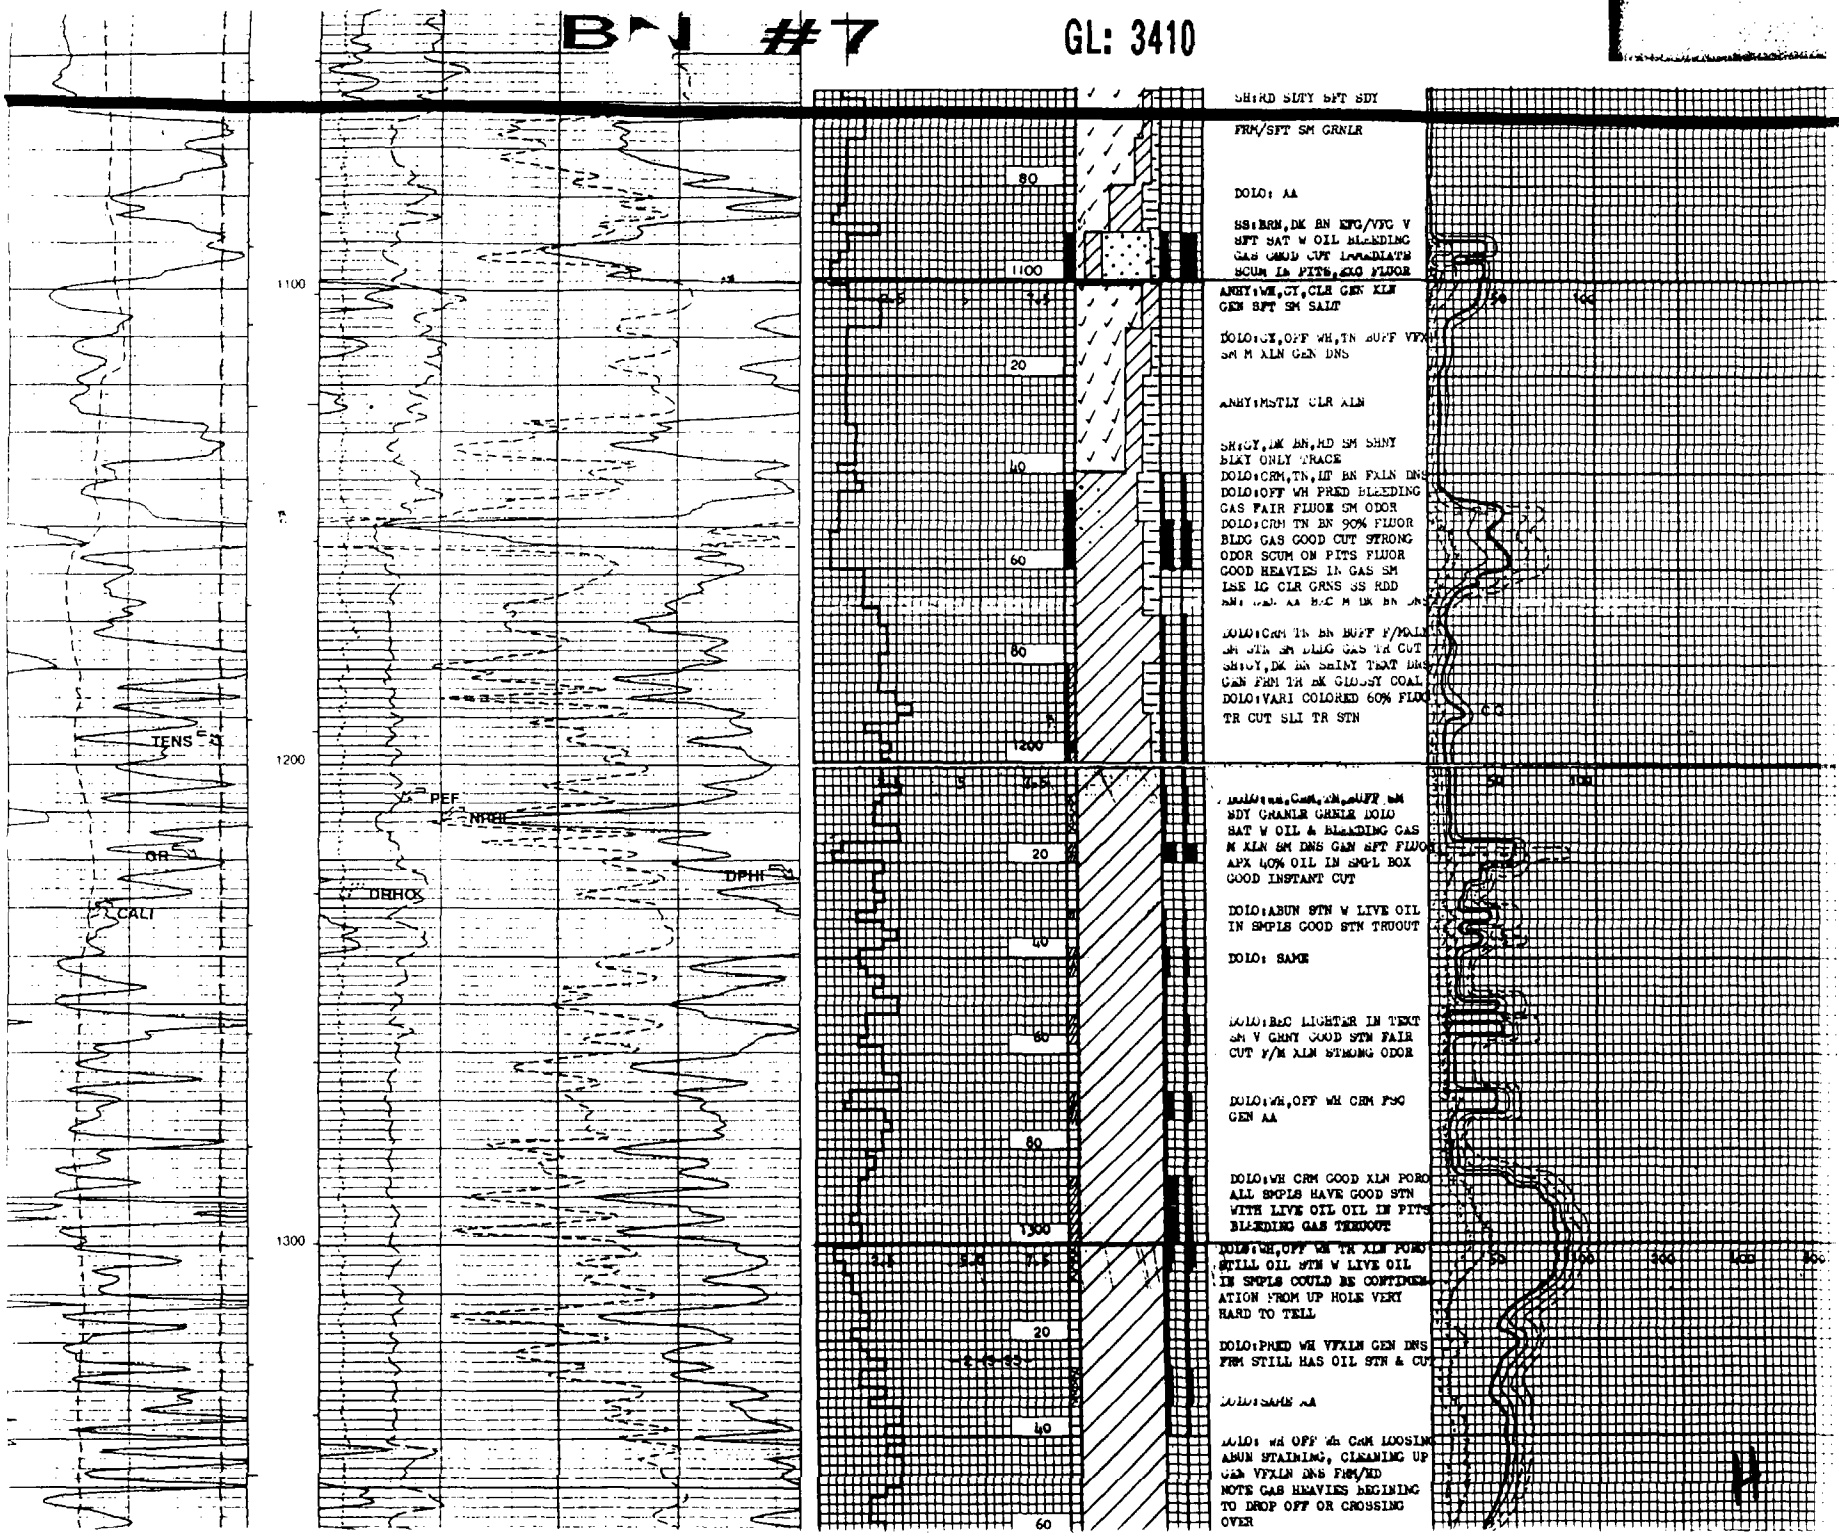
#7
GL: 3410
1100
1200
1300
TENS
GR
CALI
PEF
NPHI
DPHI
DRHO
SH:RD SLTY SFT SDY
FRM/SFT SM GRNLR
DOLO: AA
SS:BRN,DK BN VFG/VFG V
SFT SAT W OIL BLEEDING
GAS CMSD CUT IMMEDIATE
SCUM IN PITS,GLO FLUOR
ANHY:WH,CY,CLR GRN XLN
GRN SFT SM SALT
DOLO:CY,OFF WH,TN BUFF VFX
SM M XLN GRN DNS
ANHY:MSTLY CLR XLN
SH:GY,DK BN,MD SM SHNY
BLKY ONLY TRACE
DOLO:CRM,TN,LT BN FXLN DNS
DOLO:OFF WH PRED BLEEDING
GAS FAIR FLUOR SM ODOR
DOLO:CRM TN BN 90% FLUOR
BLDG GAS GOOD CUT STRONG
ODOR SCUM ON PITS FLUOR
GOOD HEAVIES IN GAS SM
LSE LG CLR GRNS SS RDD
SH: GRD AA B&C M DK BN
DOLO:CRM TN BN BUFF F/MXLN
SM STN SM BLDG GAS TR CUT
SH:GY,DK BN SmINY TRAT DNS
GRN FRM TR BK GLOSSY COAL
DOLO:VARI COLORED 60% FLUO
TR CUT SLI TR STN
SDY GRANLR GRNLR DOLO
SAT W OIL & BLEEDING GAS
M XLN SM DNS GRN SFT FLUOR
APX 40% OIL IN SMPL BOX
GOOD INSTANT CUT
DOLO:ABUN STN W LIVE OIL
IN SMPLS GOOD STN THROUT
DOLO: SAME
DOLO:BSC LIGHTER IN TEXT
SM V GRNY GOOD STN FAIR
CUT F/M XLN STRONG ODOR
DOLO:WH,OFF WH CRM FSC
GRN AA
DOLO:WH CRM GOOD XLN POR
ALL SMPLS HAVE GOOD STN
WITH LIVE OIL OIL IN PITS
BLEEDING GAS THROUT
DOLO:WH,OFF WH TN XLN POR
STILL OIL STN W LIVE OIL
IN SMPLS COULD BE CONTINUA-
ATION FROM UP HOLE VERY
HARD TO TELL
DOLO:PRED WH VFXLN GRN DNS
FRM STILL HAS OIL STN & CUT
DOLO: SAME AA
DOLO: WH OFF WH CRM LOOSING
ABUN STAINING, CLEANING UP
GRN VFXLN DNS FRM/MD
NOTE GAS HEAVIES BEGINING
TO DROP OFF OR CROSSING
OVER