Form 3160-5
(June 1990)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT--" for such proposals

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM-03283

6. If Indian, Allottee or Tribe Name

—

SUBMIT IN TRIPLICATE

7. If Unit or CA, Agreement Designation

—

1. Type of Well	8. Well Name and No.
Oil Gas	LMY ~~Federal~~ #2
☐ Well ☒ Well ☐ Other	

2. Name of Operator

Yates Drilling Company

9. API Well No.

30-041-00275

3. Address and Telephone No.

105 S. 4th St., Artesia, NM 88210 (505-748-1471)

10. Field and Pool, or Exploratory Area

Allison Penn

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1874' FNL & 1874' FWL Section 33-8S-37E

Unit F

11. County or Parish, State

Roosevelt County, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION	
☒ Notice of Intent	☒ Abandonment	☐ Change of Plans
	☐ Recompletion	☐ New Construction
☐ Subsequent Report	☐ Plugging Back	☐ Non-Routine Fracturing
	☐ Casing Repair	☐ Water Shut-Off
☐ Final Abandonment Notice	☐ Altering Casing	☐ Conversion to Injection
	☐ Other _____	☐ Dispose Water

(Note : Report results of multiple completion on Well completion or Recompletion Report and Log Form)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. TIH w/ bit & scrapper on tbg. to +/- 9560', TOH.
2. TIH w/ CIBP, set @ +/- 9502', dump 5 sacks of cement on CIBP, TOH.
3. TIH w/ tbg. to +/- 7900', spot 25 sack cement plug, TOH.
4. TIH w/ wireline, perforate @ +/- 4247', 2353', 398', TOH.
5. TIH w/ squeeze retainer #1, set @ +/- 4177', squeeze through retainer
    w/ 43 sacks of cement, dump 7 sacks on retainer, TOH.
6. TIH w/ squeeze retainer #2, set @ +/- 2333', squeeze through retainer
    w/ 43 sacks of cement, dump 7 sacks on retainer, TOH.
7. Pump down 4 1/2" casing, try to break circulation to surface, squeeze
    through perforation @ 398' w/ 40 sacks of cement, leave 10 sacks in
    4 1/2" casing.
8. Spot 5 sack surface plug. Minimum 50'.
9. Erect regulation surface marker.
10. Remove equipment and clean location.

NOTE: Mud will be spotted between all cement plugs.

14. I hereby certify that the foregoing is true and correct

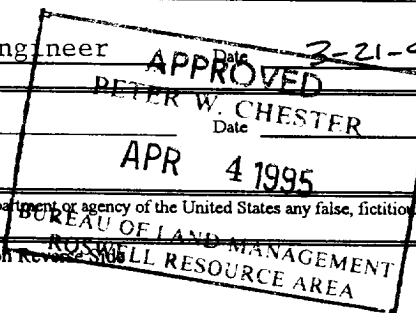Signed _____ Title Petroleum Engineer Date 3-21-95

APPROVED
PETER W. CHESTER

(This space for Federal or State office use)
Approved by _____ Title _____ Date _____
Conditions of approval, if any:

APR 4 1995

BUREAU OF LAND MANAGEMENT
ROSWELL RESOURCE AREA

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side