District.I 1625 N. French Dr., Hobbs, NM 88240 District.II 1301 W. Grand Avenue, Artesia, NM 88210 District.III 1000 Rio Brazos Road, Aztec, NM 87410 District.IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

March 4, 2004

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit to appropriate District Office State Lease - 6 Copies Fee Lease - 5 Copies

☐ AMENDED REPORT

Form C-101

APPI. Operator Nat			R PERMIT	<u>TO DRILI</u>	<u>, RE-EN</u>	ITER,	DEEPE	- 1	CK, OR	ADD A ZONE	
Nearburg Pr	oducing Co	mpany						² OGRID Number	01574	2	
3300 N Å Si Midland, TX	L, Bldg 2, S 79705	uite 120						³ API Number	. 3344	12	
³ Property Code 0									* Well No.	10	
•			·	7 8	urface Lo					-	
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	· · · · · ·	orth/South line	Feet from the	East/West	line County	
Н	2	22S	24E		2006		North	703	East	Eddy	
			8 Proposed	Bottom Hol	e Locatio	n If Di	fferent Fr	om Surface			
UL or lot no.	Section 2	Township	Range	Lot Idn	Feet from th		orth/South line North	Feet from the	East/West	line County Eddy	
9 Proposed Poo		228	24E	<u> </u>	660	10 P	Proposed Pool	1980 2	East	Eddy	
•		Indian Basi	n; Upper Penn, Asse						_		
			Dri	lling Pit Loc	ation and	l Other	<u>Informat</u>	ion		<u> </u>	
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	he No	orth/South line	Feet from the	East/West	line County	
	2	228	24E	1 =: .	1850		North	503	East	Eddy	
Depth to ground water		er rancher)		Distance from nea fresh water well	1 mil	le		Distance from nearest surface water		1/2 mile	
Work Type C	ode	¹² We	ll Type Code	13 Cab	le/Rotary		14 Lease	Type Code	15 Gro	ound Level Elevation	
Nultiple N		17 Pro	O posed Depth	¹⁸ For	Rotary	ry S 19 Contractor			3866' 20 Spud Date		
N			8600'		isco Can	yon		terson/ UTI		6/15/04	
			21	Proposed C	asing and	Ceme	nt Progra	m			
Hole S	ize	Casi	ng Size	Casing weigh	t/foot	Settin	g Depth	Sacks of Cer	ment	Estimated TOC	
14-3	/4	9.	-5/8	36#		15	500'	800		Circ to Surface	
8-3/	4		7	23# and 2	26#	86	500'	1000		Circ to Surface	
										70.1901	
					:						
							data on the p	resent productive zo	ne and prop	posed new productive zone.	
				additional sheets ent depth to eva			on formation	n. After reaching	TD, logs v	will be run and csg set if	
				mulate as neces				Ü	, ,	Ū	
Acreage ded	ication is	320 acres;	E/2 of Section	2.		1					
best of my kn	owledge an	d belief. I fu	rther certify tha	ue and complete	will be	20	OIL C	CONSERVAT	ION DI	VISION	
			guidelines ᡌ, a roved plan □.	general permit [· •¶	pproved b	nv.		-		
	A		10.1			ррготов с	,y.	Jens) let_	George	
Signature:			Ldl_			•.•		D:	Tro-	Side	
Printed name: Title: Produ						itle: pproval D	Date: 'NIN	0 4 2004 Ex	piration Da	ate: IIIN o a com	
E-mail Addres			com			pprovat D	991	U 1 200 E)	phanon Da	W SUN U 4 ZIN	
Date:	1	1	_	586-8235 x 203	C	onditions	of Approval:	- Notify (OCD TO	O WITNESS	
6.4	1.04	4	131032		1	ttached [ALL CASI			

State of New Mexico

DISTRICT I P.O. Box 1980, Hobba, NK 88241-1980

Energy, Minerals and Natural Resources Department

Form C-102
Revised February 10, 1994
Submit to Appropriate District Office
State Lease - 4 Copies
Fee Lease - 3 Copies

OISTRICT II P.O. Drawer DD, Artesia, NM 88211-0719

OIL CONSERVATION DIVISION

P.O. Box 2088

DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fe, New Mexico 87504-2088

DISTRICT IV 2.0. BOX 2088, SANT	A PR. N.M. 87	504-2088	WELL LC	CATION	N AND ACREA	GE DEDICATI	ON PLAT	□ AMENDI	ED REPORT
	Number		1	Pool Code	Fo	dianba	Pool Name	erfeno. F	155.
Property (Code				Property Nam	ie	y	Well Num	
<u> </u>	15	BIG WALT "2" STATE 10 Operator Name Elevation							
0157L	_		N	EARBUI		NG COMPANY		Elevation 3866	
					Surface Loc	ation			
UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
Н	2	22-S	24-E		2006'	NORTH	703'	EAST	EDDY
			Bottom	Hole Lo	ocation If Diffe	erent From Sur	face		
UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
2	2	22-S	24-E		660'	NORTH	1980'	EAST	EDDY
NO ALLO	\overline{L}	VILL BE A		то тніѕ		JNTIL ALL INTER		EEN CONSOLIDA	ATED
LOT 4			OT 3	17/	012/	LOT 1	7).		
52.56 AC		52.	#3. Y=5188 X=4588 46 AC	5.00RDINA 7.NME 87.00RDINA 7.NME 87.006.1 E	2.38 AC 77.	-1980'	I hereby certify on this plat us actual surveys supervison, an correct to the certification of the correct to the certain desired to the correct to the certain desired to the certain correct to the certain	OR CERTIFICAT If that the well locat as plotted from field made by me or ad that the same is a best of my belie IN 11, 2004	TION I notes of under my true and
								OF SOLUTION	12641

District I 1625 N. French Dr., Hobbs, NM 88240 District II 1301 W. Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy, Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For drilling and production facilities, submit to appropriate NMOCD District Office.


For downstream facilities, submit to Santa Fe

Form C-144


March 12, 2004

Pit or Below-Grade Tank Registration or Closure

Is pit or below-grade tank covered by a "general plan"? Yes \(\sum No \) \(\text{X}\) Type of action: Registration of a pit or below-grade tank X Closure of a pit or below-grade tank Operator: Nearburg Producing Company Telephone: 686-8235 e-mail address: sjordan@nearburg.com Address: 3300 N A St., Bldg 2, Ste 120, Midland, TX 79705 U/L or Out H Sec 2 T22S R 24E Facility or well name: Big Walt 2 State #10 API #: Latitude 32.75 27.36 Longitude 104.27 44.27 NAD: 1927 X 1983 Surface Owner Federal State Private Indian Pit Below-grade tank Type: Drilling X Production Disposal Volume: ____bbl Type of fluid: __ Workover Emergency Construction material: ____ Double-walled, with leak detection? Yes I If not, explain why not. Lined X Unlimited Liner type: Synthetic X Thickness ___12mil Clay Volume Less than 50 feet (20 points) Depth to ground water (vertical distance from bottom of pit to seasonal high 50 feet or more, but less than 100 feet (10 points) water elevation of ground water.) 100 feet or more (0 points) Wellhead protection area. (Less than 200 feet from a private domestic (20 points) water source, or less than 1000 feet from all other water sources.) No (0 points) Χ Less than 200 feet (20 points) Distance to surface water: (horizontal distance to all wetlands, playas, 200 feet or more, but less than 1000 feet (10 points) irrigation canals, ditches, and perennial and ephemeral watercourses.) 1000 feet or more (0 points) Ranking Score (Total Points) 0 If this is a pit closure: (1) attach a diagram of the facility showing the pit's relationship to other equipment and tanks. (2) Indicate disposal location: onsite offsite If offsite, name of facility _____(3) Attach a general description of remedial action taken including remediation start date and end date. (4) Groundwater encountered: No Tyes Tifyes, show depth below ground surface ft. and attach sample results. (5) Attach soil sample results and a diagram of sample locations and excavations. I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that the above-described pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines [X], a general permit [], or an (attached) alternative OCD-approved plan []. Date: 6/4/04 Printed Name/Title: Sarah Jordan, Production Analyst Your certification and NMOCD approval of this application/closure does not relieve the operator of liability should the contents of the pit or tank contaminate ground water or otherwise endanger public health or the environment. Nor does it relieve the operator of its responsibility for compliance with any other federal, state, or local laws and/or regulations.

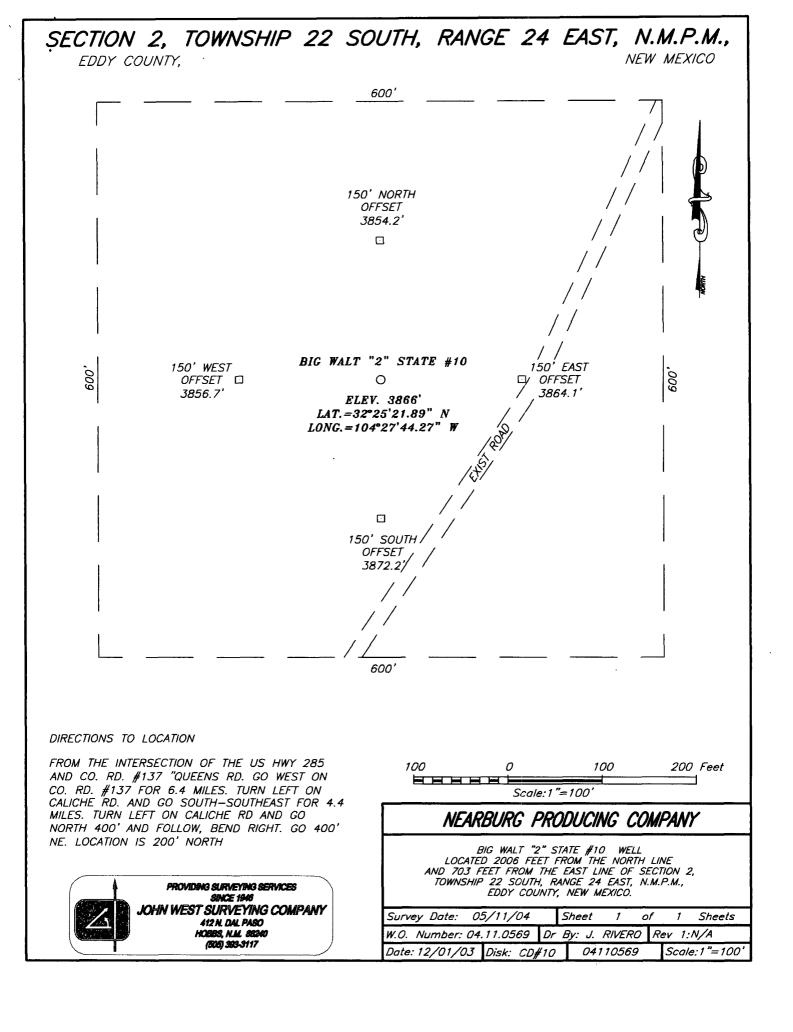

VICINITY MAP

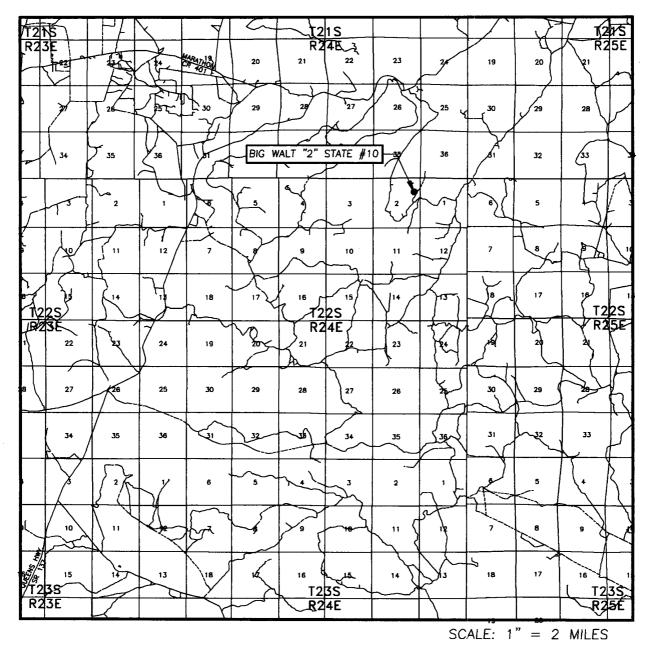

SEC. 2 TWP. 22-S RGE. 24-E

SURVEY N.M.P.M.

COUNTY EDDY

DESCRIPTION 2006' FNL & 703' FEL

ELEVATION 3866'


NEARBURG PRODUCING COMPANY

LEASE BIG WALT "2" STATE





LOCATION VERIFICATION MAP

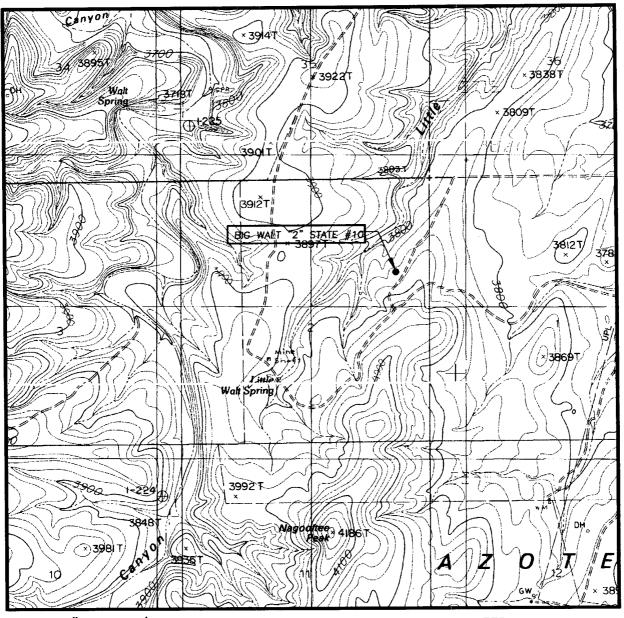

SCALE: 1" = 2000'

CONTOUR INTERVAL: AZOTEA PEAK, N.M. – 10'

SEC. 2 TWP. 22-S RGE. 24-E

SURVEY N.M.P.M.

COUNTY EDDY

DESCRIPTION 2006' FNL & 703' FEL

ELEVATION 3866'

NEARBURG PRODUCING
OPERATOR COMPANY


LEASE BIG WALT "2" STATE

U.S.G.S. TOPOGRAPHIC MAP
AZOTEA PEAK, N.M.






ARBURG PRODUCING COMPAINT BOPE SCHEMATIC

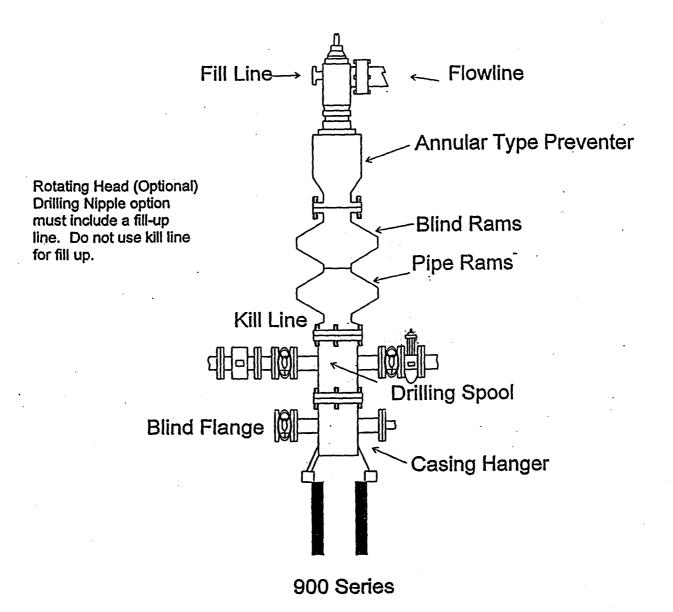

NEARBURG PRODUCING COMPANY CHOKE MANIFOLD 2M AND 3M SERVICE

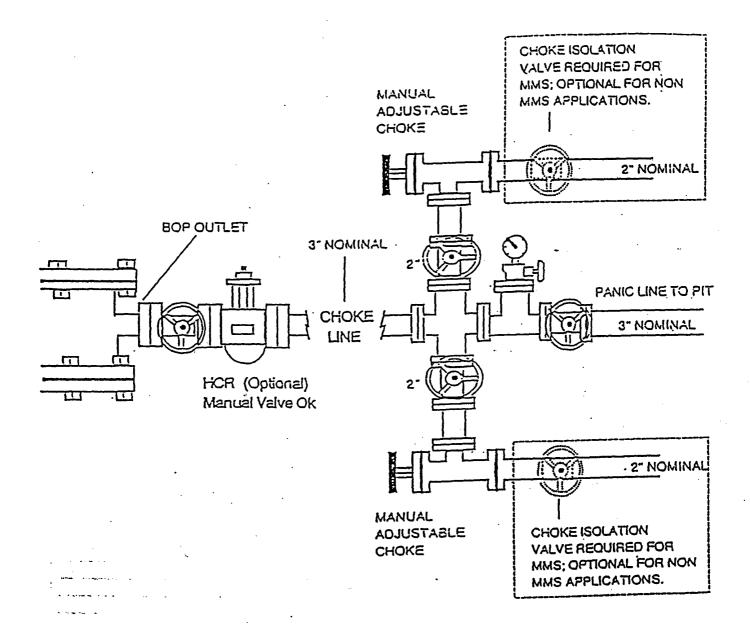

DRILLING FLUID SYNOPSIS

NEARBURG PRODUCING CORPORATION

BIG WALT 2 STATE # 10 Section 2 T-22-S R-24-E Eddy County, New Mexico

CASING

9 5/8" at 1,600'

5 1/2" at 8,600'

DEPTH	MUD WEIGHT	VISCOSITY	FLUID LOSS	DRILL SOLIDS	COMMENTS
0-1,600'	8.4 to 8.5	28 to 29	No Control	<1%	Fresh Water, Fresh Gel Sweeps, Lime, Paper
1,600'-8,600'	8.4 to 8.5	28 to 29	No Control	<1%	Fresh Water, Star NP-110, Paper, Lime Starch if needed

ESTIMATED FORMATION TOPS

 SAN ANDRES
 530'

 DELAWARE
 1,598'

 BONE SPRINGS
 2,774'

 WOLFCAMP
 7,460'

 PENN (CISCO)
 7,860'

 CANYON
 7,995'

 TD
 8,600'

RECOMMENDED CASING PROGRAM

9 5/8" at 1,600'

5 1/2" at 8,600'

RECOMMENDED DRILLING FLUID PROGRAM

DEPTH	WEIGHT_	VISCOSITY	FILTRATE
0-1,600'	8.4-8.5	28-29	No Control

Spud with fresh water circulating through the working pits. Sweep the hole with Fresh Water Gel flocculated with Lime mixed at a 10 to 1 ratio. Use Paper for seepage control. There is a potential for lost returns in this interval. If lost returns are encountered and circulation cannot be regained after pumping several viscous LCM pills, you should consider dry drilling to casing point. While dry drilling, we recommend periodically pumping viscous LCM sweeps to prevent solid accumulation in annulus.

DEPTH	WEIGHT	VISCOSITY	<u>FILTRATE</u>
1,300'-8,800'	8.4-8.5	28-29	No Control

Drill out from under surface with fresh water circulating through the reserve pit. Use Star NP-110 for sweeps and to control solids. Use Lime for 9.0 to 10.0 pH. Paper should be used for seepage. The hole should be swept every 200', or as needed, with pre-hydrated Fresh Water Gel. This will minimize solids buildup in the annulus and reduce the possibility of lost circulation while drilling the Upper Penn and other under pressured formations. There is a potential for lost returns in this interval. If lost returns are encountered and circulation cannot be regained after pumping several viscous LCM pills, you should consider dry drilling to casing point. While dry drilling, we recommend periodically pumping viscous LCM sweeps, to prevent solid accumulation in annulus. There is a possibility of encountering H_2S from the Bone Springs as well as the Upper Penn. If H_2S is encountered, we recommend additions of an H_2S Scavenger for personnel safety and a Filming Amine to protect the drill pipe. We recommend utilizing a ± 200 bbl premix pit for sweeps and LCM pills.


Note: we recommend a blend of Fiber Plug, Nut Shell, Maxi-Seal (Chem-Seal), and Mica may be used as LCM in this interval.

If a drilling fluid is desired for evaluation of this interval, we recommend returning to the working pits and utilizing a Star NP-110/Starch type fluid. Use Starch to reduce the API fluid loss below 15cc. Maintain pH at 9.0 to 10.0 with Lime. If additional viscosity is desired we recommend using Fresh Gel. This fluid should be sufficient for evaluation in this area.

Estimated Drilling Fluid Cost: \$4,000.00 to \$5,000.00 Estimated Drilling Days: 13 to 16

Cost is based on a 1,000 bbl system and does not reflect lost circulation, abnormal pressure, H₂S, unstable hole conditions requiring elevated viscosities or mud in production interval.

Nearburg Producing Company

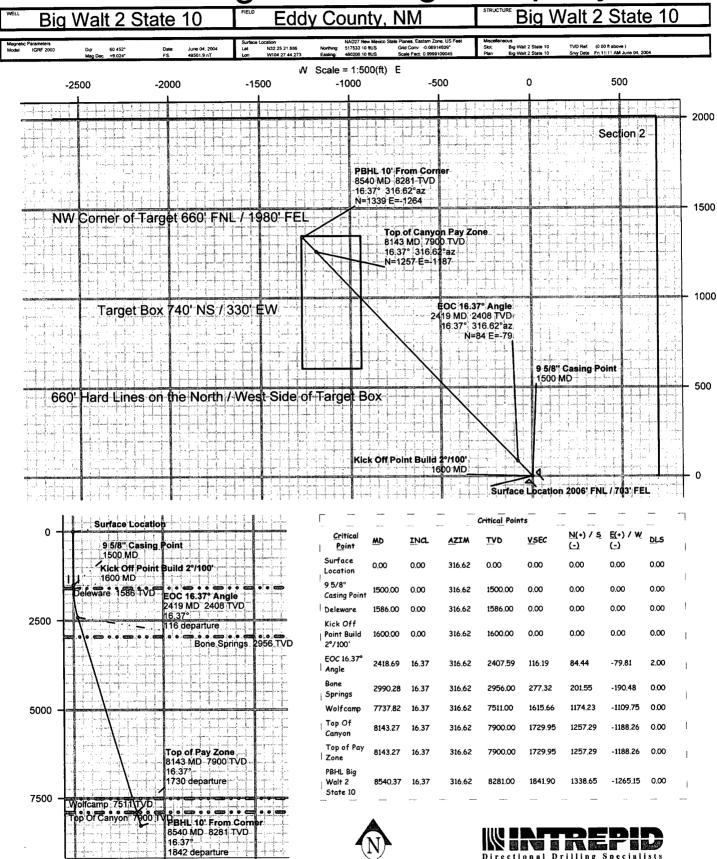

Departure (ft) Azim = 316.617°, Scale = 1:2500 Origin = 0 N/-S, 0 E/-W

5000

2500



Proposal

Report Date: June 4, 2004

Client: Nearburg Producing Company

Field: Eddy County, NM

Structure / Slot: Big Walt 2 State 10 / Big Walt 2 State 10

Well: Big Walt 2 State 10 Borehole: Big Walt 2 State 10

UWI/AP#:

Survey Name / Date: Big Walt 2 State 10 / June 4, 2004

Tort / AHD / DDI / ERD ratio: 16.374° / 1841.90 ft / 4.493 / 0.222

Grid Coordinate System: NAD27 New Mexico State Planes, Eastern Zone, US Feet

Location Lat/Long: N 32 25 21.886, W 104 27 44.273 Location Grid N/E Y/X: N 517533.100 ftUS, E 460206.100 ftUS

Grid Convergence Angle: -0.06914609° Grid Scale Factor: 0.99991090

Survey / DLS Computation Method: Minimum Curvature / Lubinski

Vertical Section Azimuth: 316.617°

Vertical Section Origin: N 0.000 ft, E 0.000 ft

TVD Reference Datum:

TVD Reference Elevation: 0.0 ft relative to Sea Bed / Ground Level Elevation: 0.000 ft relative to

Magnetic Declination: 9.024° Total Field Strength: 49501.908 nT Magnetic Dip: 60.452°

Declination Date: June 04, 2004 Magnetic Declination Model: IGRF 2000

North Reference: Grid North

Total Corr Mag North -> Grid North: +9.093° Local Coordinates Referenced To: Well Head

Comments	Measured Depth	Inclination	Azimuth	TVD	Vertical Section	NS	EW	DLS	Tool Face	Northing	Easting
	(ft)	(deg)	(deg)	(ft)	(ft)	(ft)	(ft)	(deg/100 ft)	(deg)	(ftUS)	(ftUS)
Surface Location	0.00	0.00	316.62	0.00	0.00	0.00	0.00	0.00	-43.38M	517533.10	460206.10
9 5/8" Casing Point	1500.00	0.00	316.62	1500.00	0.00	0.00	0.00	0.00	-43.38M	517533.10	460206.10
Deleware	1586.00	0.00	316.62	1586.00	0.00	0.00	0.00	0.00	-43.38M	517533.10	460206.10
Kick Off Point Build 2°/100'	1600.00	0.00	316.62	1600.00	0.00	0.00	0.00	0.00	-43.38M	517533.10	460206.10
	1700.00	2.00	316.62	1699.98	1.75	1.27	-1.20	2.00	-43.38M	517534.37	460204.90
	1800.00	4.00	316.62	1799.84	6.98	5.07	-4.79	2.00	-43.38M	517538.17	460201.31
	1900.00	6.00	316.62	1899.45	15.69	11.41	-10.78	2.00	0.00G	517544.50	460195.32
	2000.00	8.00	316.62	1998.70	27.88	20.26	-19.15	2.00	0.00G	517553.36	460186.95
	2100.00	10.00	316.62	2097.47	43.52	31.63	-29.89	2.00	0.00G	517564.73	460176.21
	2200.00	12.00	316.62	2195.62	62.60	45.50	-43.00	2.00	0.00G	517578.59	460163.10
	2300.00	14.00	316.62	2293.06	85.10	61.85	-58.45	2.00	0.00G	517594.94	460147.65
	2400.00	16.00	316.62	2389.64	110.98	80.66	-76.23	2.00	0.00G	517613.75	460129.88
EOC 16.37° Angle	2418.69	16.37	316.62	2407.59	116.19	84.44	-79.81	2.00	0.00G	517617.53	460126.30
Bone Springs	2990.28	16.37	316.62	2956.00	277.32	201.55	-190.48	0.00	0.00G	517734.63	460015.63
Wolfcamp	7737.82	16.37	316.62	7511.00	1615.66	1174.23	-1109.75	0.00	0.00G	518707.22	459096.45
Top Of Canyon	8143.27	16.37	316.62	7900.00	1729.95	1257.29	-1188.26	0.00	0.00G	518790.28	459017.95
Top of Pay Zone	8143.27	16.37	316.62	7900.00	1729.95	1257.29	-1188.26	0.00	0.00G	518790.28	459017.95
PBHL Big Walt 2 State	8540.37	16.37	316.62	8281.00	1841.90	1338.65	-1265.15	0.00	0.00G	518871.63	458941.07



Proposal

Report Date: June 4, 2004

Client: Nearburg Producing Company

Field: Eddy County, NM

Structure / Slot: Big Walt 2 State 10 / Big Walt 2 State 10

Well: Big Walt 2 State 10 Borehole: Big Walt 2 State 10

UWI/AP#:

Survey Name / Date: Big Walt 2 State 10 / June 4, 2004
Tort / AHD / DDI / ERD ratio: 16.374° / 1841.90 ft / 4.493 / 0.222

Grid Coordinate System: NAD27 New Mexico State Planes, Eastern Zone, US Feet

Location Lat/Long: N 32 25 21.886, W 104 27 44.273 Location Grid N/E Y/X: N 517533.100 ftUS, E 460206.100 ftUS

Grid Convergence Angle: -0.06914609°
Grid Scale Factor: 0.99991090

Survey / DLS Computation Method: Minimum Curvature / Lubinski

Vertical Section Azimuth: 316.617°

Vertical Section Origin: N 0.000 ft, E 0.000 ft TVD Reference Datum:

TVD Reference Elevation: 0.0 ft relative to Sea Bed / Ground Level Elevation: 0.000 ft relative to

Magnetic Declination: 9.024°
Total Field Strength: 49501.908 nT

Magnetic Dip: 60.452°
Declination Date: June 04, 2004
Magnetic Declination Model: IGRF 2000

North Reference: Grid North
Total Corr Mag North -> Grid North: +9.093°
Local Coordinates Referenced To: Well Head

Comments	Measured Depth	Inclination	Azimuth	TVD	Vertical Section	NS	EW	DLS	Tool Face	Northing	Easting
	(ft)	(deg)	(deg)	(ft)	(ft)	(ft)	(ft)	(deg/100 ft)	(deg)	(ftUS)	(ftUS)
Surface Location	0.00	0.00	316.62	0.00	0.00	0.00	0.00	0.00	-43.38M	517533.10	460206.10
9 5/8" Casing Point	1500.00	0.00	316.62	1500.00	0.00	0.00	0.00	0.00	-43.38M	517533.10	460206.10
Deleware	1586.00	0.00	316.62	1586.00	0.00	0.00	0.00	0.00	-43.38M	517533.10	460206.10
Kick Off Point Build 2°/100'	1600.00	0.00	316.62	1600.00	0.00	0.00	0.00	0.00	-43.38M	517533.10	460206.10
	1700.00	2.00	316.62	1699.98	1.75	1.27	-1.20	2.00	-43.38M	517534.37	460204.90
	1800.00	4.00	316.62	1799.84	6.98	5.07	-4.79	2.00	-43.38M	517538.17	460201.31
	1900.00	6.00	316.62	1899.45	15.69	11.41	-10.78	2.00	0.00G	517544.50	460195.32
	2000.00	8.00	316.62	1998.70	27.88	20.26	-19.15	2.00	0.00G	517553.36	460186.95
	2100.00	10.00	316.62	2097.47	43.52	31.63	-29.89	2.00	0.00G	517564.73	460176.21
	2200.00	12.00	316.62	2195.62	62.60	45.50	-43.00	2.00	0.00G	517578.59	460163.10
	2300.00	14.00	316.62	2293.06	85.10	61.85	-58.45	2.00	0.00G	517594.94	460147.65
	2400.00	16.00	316.62	2389.64	110.98	80.66	-76.23	2.00	0.00G	517613.75	460129.88
EOC 16.37° Angle	2418.69	16.37	316.62	2407.59	116.19	84.44	-79.81	2.00	0.00G	517617.53	460126.30
Bone Springs	2990.28	16.37	316.62	2956.00	277.32	201.55	-190.48	0.00	0.00G	517734.63	460015.63
Wolfcamp	7737.82	16.37	316.62	7511.00	1615.66	1174.23	-1109.75	0.00	0.00G	518707.22	459096.45
Top Of Canyon	8143.27	16.37	316.62	7900.00	1729.95	1257.29	-1188.26	0.00	0.00G	518790.28	459017.95
Top of Pay Zone	8143.27	16.37	316.62	7900.00	1729.95	1257.29	-1188.26	0.00	0.00G	518790.28	459017.95
PBHL Big Walt 2 State	8540.37	16.37	316.62	8281.00	1841.90	1338.65	-1265.15	0.00	0.00G	518871.63	458941.07

Nearburg Producing Company

Big Walt 2 State 10 Eddy County, NM Big Walt 2 State 10 Gnd Conv -0.0091+0009 Scele Fact 0 9999109045 W Scale = 1:500(ft) E -500 0 500 -2500 -2000 -1500 -1000 2000 Section 2 PBHL 10' From Corner 8540 MD 8281 TVD 16:37° 316:62°az N=1339 E=-1264 1500 NW Corner of Target 660' FNL / 1980' FEL Top of Canyon Pay Zone 8143 MD 7900 TVD 16:37° 316:62°az N=1257 E=-1 87 1000 ÉOC 16.37° Angle Target Box 740' NS / 330' EW 2419 MD 2408 TVD 16.37° 316.62°az N=84 F=-79 9 5/8" Casing Point 1500 MD 500 Hard Lines on the North / West Side of Target Box Kick Off Point Build 2°/100' 0 Surface Location 2006' FNL / 703' FEL Critical Points Surface Location 0 Critical N(+) / 5 E(+) / W MD INCL AZIM TVD **VSEC** 9 5/8" Casing Point <u>Point</u> <u>(-)</u> **(-)** 1500 MD Surface 0.00 0.00 0.00 0.00 0.00 0.00 Kick Off Point Build 2º/100' 0.00 316.62 Location 1600 MD 9.5/8" Deleware 1586 TVD 0.00 0.00 1500.00 316.62 1500.00 0.00 0.00 0.00 EOC 16.37° Angle Casing Point 2419 MD 2408 TVD 1586.00 0.00 316,62 1586.00 0.00 0.00 0.00 0.00 2500 Kick Off 116 departure Point Build 1600.00 1600.00 0.00 0.00 0.00 0.00 Bone Springs 2956 TVD 2°/100' EOC 16.37 -79.81 2418 69 2407 59 116 19 84.44 2.00 16.37 316 62 Angle Bone 2990.28 16,37 316.62 2956 00 277 32 201.55 -190.480.00 | Springs 1174.23 -1109.75 5000 Wolfcamp 7737.82 16.37 316.62 7511.00 1615.66 Top Of 8143,27 16.37 316.62 7900.00 1729.95 1257.29 -1188.26 0.00 Canyon Top of Pay Top of Pay Zone 8143 MD 7900 TVD 8143 27 16 37 316.62 7900.00 1729 95 1257 29 -1188 26 0.00 Zone PBHL Big Walt 2 -1265.15 1730 departure 8540.37 16.37 8281.00 1841.90 State 10 7500 Top Of Canyon 7000 PBHL 10' From Corner 8540 MD 8281 TVD 16.37 1842 departure Directional Drilling Specialists

0 2500 5000 Departure (ft) Azim = 316.617°, Scale = 1:2500 Origin = 0 N/-S, 0 E/-W

Nearburg Producing Company

3300 N A St., Bldg 2, Suite 120 Midland, TX 79705

Hydrogen Sulfide (H2S) Contingency Plan

For

Big Walt 2 State #10 SHL: 2006' FNL and 703' FEL BHL: 660' FNL and 1980' FEL Sec. 2, T22S, R24E Eddy County, New Mexico

And

Patterson Drilling Rig #512

TABLE OF CONTENTS

		SECTION
PURPOSE		1
SCOPE		2
DEFINITIONS		3
THE PLAN		4
DISTRIBUTION AN	ID REVIEW	5
APPROVALS		6
APPENDIX A	ROE calculation data	7
APPENDIX B	Contact Information	8
APPENDIX C	Site specific plans	9
APPENDIX D	Emergency Equipment	10
APPENDIX E	Layout Diagram	11
APPENDIX F	Revision Log	12

1. PURPOSE

This plan is intended to protect the health and safety of the public, contractors and Nearburg Producing Company (NPC) personnel should an unanticipated release of a potentially hazardous volume of Hydrogen Sulfide (H2S) occur.

Further to:

- Comply with the Bureau of Land Management's (BLM) Onshore Oil and Gas Operations Onshore Oil and Gas Order No. 6, Hydrogen Sulfide Operations (43 CFR Part 3160).
- Comply with the State of New Mexico Oil Conservation Division's (NMOCD) rule 19 NMAC 15.C 118.
- Assure proper notification of the appropriate parties and agencies.

2. SCOPE

The provisions of this document are intended to address Hydrogen Sulfide (H2S) releases and H2S emergencies at Nearburg Producing Companies production batteries and all surrounding operated field locations in the McKittrick Hills Field. Facilities for which calculations indicate a potential hazardous volume of H2S could occur have additional site specific response information and radius of exposure drawn on the attached plat map. The field is located approximately 20 miles west of Carlsbad, New Mexico (Eddy County).

This plan is intended to be used in conjuction with the Emergency Response plan that is available at the Artesia Field Office and applies to RMS Level 1 incidents.

3. **DEFINITIONS**

All Clear - Notification of effected personnel, by the response leader, that the incident has ended and the area is safe to re-enter.

A Potentially Hazardous Volume - a volume of Hydrogen Sulfide (H2S) gas of such concentrate that:

- The 100-ppm ROE includes any public area.
- The 500-ppm ROE includes any public road.
- The 100-ppm ROE exceeds 3,000 feet.

Facility – Equipment involved in producing, processing, or transporting natural gas and/or crude oil, including the property to the edge of the pad or fence.

Hydrogen Sulfide Gas (H2S) – is extremely flammable, colorless, poisonous gas that may occur naturally as a component of production streams, such as crude oil, produced water and natural gas. At low concentrations it has a rotten egg odor, but at higher concentrations deadens the sense of smell. Its specific gravity is heavier than air giving it a tendency to collect in low-lying areas on still days. The permissible exposure limit is 10 ppm and the short term exposure limit is 15 ppm. It is considered to be immediately dangerous to life and health at 300 ppm. H2S is readily dispersed in air and is water soluble.

ICS (Incident Command System) – A team based concept for emergency response in which roles and responsibilities are predetermined.

Incident Commander (IC) – Senior Nearburg Producing Company employee in charge of an emergency response.

Incipient Stage Fire – A fire in the beginning or very early stages of development, which can be effectively extinguished by one or more persons with portable fire fighting equipment.

Muster Site - A pre-defined staging or meeting area.

RMS Level I – an emergency that can be reasonably addressed by Artesia Area Office in which the incident occurs and that can be resolved in approximately two days or less.

ROE (Radius of Exposure) – The radius constructed with the point of escape (of gas) as its starting point and its length calculated using the Pasquill-Gifford derived equation or computer modeling where the H2S concentration is greater than 10%.

PPM - Parts per Million

Public Area – Any building or structure that is not associated with the well, facility or operation for which the ROE is being calculated and that is used as a dwelling, office, place of business, church, school, hospital or government building, or any portion of a park, city, town, village, or designated school bus stop or other similar area where members of the public may reasonably be expected o be present.

Public Road - Any federal, state, municipal or county road or highway.

Serious Incident – An event which results or has the potential to result in severe personal injury and/or significant equipment damage.

Sulfur Dioxide (SO2) – A heavy colorless toxic gas that is formed when hydrogen sulfide is burned. It has a pungent odor and is a respiratory irritant. The permissible exposure limit is 2 ppm, the short rem exposure limit is 5 ppm. It is considered to be immediately dangerous to life and health at 100 ppm. SO2 is readily dispersed in air and is water soluble.

Total Personnel Evacuation – An evacuation of all persons (contract employees, or visitors) from the emergency area to a muster area.

4. THE PLAN

Training:

All personnel (company, contractors and sub-contractors) working in the field for NPC are required to complete hydrogen sulfide training before beginning work and annually thereafter.

Training on the contents of this plan shall be provided to all NPC and appropriate contract personnel working for NPC:

- whenever the employees' responsibilities or designated actions under the plan change,
- whenever the contents of the plan are changed/revised
- whenever a new employee begins employment, and
- periodically as needed for all employees.

Nearburg Producing Company supervision is responsible for this training.

Orientation:

All persons visiting or working at Indian Basin shall receive an orientation covering the following minimum items:

	What types of emergencies are possible,
	What the emergency evacuation alarm sounds like in the gas plant,
	How to report an incident/emergency,
	Who will be in charge during an emergency,
	How to safely evacuate the plant, and
П	Where to assemble so that all persons can be accounted for

The NPC representative responsible for the contractors or visitors shall conduct the orientations and shall document attendees and dates.

H2S Monitors:

All personnel working at the Indian Basin are required to wear personal H2S monitor at all times when working in the plant or field. Monitors should have a vibrating alarm if used in high noise areas.

Activation:

Phase I – activated when:

- 1. Sustained H2S concentration reaches 10 parts per million (ppm) in any work area and the source is not readily identified and/or controllable.
- 2. Continuous H2S levels are detected at 10 ppm (or greater) at any public road, near an occupied residence or bus stop, and the source is not readily identified and/or immediately controlled.

Phase II – activated when:

- 1. A potentially hazardous volume of H2S is detected.
- 2. When sustained H2S concentrations exceed 50 ppm at any facility boundary.

Phase I:

Upon discov	ery o	on-site personnel should:
		Make others on-site aware of the presence of H2S and leave the area upwind or
		crosswind to a safe location. (Pre-determine if a pre-job tailgate meeting was conducted).
		Prevent unauthorized persons from entering the area. Request assistance if needed.
		If a residence or other public area is in the vicinity, monitor for H2S to ensure exposure is
		less than 10 ppm. Notify supervisor if higher exposures are noted or if any other
		questions arise about steps necessary to protect these sensitive areas.
		If considering re-entering the area to assess the H2S source, ensure you have been
		properly trained to respond. Use an H2S monitor with digital display (preferably a multigas monitor) and have a supplied air respirator (SAR) and back up person with SAR
		readily available. Consider notification of supervisor if appropriate.
		Proceed with caution. If H2S concentration reaches 10 ppm in your breathing zone, back
	ш	out and use SAR to re-enter. If H2S concentration reaches 50 ppm at the facility
		boundary, immediately notify supervision.
		If source can be safely controlled, monitor area to ensure H2S levels are below 10 ppm.
		End response here and sound all clear to allow others to re-enter the area. Report length
		of release and volume to supervisor.
		If the source of H2S cannot be identified and/or controlled, or if you cannot do so with
	_	out exposing yourself to danger, leave the area to a safe distance.
		Notify supervision.
		Continue to monitor for H2S and maintain site security until instructed be supervision to do otherwise.
Supervision:		
		Gather necessary information to determine the course of action and level of response.
		Mobilize any additional man power or equipment necessary.
		Ensure Phase II measures are implemented if appropriate.
		Continue to monitor situation until incident is over.
		Make notifications if required.
		Complete reports if required.
		Investigate as indicated.
Phase II		
Upon discov	ery (on-site personnel should:
		Make others on-site aware of the presence of H2S and leave the area upwind or
		crosswind to a safe location. (Pre-determined if a pre-job tailgate meeting was
		conducted).
		Prevent authorized persons from entering the area.
		Notify Supervisor.
Supervision:		
		Initiate the <u>Incident Command System</u> as deemed appropriate.
		Mobilize the resources necessary to maintain site security and provide for the protection
	_	of personnel and the public.
		Issue warnings to all NPC personnel by radio and/or phone (IB Contact List) to make
		them aware of the incident and its location. Have non-essential personnel leave the area. If deemed necessary, order a total personnel evacuation of the area.

□ Notify non-company personnel known to work or reside in the area (IB Contact List). If

	necessary to ensure their safety, dispatch NPC personnel with the appropriate monitor, supplied air respirators and means of communication to these locations. (Appendix B)
	Have NPC personnel set up road blocks to prevent unauthorized entry into impacted areas until relieved by law enforcement or other authorized personnel.
	Make all appropriate notifications to NPC, Federal, State and local authorities.
	When the release has been contained and monitoring indicates the area is safe to re-enter, terminate operations and sound the all clear.
	Complete records if required.
	Investigate as indicated.
	For spills, well blowouts, fires, natural disasters and terrorist or bomb threats
•	anel not involved in the immediate response:
	If a total evacuation is ordered, report to the incident command center or nearest muster site to which you have safe access. (See Appendix A for muster site locations)
•	If a total evacuation is ordered, report to the incident command center or nearest muster
	If a total evacuation is ordered, report to the incident command center or nearest muster site to which you have safe access. (See Appendix A for muster site locations) Ensure all contract personnel working for you (or in your area) are accounted for and

Ignition of H2S:

While no uncontrollable release of H2S is anticipated, should ignition of gas be necessary for the protection of personnel or the public, the determination would be made by the NPC Incident Commander. The method of ignition will maintain the safety of the person performing this task as the primary concern. The most likely method would be the use of a flare gun from a safe distance.

If this becomes necessary, monitoring will include sulfur dioxide (SO2) in addition to H2S.

6. APPROVALS

Approved by: N

Name:

Title: Drilling Manager

Date:

NEARBURG PRODUCING COMPANY REGULATORY CONTACTS

	Contact Name					
Agency	First	Last	Division/Area	Main Phone#	Cell Phone	Home Phone #
NMOCD	Emergency Number		District 2	505-746-4302		
NMOCD	Field Rep On-Call		District 2	505-939-8622		
NMOCD	Tim	Gum	District 2	505-748-1283	505-626-0824	505-324-1387
NMOCD	Mike	Stubblefield	District 2	505-748-1283	505-626-0831	505-746-6422
NMOCD	Gerry	Guye	District 2	505-748-1283	505-626-0843	505-887-3254
NMOCD	Phil	Hawkins	District 2	505-748-1283	505-626-0836	505-746-9272
NMOCD	Bryan	Arrant	District 2	505-748-1283	505-626-0830	505-748-2092
NMOCD	Lori	Wortenberhy	Santa Fe Division Ofc.	505-827-7131	505-476-3460	505-466-0134
NMOCD	Ed	Martin	Santa Fe Division Ofc.	505-827-7131	505-476-3492	505-685-4056
NMOCD	Roger	Anderson	Santa Fe Division Ofc.	505-827-7131	505-476-3490	505-471-2017
NM State Police			District 3, Roswell	505-827-9312		9
NM State Police			Sub-District 3, Roswell	505-622-7200 (ca	III this # for dispa	tch to our area)
BLM			Carlsbad	505-887-6544		
US Coast Guard			National Response Center	800-424-8802		
NMED			Air Quality Bureau	505-827-1494		
	State Emergency Re	esponse Cent	er	505-827-9126		
LEPC	Local Emerg. Planni	ng Commissi	on - Eddy County	505-885-2111		
NM OSHA	New Mexico OSHA	Ofc.		505-827-2850		

EMERGENCY SERVICES

Service Provider	Description	Main Phone
General Emergency	Police, Fire, Ambulance	911
Carlsbad Police, Fire, Ambulance Service		505-885-2111
Artesia General Hospital	Medical Services	505-748-3333
Carlsbad Fire Dept.	Fire Control	505-885-3124
Artesia Fire Dept.	Fire Control	505-746-2701
Happy Valley Fire Dept.	Fire Control	505-885-1982
NM State Police	Sub-District 3, Carlsbad	
NM State Police (Dispatcher)	District 3, Roswell	505-622-7200
Eddy County Sheriff	Law Enforcement	505-887-7551

NEARBURG PRODUCING COMPANY EMERGENCY RESPONSE PLAN

Position	Office Phone	Gell Phone#	Home Phone #		
		en again	A CONTRACTOR OF THE PARTY OF TH		
Drilling Superintendent	-25 357				
Butch Willis	432-686-8235 (223)	505-369-5852	432-697-2484		
Production Superintendent					
Matt Lee	505-746-0422	505-365-6662	505-746-0932		
Operations 🖟 🖟			The contract of the contract of		
Roger King	505-746-0422	505-361-3605	505-885-3605		
Rick Foutch	505-746-0422	505-361-4211	505-887-7844		
Jerry Stark	505-746-0422	505-365-4672	505-746-3862		
Planning Section					
Fred White	214-739-1778	469-644-1326	972-931-8845		
Bob Shelton	432-686-8235 (214)	432-682-3100	432-528-6134		
Public Affairs	* **	and the second second	1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 -		
Bob Shelton	432-686-8235 (214)	432-682-3100	432-528-6134		

AREA RESIDENTS AND OFFSET OPERATIONS

ltion Donointion	Contact	Title		C:4./CT/7:	Dhana 4	Call	
Location Desciption	Wilkie, Mark & Sandi	I ITIE	Address 1073 Marathon Rd.	City/ST/Zip Carlsbad, NM 88220	Phone 1 505-457-2022	Cell	Location Info.
4TK + (Boles) Foster Ranch					505-457-2022		
Forrest Lee Ranch	Foster, John		P.O. Box 103 P.O. Box 89	Artesia, NM 88211-0103			T- 7 1
	Lee, Dean		344 Pinderosa Pine	Lakewood, NM 88254	505-457-2301		Trailer house near NIBU 24
Gissler Ranch	Cox, Billy			Carlsbad, NM 88220	505-457-2397		
Gregory's	Gregory, Wayne		617 Queens Hwy.	Carlsbad, NM 88220	505-457-2245		
HH Ranch	Houchtaling, Harold		P.O. Box 234	Artesia, NM 88211-0234	505-457-2245		
Howell Ranch	Howell, Richard		P.O. Box 94	Lakewood, NM 88254	505-457-2602		
Kincaid Ranch	Kincaid, Gene		2913 Octotilly Canyon Dr.	Carlsbad, NM 88220	505-887-6918		
Kincaid Ranch	Kincaid, Hugh		2911 Octotilly Canyon Dr.	Carlsbad, NM 88220	505-885-9458		
							Lives at ranch house just E of Hwy 137 About 2 miles past mile marker 42 towrds
Kincaid Ranch	Marbauch, Jim		1762 Qureen Hwy.	Carlsbad, NM 88220	505-457-2233		Queens.
Old Jones Ranch	Lasiter, Rick				505-457-2108		
Schafer Ranch	Biebelle, Stacey		646 Qureen Hwy.	Carlsbad, NM 88220	505-457-2360		House near low water crossing on Hwy 137
Patsy's old house	DeMoss, Neil				none		
Chevron Oil	Boles, Randy					505-390-7232	
Chevron Oil	Angel, Kenneth					505-390-1540	
Devon	Daniel				505-390-5850		
Devon	Crosbey, Owen				505-748-7749		
Devon	Huber, Mark		1		505-748-5502		
Devon	Canada, Don				505-748-5503		
Devon	Brady				505-390-5431		
Devon	Huber, Joe	Superintendent			505-390-5438		
Devon	"Doghouse"				505-457-2613		
Duke Energy	Lamb, Johnny	Foreman			505-390-2791		
Duke Energy	Main Office		Carlsbad		505-628-0282		
Duke Energy	Valenzuela, Oscar				505-910-4675		
El Paso	Jacquez, David	Gas Measurement			505-857-2158		
KMG (Kerr McGee)	Deese, Tommy	Superintendent		-	505-234-2703	505-706-3423	
KMG (Kerr McGee)	Chalker, Andy	Prod. Foreman			505-234-2703	505-910-0342	
KMG (Kerr McGee)	Hess, Bobby	Team Leader			505-234-2703	505-706-3543	
KMG (Kerr McGee)	Wilson, James	ream Leader			303-234-2703	300-700-3343	
		1			505 200 4540	FOE 700 0000	
KMG (Kerr McGee)	Brannon, Steve	 			505-390-1540	505-706-3669	
Yates Petroleum (Agave)	Main Office				505-784-1471		
Yates Petroleum (Agave)	Johnson, Bill	Foreman			505-748-6816	505-365-4615	
Yates Petroleum (Agave)	Moorehead, Robert	1			505-748-6815	505-365-4840	1