
Office	ate of New Mexico	Form C-103
1625 N. French Dr., Hobbs, NM 88240	nerals and Natural Resources	March 4, 2004 WELL API NO. 30-015-04004
1501 W. Gland Ave., Altesia, 1444 00210	ISERVATION DIVISION	5. Indicate Type of Lease
1000 Pio Brazos Pd. Aztec. NM 97410	South St. Francis Dr.	STATE FEE X
District IV Sa	anta Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		LC 063926
SUNDRY NOTICES AND REPO (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI	TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name WSLU TRACT 5
PROPOSALS.)		8. Well Number
1. Type of Well: Oil Well Gas Well Other W.I.W		8
	RECEIVED	9. OGRID Number
2. Name of Operator J. CLEO THOMPSON	MAR 2 1 2005	9. OGRID Number
3. Address of Operator P O BOX 237 LOCO HILI	S NIM 99255	10. Pool name or Wildcat
F O BOX 237 LOCO HILL	S, NW 0023010 PEAM TEAM	GRAYBURG SAN ANDREAS
4. Well Location		
T. 1000		
Unit Letter F: 1980 feet from the N line and 1980 feet from the W line		
Section 35 Township 16S Range 30E NMPM County EDDY 11. Elevation (Show whether DR, RKB, RT, GR, etc.)		
3787 KB		
Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)		
Pit Location: UL Sect Twp Rng Pit type Depth to Groundwater Distance from nearest fresh water well		
Distance from nearest surface water Below-grade Tank Location ULSect TwpRng;		
feet from theline andfeet from theline		
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data		
NOTICE OF INTENTION TO		SSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND AB	ANDON 🗌 REMEDIAL WOF	RK $oxed{oxed}$ ALTERING CASING $oxed{\Box}$
TEMPORARILY ABANDON CHANGE PLAN	NS COMMENCE DE	RILLING OPNS. PLUG AND ABANDONMENT
PULL OR ALTER CASING MULTIPLE COMPLETION	CASING TEST A	
OTHER:	OTHER: REPA	IR HOLE IN TBG.
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date		
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.		
M.I.R.U. pulling unit nipple dwn wellhead, unset PKR C.O.H. Lay PKR DWN Bullplug TBG G.I.H. w/TBG test every 10 stands to 2000# found several leaks C.O.H. pick up redressed PKR. G.I.H. Circulate PKR fluid set PKR pressure CSG. up to 600# leave chart		
on 30 mins. "OK" Nipple up wellhead, rig dwn leave well injecting. Next A.M. have water coming out of CSG. M.I.R.U. pulling unit		
nipple DWN wellhead unset PKR. C.O.H. Bullph 4 1/2 tension PKR. G.I.H. w/87 JTS. 2 3/8 plastic		
30 mins. "OK" nipple up wellhead, put on injection		
I hereby certify that the information above is true and		
grade tank has been/will be constructed or closed according to !	NMOCD guidelines \square , a general permit \square	or an (attached) alternative OCD-approved plan .
SIGNATURE HAT & Z.	TITLE PRODUCTION FO	DATE 03/05/2005
Type or print name AMADOR PANDO	E-mail address:	Telephone No.(505)677-2396
(This space for State use)		
(This space for State use)	1	1
(This space for State use)	Den 1. [1]	
APPPROVED BY Conditions of approval, if any:	TITLE DEPuty Tell	DATE 3-23-05

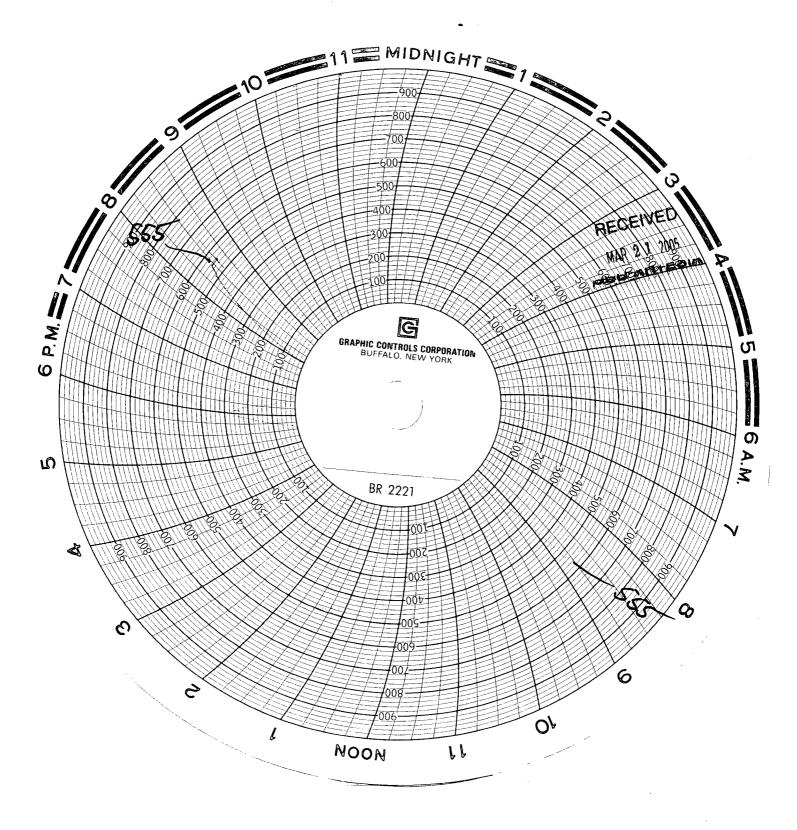

Check Strong Son Willow Son Willow Son Willow Son Will Show Son Willow Son Will Son Will Son Williams Son Wil

ė ,

,

.

.

•

.