

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED
OMB No. 1004-0137
Expires: March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE- Other instructions on reverse side.

1. Type of Well



Oil Well



Gas Well



Other

2. Name of Operator

OXY USA WTP LP

192463

3a. Address

P.O. Box 50250 Midland, TX 79710

3b. Phone No. (include area code)

432-685-5717

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1600 FNL 1400 FWL SENW(F) Sec 7 T22S R24E

5. Lease Serial No.

NM 81219

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

Old Ranch Canyon Federal #2

9. API Well No.

30-015-28075

10. Field and Pool, or Exploratory Area

Indian Basin Up. Penn (Assoc)


11. County or Parish, State

Eddy NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

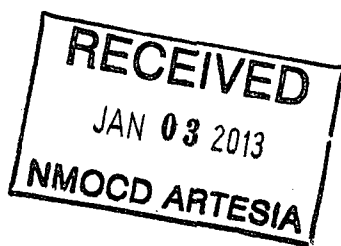

See Attached

RECLAMATION
DUE 6-5-13

Accepted as to plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

David Stewart

Title Regulatory Advisor

Signature

Date

12/10/12

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title

Office

Date

DEC 31 2012

BUREAU OF LAND MANAGEMENT
CARLSBAD FIELD OFFICE

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

1/3/2013

Accepted for record
NMOC D

Old Ranch Canyon 7 Federal #2

11/27/12 MIRU PU

11/28/12 NDWH, NUBOP, Dig out cellar to surf head, RIH w/ gauge ring to 7650', POOH.

11/29/12 RIH w/ CIBP & set @ 7610', circ hole w/ 10# MLF

11/30/12 RIH & tag CIBP @ 7610', circ hole w/ 10# MLF, spot 25sx CL C cmt, Calc TOC 7460'. PUH to 6923', spot 40sx CL C cmt, PUH, WOC.

12/3/12 RIH & tag cmt @ 6858', plug was low, Terry Wilson-BLM appr respot plug. Circ hole w/ 10# MLF, spot 40sx CL C cmt @ 6858', PUH, WOC. RIH & tag cmt @ 6616'. PUH to 6440', spot 40sx CL C cmt, PUH, WOC.

12/4/12 RIH & tag cmt @ 6236', POOH. RIH w/ WL & perf @ 4326', POOH w/ WL. RIH w/ pkr & set @ 3831', EIR @ 2BPM w/ full returns up 7" X 9-5/8", sqz 80sx CL C cmt, PUH, WOC.

12/5/12 RIH & tag cmt @ 3936', POOH. RIH w/ WL & perf @ 3444', RDWL. RIH & set pkr @ 3026', EIR @ 2BPM w/ full returns, sqz 55sx w/ 2% CaCl₂, PUH, WOC. RIH & tag cmt @ 3255', POOH. RIH w/ WL & perf @ 2522', RDWL. RIH & set pkr @ 1899'.

12/6/12 EIR @ 2BPM w/ full returns, sqz 130sx CL C cmt w/ 2% CaCl₂, POOH, WOC. RIH & tag cmt @ 2145', PUH & perf @ 878', RDWL. RIH & set pkr @ 414' EIR @ 2BPM w/ full returns, sqz 45sx CL C cmt, WOC.

12/7/12 RIH & tag cmt @ 708', PUH & perf @ 417', RDWL. ND BOP, NU B-1 Adapter, circ 130sx CL C cmt to surf. RDPU.