


District I – (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II – (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III – (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV – (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

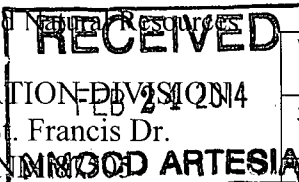

WELL API NO. 30-005-64119
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. L-729
7. Lease Name or Unit Agreement Name Round Tank Queen Unit
8. Well Number 6-Y
9. OGRID Number 1092
10. Pool name or Wildcat Round Tank Queen

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator  
Armstrong Energy Corporation

3. Address of Operator  
P.O. Box 1973, Roswell, NM 88202

4. Well Location  
Unit Letter C 710 feet from the North line and 1750 feet from the West line  
Section 30 Township 15S Range 29E NMPM : Chaves County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3720 GR

### 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

#### NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐  
CLOSED-LOOP SYSTEM ☐  
OTHER: ☐

#### SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☒  
CASING/CEMENT JOB ☐  
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 2-13-14 RU J&B Well Service. ND wellhead, attempt to unseat pump, pump stuck, back off rods. Lay down 59-3/4" rods and pump rod. Install BOP, attempt to pull tubing, tubing stuck. SDON
- 2-14-14 RIH w/ Wireline and back off tubing @ 1435'. POOH w/ 46 jts, 2-3/8" tbg, RIH w/ CIBP and set @ 1435' (perfs 1487'-1503'). Spot 30 sx Class "C" cement on top of CIBP. POH to 362', circulate 45 sx Class "C" cement to Surface, cut off wellhead, install Dry Hole marker, back-fill cellar. RD, move out. Prep to clean location, remove caliche, rip location and re-seed. Will notify OCD when work is complete.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE B. Stubbs TITLE Vice President – Operations DATE 2/21/2014

Type or print name Bruce A. Stubbs E-mail address: bastubbs@armstrongenergycorp.com PHONE: 575-625-2222

#### For State Use Only

APPROVED BY: SR Dade TITLE Dist. II Supervisor DATE FEB 25<sup>th</sup> 2014

Conditions of Approval (if any):

★ Submit Subsequent C-103