NM OIL CONSERVATION ARTESIA DISTRICT

NOV 2 4 2015


RECEIVED

N

E SUNDRY Do not use ti						FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010 5. Lease Serial No. NMNM0352856B 6. If Indian, Allotze or Tribe Name	
SUBMIT IN TRIPLICATE - Other Instructions on reverse side.					7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well 20 Oil.Well Ou Well Other					8. Well Name and No. MOBIL CI FEDERAL COM 1		
2. Name of Operator Contact: TINA HUERTA YATES PETROLEUM CORPORATION: Mail: thrat@yatespetroleum.com					9. API Well No. 30-015-20582		
3. Address 105 SOUTH FOURTH STRE ARTESIA, NM 88210	include area code 4168 4585):	10. Field and Pool, or Exploring PENASCO DRAW; SAN ANDRES				
4. Location of Well (Footage, Sec.,		11. County or Parish, and State					
Sec 6 T19S R26E NWSE 16			EDDY COUNTY, NM				
12. CHECK AP	PROPRIATE BOX(ES) T	O INDICATE	NATURE OF	NOTICE, P	BPORT, OR OTHE	R DATA	
TYPE OF SUBMISSION		TYPE OF ACTION				·	
B Notice of Intent	Acidize	🚺 Deep	Deepen		tion (Start/Resume)	Water Shut-Off	
	Alter Casing	D Frad	D Fracture Treat		nation	🖸 Well Integrity	
Subsequent Report	Casing Repair		C New Construction		nplete	C Other	
Final Abandonment Notice	Change Plana		B Plug and Abandon		aranily Abandon		
13. Describe Proposed or Completed (If the proposal is to deepen direction	Convert to Injection	m C) Plug Back		U Water Disposal			
determined that the site is ready for Yates Petroleum Corporation 1: RU any safety equipment 2: Set a 4-1/2 inch CIBP et fill entire wellbore up from C 3. Cut off wellboad and ins	n plans to plug and aband t as needed. POOH with 1047 ft. Spot a 110 sx Cl IBP to surface. WOC and all marker, clean up locat	production equi ass C cement p d teg plug. ion as per regul	pment. lug from 0-104 ated.			<i>D</i> O	
RECLAMATION PROCEDURE							
ATTACHED					SEE ATTACHED FOR		
				0	CONDITIONS ()F APPROVAL	
14. I hereby certify that the foregoin	g is tree and correct. Electronic Submission For YATES PET Committed to AFMSS for		DRATION, sent				
Name (Printed/Typed) TINA HUERTA			Tide REGI	REPORTIN	G SUPERVISOR		
Signature (Electronic Subinitision)			Date 04/22	2013			
	THIS SPACE	FOR FEDERA	L OR STATE	E OFFICE	USE		
Approved By frame	Approved By france Q. Ome		Title S.F	C 15		Date 6-15-13	
Conditions of Approval, if any, are stached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office CAD				
Title 18 U.S.C. Section 1001 and Title States any false, fictitious or fraudul					make to any department of	r sgency of the United	
* OPEF	ATOR-SUBMITTED **	OPERATOR	SUBMITTED) ** OPER	ATOR SUBMITTER)"	

1


Ou where his cs

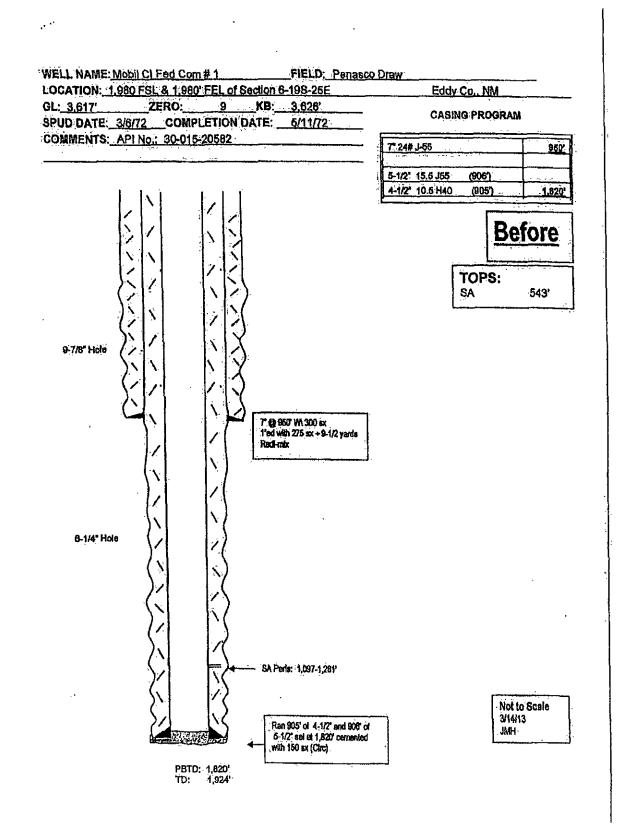

. ; ;

\bigcirc

÷

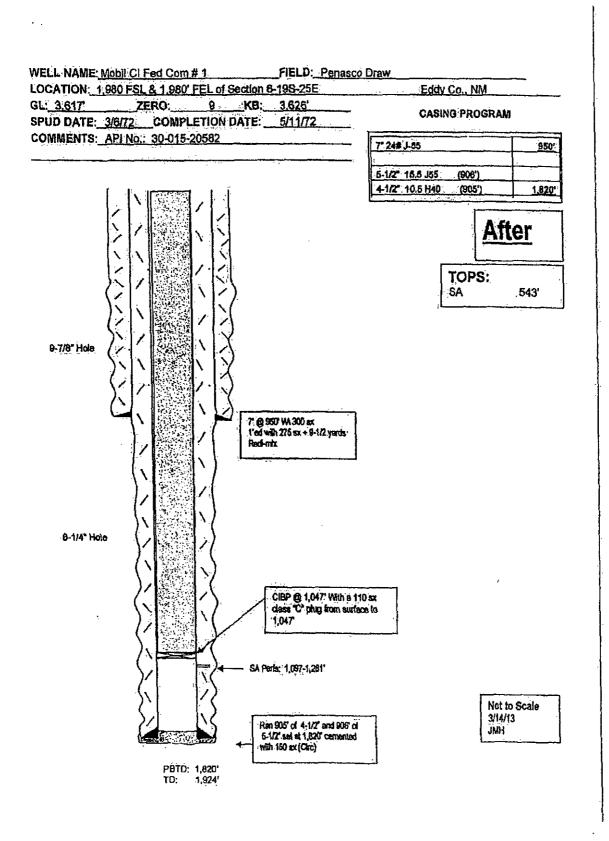

 (\dot{C})

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9:090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.



United States Department of the Interior

BURBAU OF LAND MANAGEMENT Caribbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blan.gov/am



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pade, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to saits or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160.4). For final reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160.4). For final reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160.4). For final reclamation, the appropriate time for submittal would be when filing the Nötice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3: The operator must file a Subsequent Report Phug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure:

J. Amos 3/6/11