
		UNITED STATES PARTMENT OF THE II	NTERIOR	OCD Artes	ia	OMB NO	APPROVED O. 1004-0137 anuary 31, 2018	
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS					Γ	5. Lease Serial No. NMNM89878		
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.						6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on page 2						7. If Unit or CA/Agreement, Name and/or No. NMNM134181		
1. Type of Well Solution Of Well Gas Well Other					8. Well Name and No. PAVO MESA 30 FEDERAL COM 1			
2. Name of Operator CIMAREX ENE	EYLER -RES.COM	9. API Well No. 30-015-35918-00-S1						
3a. Address         3b. Phone N           202 S CHEYENNE AVE SUITE 1000         Ph: 432-6           TULSA, OK 74103.4346         Ph: 432-6				e No. (include area code) 2-687-3033			Exploratory Area	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State			
Sec 30 T16S R29E SWNW 1780FNL 330FWL					E		EDDY COUNTY, NM	
12. Cl	HECK THE AP	PROPRIATE BOX(ES)	TO INDI	CATE NATURE OF	F NOTICE, I	REPORT, OR OTH	HER DATA	
TYPE OF SUE	TYPE OF SUBMISSION TYPE OF ACTION							
Notice of Inte	ent	Acidize		Deepen	Productio	on (Start/Resume)	UWater Shut-Of	
_		Alter Casing		Hydraulic Fracturing	🗖 Reclama	tion	U Well Integrity	
□ Subsequent R	· .	Casing Repair	—	New Construction	C Recompl		□ Other	
Final Abandonment Notice				Plug and Abandon	Temporarily Abandon Water Disposal			
		Convert to Injection		Plug Back				
following complet	tion of the involved ompleted. Final Ab	operations. If the operation re andonment Notices must be fi	esults in a mu	altiple completion or reco	mpletion in a ne	ew interval, a Form 316	e filed within 30 days 60-4 must be filed once and the operator has	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 4) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS	ompleted. Final Ab. csite is ready for fur CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 2,5 XS.CMT. @ 475 C. TO SURF. 25 CUT OFF WEL CUT OFF WEL R. PROCEDURE	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHC 5'-275'(13-3/8"CSG.SHC SXS.CMT. @ 63'-3'. LHEAD 3' B.G.L.; WELC WE PLAN TO USE THE	sults in a mu led only after 5,650'-6,42 C X TAG C HOE); WOO DE); WOC 3 O ON STEE	ultiple completion or reco r all requirements, includ: 25'(4-1/2"LNR.TOP); 25'T. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS	mpletion in a noing reclamation CIRC. CIRC.	ew interval, a Form 316, have been completed a	60-4 must be filed once and the operator has	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 4) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS	ompleted. Final Ab. e site is ready for fu CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 2,5 XS.CMT. @ 475 C. TO SURF. 25 CUT OFF WELI ER.	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHC 5'-275'(13-3/8"CSG.SHC SXS.CMT. @ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17.	sults in a mu led only after 5,650'-6,42 C X TAG C HOE); WOC DE); WOC DE); WOC DON STEE	altiple completion or reco r all requirements, includ: 25'(4-1/2"LNR.TOP); 25'MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS 0-LOOP SYSTEM AN	mpletion in a noing reclamation CIRC. CIRC.	ew interval, a Form 316, have been completed a	60-4 must be filed once and the operator has	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 4) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS	ompleted. Final Ab. csite is ready for fur CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 2,5 XS.CMT. @ 475 C. TO SURF. 25 CUT OFF WEL CUT OFF WEL R. PROCEDURE	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHC 5'-275'(13-3/8"CSG.SHC SXS.CMT. @ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA	sults in a mu led only after 5,650'-6,42 C X TAG C HOE); WOC DE); WOC DE); WOC DON STEE	altiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS -LOOP SYSTEM AN CEDURE	mpletion in a noing reclamation CIRC. CIRC. COC G. G. X INSTALL ID HAUL CC	ew interval, a Form 316, have been completed a C Tag. GROUND LEVEL	60-4 must be filed once and the operator has	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 4) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS	ompleted. Final Ab. csite is ready for fur CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 2,5 XS.CMT. @ 475 C. TO SURF. 25 CUT OFF WEL CUT OFF WEL R. PROCEDURE	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHC 5'-275'(13-3/8"CSG.SHC SXS.CMT. @ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA	sults in a mu led only after 5,650'-6,42 C X TAG C HOE); WO DE); WO DE); WO DON STEE E CLOSED TION PRO(	altiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS -LOOP SYSTEM AN CEDURE	mpletion in a noing reclamation CIRC. COC G. S. X INSTALL ID HAUL CC	Winterval, a Form 316 have been completed GROUND LEVEL ONTENTS TO THE CHED FOR	60-4 must be filed once and the operator has _ DRY REQUIRED	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 4) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS	ompleted. Final Ab. te site is ready for fur- CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 475 C. TO SURF. 25 CUT OFF WELI CUT OFF WELI ER. PROCEDURE ER OCD RULE that the foregoing is	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHC SXS.CMT. @ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA A true and correct. Electronic Submission # For CIMAREX EN	esults in a mu led only after 5,650'-6,42 C X TAG C HOE); WOO DE); WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE];	altiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS -LOOP SYSTEM AN CEDURE rified by the BLM Wel IPANY OF CO. sent for	mpletion in a no ing reclamation CIRC. <b>6</b> G. S. X INSTALL ID HAUL CO CEE ATT/ CONDITION O the Carlsba	Winterval, a Form 316 have been completed a GROUND LEVEL ONTENTS TO THE ACHED FOR	60-4 must be filed once and the operator has - DRY REQUIRED	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS DISPOSAL, PI	ompleted. Final Ab. te site is ready for fur- CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 475 C. TO SURF. 25 CUT OFF WELI CUT OFF WELI ER. PROCEDURE ER OCD RULE that the foregoing is	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHO SXS.CMT. @ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA A true and correct. Electronic Submission # For CIMAREX EN pommitted to AFMSS for pr	esults in a mu led only after 5,650'-6,42 C X TAG C HOE); WOO DE); WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE];	altiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS -LOOP SYSTEM AN CEDURE rified by the BLM Wel IPANY OF CO. sent for	mpletion in a no ing reclamation CIRC. <b>6</b> G. S. X INSTALL ID HAUL CO CEE ATT/ CONDITION O the Carlsba	Winterval, a Form 316 have been completed a GROUND LEVEL ONTENTS TO THE ACHED FOR	60-4 must be filed once and the operator has - DRY REQUIRED	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS DISPOSAL, PI	ompleted. Final Ab ne site is ready for fur CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 2,5 XS.CMT. @ 475 CUT OFF WEL ER S PROCEDURE ER OCD RULE	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHO SXS.CMT. @ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA A true and correct. Electronic Submission # For CIMAREX EN pommitted to AFMSS for pr	esults in a mu led only after 5,650'-6,42 C X TAG C HOE); WOO DE); WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE];	Itiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS LOOP SYSTEM AN CEDURE Fified by the BLM Well PANY OF CO, sent to by JAMES AMOS on 1	mpletion in a no ing reclamation CIRC. <b>6</b> G. S. X INSTALL ID HAUL CO CEE ATT/ CONDITION O the Carlsba	Winterval, a Form 316 have been completed a GROUND LEVEL ONTENTS TO THE ACHED FOR	60-4 must be filed once and the operator has - DRY REQUIRED	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS DISPOSAL, PI	ompleted. Final Ab ne site is ready for fur CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 2,5 XS.CMT. @ 475 CUT OFF WEL ER S PROCEDURE ER OCD RULE	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHO SXS.CMT. @ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA A true and correct. Electronic Submission <del>f</del> For CIMAREX END pommitted to AFMSS for pr EYLER	esults in a mu led only after 5,650'-6,42 C X TAG C HOE); WOO DE); WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE]; WOO DE];	Itiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS LOOP SYSTEM AN CEDURE Fified by the BLM Well PANY OF CO, sent to by JAMES AMOS on 1	mpletion in a noing reclamation CIRC. CIRC. CIRC. G. S. X INSTALL ID HAUL CO CIEE ATT/ CONDITION OF Carlsba 2/29/2016 (17	Winterval, a Form 316 have been completed a GROUND LEVEL ONTENTS TO THE ACHED FOR	60-4 must be filed once and the operator has - DRY REQUIRED	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS DISPOSAL, PI	ompleted. Final Ab le site is ready for fur- CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 2,5 XS.CMT. @ 475 CUT OFF WELI ER S PROCEDURE ER OCD RULE that the foregoing is caped) DAVID A E	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHC SXS.CMT.@ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA A true and correct. Electronic Submission # For CIMAREX ENI pommitted to AFMSS for pr EYLER ubmission)	esults in a mu led only after 3,650'-6,42 C X TAG C HOE); WOC PON STEE CLOSED TION PRO( TTACHED CLOSED TION PRO( TTACHED COCESSING b	Itiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS H-LOOP SYSTEM AN CEDURE FIND OF SYSTEM AN CEDURE S S S S S S S S S S S S S S S S S S S	mpletion in a noing reclamation CIRC. CO G. S. X INSTALL ID HAUL CC CIEE ATT/ CONDITION CONTRACTOR	Winterval, a Form 316 have been completed a GROUND LEVEL ONTENTS TO THE ACHED FOR	60-4 must be filed once and the operator has _ DRY REQUIRED	
following complet testing has been or determined that th 1)SET 4-1/2" (2 2) PUMP 50 S 3) PUMP 40 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS DISPOSAL, PI	ompleted. Final Ab le site is ready for fur- CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 2,5 XS.CMT. @ 475 CUT OFF WELI ER S PROCEDURE ER OCD RULE that the foregoing is caped) DAVID A E	andonment Notices must be fi nal inspection. PUMP 40 SXS.CMT.@ 6 00'-5,750'(T/ABO); WOC 69'-3,639'(T/GLOR.). 87'-2,467'(9-5/8"CSG.SHC SXS.CMT.@ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA A true and correct. Electronic Submission # For CIMAREX ENI pommitted to AFMSS for pr EYLER ubmission)	esults in a mu led only after 3,650'-6,42 C X TAG C HOE); WOC PON STEE CLOSED TION PRO( TTACHED CLOSED TION PRO( TTACHED COCESSING b	Itiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS -LOOP SYSTEM AN CEDURE CEDURE S TITLE AGENT Date 12/13/20 CERAL OR STATE (	mpletion in a noing reclamation CIRC. CO G. S. X INSTALL ID HAUL CC CIEE ATT/ CONDITION CONTRACTOR	Winterval, a Form 316 have been completed a GROUND LEVEL ONTENTS TO THE ACHED FOR	60-4 must be filed once and the operator has - DRY REQUIRED	
following complet testing has been or determined that th 1)SET 4-1/2" (2) 2) PUMP 50 S 3) PUMP 40 S 4) PUMP 35 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS DISPOSAL, PI	ompleted. Final Ab. he site is ready for fur- CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 475 C. TO SURF. 25 CUT OFF WELI R. B PROCEDURE ER OCD RULE that the foregoing is (Electronic S (Electronic S (Electronic S) (Electronic S)	andonment Notices must be final inspection. PUMP 40 SXS.CMT.@ 6 00'-5.750'(T/ABO); WOC 69'-3.639'(T/GLOR.). 87'-2.467'(9-5/8"CSG.SHC SXS.CMT.@ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA A true and correct. Electronic Submission # For CIMAREX ENI pommitted to AFMSS for pr EYLER ubmission) THIS SPACE F(	esults in a mu fed only after (a,650'-6,42 (c)X TAG (c) (d)E); WO(c) (d)E); WO(c) (	altiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS -LOOP SYSTEM AN CEDURE FINITE SAMOS ON 1 Title AGENT Date 12/13/20 CRAL OR STATE C	mpletion in a noing reclamation CIRC. CIRC. CIRC	Winterval, a Form 316 have been completed a GROUND LEVEL ONTENTS TO THE ACHED FOR	- DRY REQUIRED	
following complet testing has been or determined that th 1)SET 4-1/2" (2) 2) PUMP 50 S. 3) PUMP 40 S 4) PUMP 35 S 5) PUMP 60 S 6) MIX X CIRC 7) DIG OUT X HOLE MARKE DURING THIS DISPOSAL, PI 14. I hereby certify t Name ( <i>Printed/Ty</i> ) Signature	ompleted. Final Ab. he site is ready for fur- CIBP @ 6,650'; F XS.CMT. @ 5,9 XS.CMT. @ 3,7 XS.CMT. @ 475 C.TO SURF. 25 CUT OFF WELI R. B PROCEDURE ER OCD RULE that the foregoing is (Electronic S (Electronic S (Electronic S (Electronic S) (Electronic S)	andonment Notices must be final inspection. PUMP 40 SXS.CMT.@ 6 00'-5.750'(T/ABO); WOC 69'-3.639'(T/GLOR.). 87'-2.467'(9-5/8"CSG.SHC SXS.CMT.@ 63'-3'. LHEAD 3' B.G.L.; WELD WE PLAN TO USE THE 19.15.17. RECLAMA A true and correct. Electronic Submission # For CIMAREX ENI pommitted to AFMSS for pr EYLER ubmission) THIS SPACE F(	esults in a mu led only after 5,650'-6,42 C X TAG C HOE); WOC E); WOC DON STEE E CLOSED I CON PRO( ITACHED A360778 ver ERGY COM OR FEDE	altiple completion or reco r all requirements, include 25'(4-1/2"LNR.TOP); MT. PLUG. C X TAG CMT. PLU X TAG CMT. PLUG. EL PLATE TO CSGS -LOOP SYSTEM AN CEDURE Title by the BLM Well PANY OF CO, sent to by JAMES AMOS on 1 Title AGENT Date 12/13/20 ERAL OR STATE C Title C Conffice C	mpletion in a noing reclamation CIRC. CIRC. CIRC	ew interval, a Form 316 , have been completed a port of the second secon	- DRY REQUIRED	



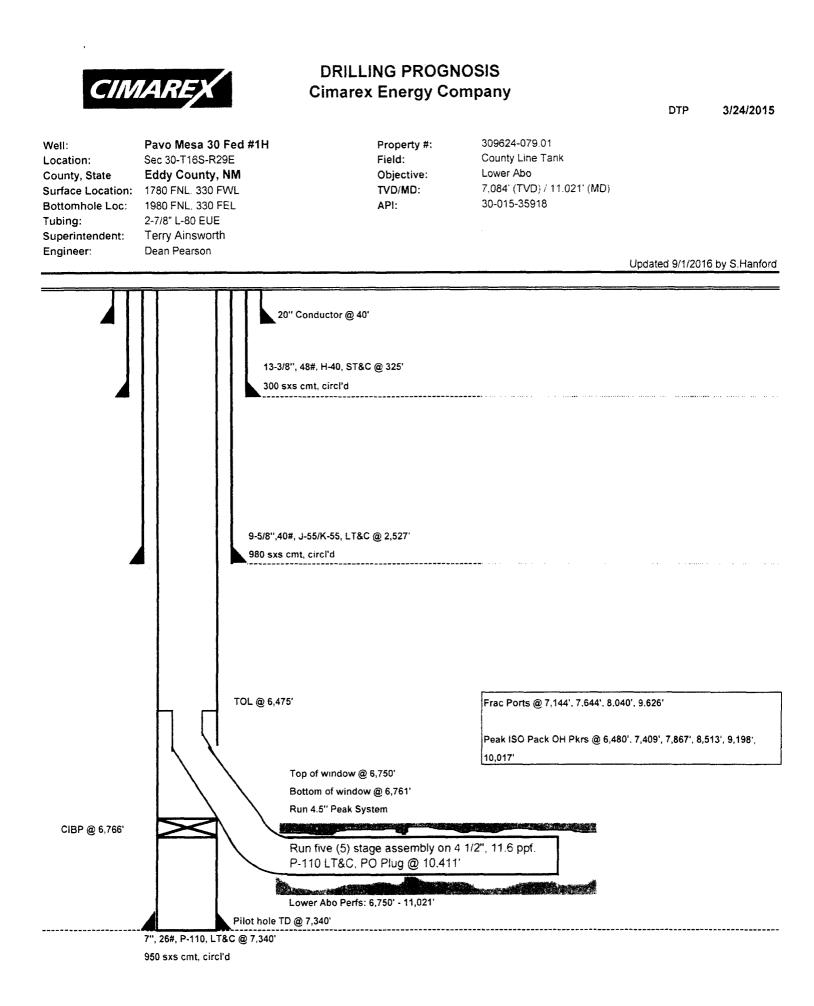

## DRILLING PROGNOSIS Cimarex Energy Company

DTP 3/24/2015

Well:Pavo Mesa 30 Fed #1HLocation:Sec 30-T16S-R29ECounty, StateEddy County, NMSurface Location:1780 FNL, 330 FWLBottomhole Loc:1980 FNL, 330 FELTubing:2-7/8" L-80 EUESuperintendent:Terry AinsworthEngineer:Dean Pearson

 Property #:
 30962

 Field:
 Count


 Objective:
 Lower

 TVD/MD:
 7,084'

 API:
 30-01'

309624-079.01 County Line Tank Lower Abo 7,084' (TVD) / 11,021' (MD) 30-015-35918

Updated 9/1/2016 by S.Hanford

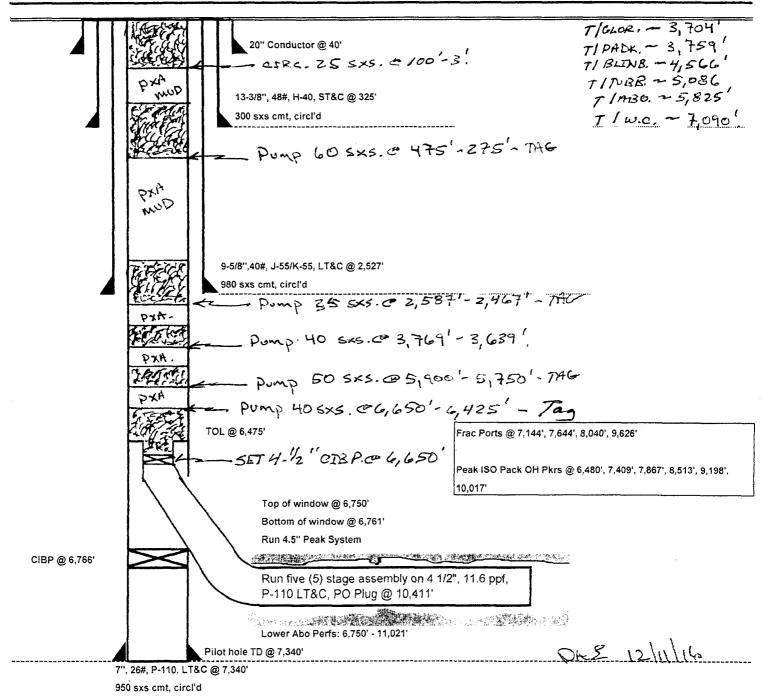

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.** 

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.





In Reply Refer To: 1310

## **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

. . ·

Linda Denniston Environmental Protection Specialist 575-234-5974

Henryetta Price Environmental Protection Specialist 575-234-5951

Dara Glass Environmental Protection Specialist 575-234-5924

Shelly Tucker Environmental Protection Specialist 575-234-5979