

	UNITED STATES DEPARTMENT OF THE I	NTERIOR		M APPROVED NO. 1004-0137 : January 31, 2018	
SUNDR	BUREAU OF LAND MANA Y NOTICES AND REPO	RTS ON WELLSMAR 06	2017 5. Lease Serial No. NMNM039762		
abandoned w	this form for proposals to vell. Use form 3160-3 (AP	Defined for the re-enter an PD) for such proposals. 晚戶CEIV		e or Tribe Name	
SUBMIT IN	N TRIPLICATE - Other ins			reement, Name and/or No.	
1. Type of Well ⊠ Oil Well □ Gas Well □ 0	Other			8. Well Name and No. FEDERAL KL-17 1	
		ABIGAIL MONTGOMERY	9. API Well No. 30-015-23719	9. API Well No. 30-015-23719	
3a. Address 600 W. ILLINOIS MIDLAND, TX 79701		3b. Phone No. (include area code) Ph: 432-580-7161		10. Field and Pool or Exploratory Area EMPIRE MORROW	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description		1)	11. County or Paris	11. County or Parish, State	
Sec 17 T17S R29E 1840FN 32.836856 N Lat, 104.09918			EDDY CO CO	DUNTY, NM	
12. CHECK THE	APPROPRIATE BOX(ES)	TO INDICATE NATURE OF	NOTICE, REPORT, OR O	THER DATA	
TYPE OF SUBMISSION		TYPE OF	TYPE OF ACTION		
 Notice of Intent Subsequent Report Final Abandonment Notice 	 Acidize Alter Casing Casing Repair Change Plans Convert to Injection 	 Deepen Hydraulic Fracturing New Construction Plug and Abandon Plug Back 	 Production (Start/Resume) Reclamation Recomplete Temporarily Abandon Water Disposal 	 Water Shut-Off Well Integrity Other 	
determined that the site is ready fo 1. MIRU plugging equipmen 2. Set CIBP @ 10250, Circ. 10250-10 150 .	r final inspection. it. ND wellhead. NU BOP. E hole w/ MLF. Pressure test 9465	led only after all requirements, includi Bleed well down POH w/ product t casing. Spot 25 sx class H ce 2045'	ction tha		
4. Perf & Sqz. 45 sx @ 7466 5. Perf & Sqz 45 sx @-5320 6. Cut and POH 5 1/2 csg @ 7 Spot 55 sx class C cemen 8. Spot 55 sx cement @ 171 9. Spot 55 sx @ 460-360. W 10. Spot 55 sx @ 100-surfac 11. Cut off wellhead and we	t @ 2650-2550. WOC & Ta 12-1612. VOC & tag. ce. Id on Dry Hole Marker.	SEE AT CONDI	TACHED FUA HOHE OF APPROX	L	
 4. Perf & Sqz. 45 sx @ 7466 5. Perf & Sqz 45 sx @ 5320 6. Cut and POH 5 1/2 csg @ 7 Spot 55 sx class C cemen 8. Spot 55 sx cement @ 17' 9. Spot 55 sx @ 460-360. W 10. Spot 55 sx @ 100-surfact 11. Cut off wellhead and we 14. I hereby certify that the foregoing	t @ 2650-2550. WOC & Ta 12-1612. VOC & tag. ce. Id on Dry Hole Marker. g is true and correct. Electronic Submission # For COG 0	SEE AT CONDI	TACHED FUA HOHE OF APPROX	L	
 Perf & Sqz. 45 sx @ 7466 Perf & Sqz 45 sx @ 5320 Cut and POH 5 1/2 csg @ 7 Spot 55 sx class C cemen 8. Spot 55 sx cement @ 171 Spot 55 sx @ 460-360. W 10. Spot 55 sx @ 100-surfat 11. Cut off wellhead and we I hereby certify that the foregoing Name (<i>Printed/Typed</i>) ABIGAIL 	g 2000. t @ 2650-2550. WOC & Ta t2-1612. VOC & tag. ce. Id on Dry Hole Marker. g is true and correct. Electronic Submission # For COG O Committed to AFMSS for	366795 verified by the BLM Well DPERATING, LLC, sent to the Ca processing by DEBORAH MCKIN	TACHED FUA HOHE OF APPROX	L	
 4. Perf & Sqz. 45 sx @ 7466 5. Perf & Sqz 45 sx @ 5320 6. Cut and POH 5 1/2 csg @ 7 Spot 55 sx class C cement 8. Spot 55 sx cement @ 171 9. Spot 55 sx @ 460-360. W 10. Spot 55 sx @ 100-surfat 11. Cut off wellhead and we 14. I hereby certify that the foregoing Name (<i>Printed/Typed</i>) ABIGAIL 	g 2000. trace 250-2550. WOC & Ta 12-1612. /OC & tag. ce. Id on Dry Hole Marker. g is true and correct. Electronic Submission # For COG O Committed to AFMSS for _ MONTGOMERY c Submission)	366795 verified by the BLM Well DPERATING, LLC, sent to the Ca processing by DEBORAH MCKIN Title AGENT	Information System Information System Information System INEY on 02/14/2017 () INEY on 02/14/2017 ()		
 Perf & Sqz. 45 sx @ 7466 Perf & Sqz 45 sx @ 5320 Cut and POH 5 1/2 csg @ 7 Spot 55 sx class C cemen 8. Spot 55 sx cement @ 171 Spot 55 sx @ 460-360. W 10. Spot 55 sx @ 100-surfat 11. Cut off wellhead and we 14. I hereby certify that the foregoing Name (Printed/Typed) ABIGAIL	g 2000. trace 250-2550. WOC & Ta 12-1612. /OC & tag. ce. Id on Dry Hole Marker. g is true and correct. Electronic Submission # For COG O Committed to AFMSS for _ MONTGOMERY c Submission)	SEE AT CONDI Background by the BLM Well DERATING, LLC, sent to the Ca processing by DEBORAH MCKIN Title AGENT Date 02/13/20	Information System Information System Information System INEY on 02/14/2017 () INEY on 02/14/2017 ()	L	
 4. Perf & Sqz. 45 sx @ 7466 5. Perf & Sqz 45 sx @ 5320 6. Cut and POH 5 1/2 csg @ 7 Spot 55 sx class C cement 8. Spot 55 sx cement @ 17' 9. Spot 55 sx @ 460-360. W 10. Spot 55 sx @ 100-surfac 11. Cut off wellhead and we 14. I hereby certify that the foregoing Name (<i>Printed/Typed</i>) ABIGAIL Signature (Electronic Approved By Approved By	g 2000. t @ 2650-2550. WOC & Ta 12-1612. /OC & tag. ce. Id on Dry Hole Marker. g is true and correct. Electronic Submission # For COG O Committed to AFMSS for MONTGOMERY c Submission) THIS SPACE FO bed. Approval of this notice does equitable title to those rights in the iduct operations thereon.	AS DEFENSION OF THE PARTY OF TH	Information System Information System Inform	d for record	

•

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **

COG Operating LLC

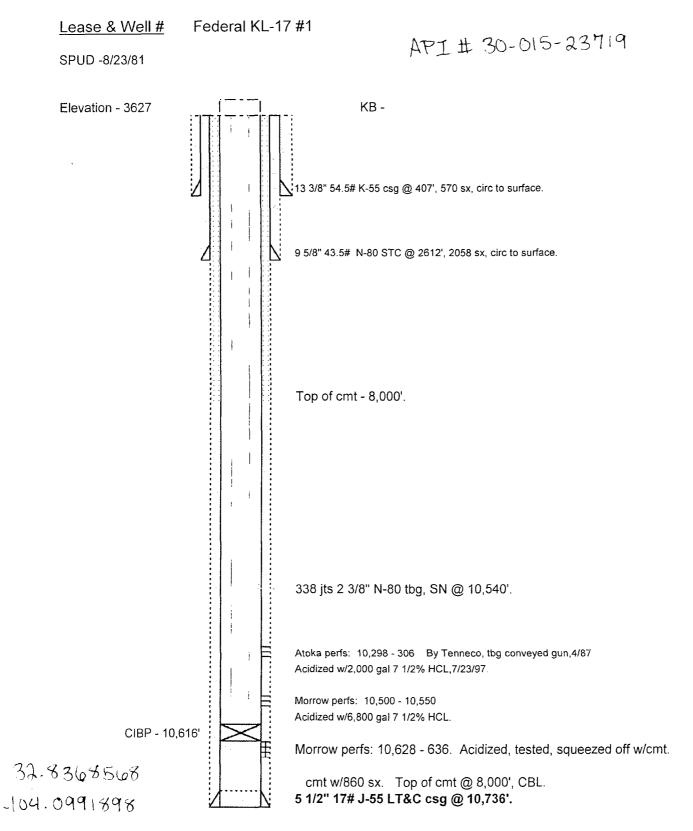

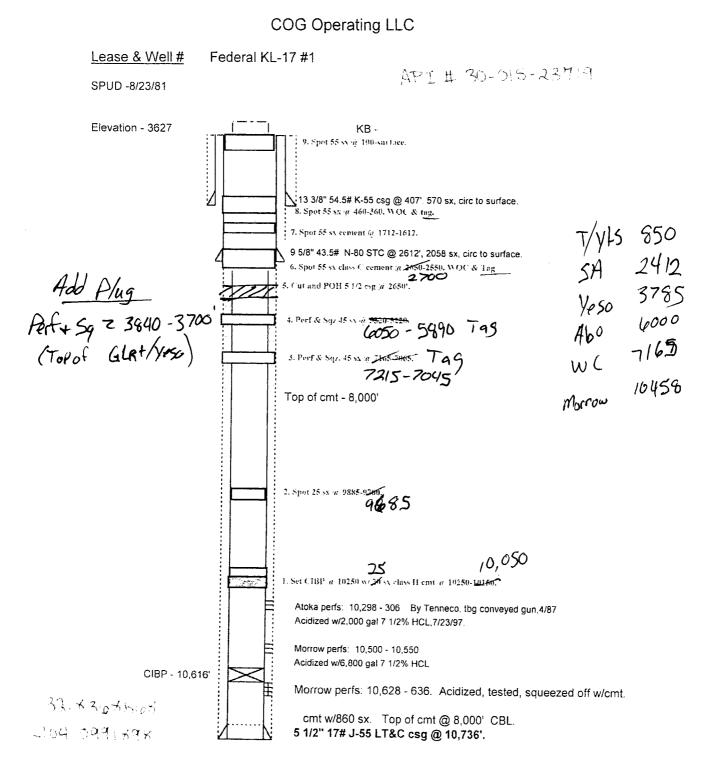



Federal KL - 17 #1 Wellbore diagram

SH

IN OIL CONSERVATION

ARTESIA DISTRICT

MAR 06 2017

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

RECEIVED

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.