

Forla 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT OCD Artesia						FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM0533177A 6. If Indian, Allottee or Tribe Name			
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.									
SUBMIT IN TRIPLICATE - Other instructions on page 2						7. If Unit of	7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well Gas Well Other						8. Well Name and No. TODD 14B FEDERAL 3			
2. Name of Operator Contact: RONNIE SLACK DEVON ENERGY PRODUCTION CONL-Mail: ronnie.slack@dvn.com							9. API Well No. 30-015-32777-00-S1		
3a. Address 3b. Phone No.				(include area code)			10. Field and Pool or Exploratory Area		
6488 SEVEN RIVERS HIGH	Ph: 405.552.4615 Fx: 405.552.1415				INGLE	INGLE WELLS-DELAWARE			
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)							11. County or Parish, State		
Sec 14 T23S R31E NWNE 660FNL 1886FEL							EDDY COUNTY, NM		
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICA	TE NATU	RE OF	NOTICI	E, REPORT	, OR OTH	IER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION								
Notice of Intent	🗖 Acidize		pen	en		Production (Start/Resume)		U Water Shut-Off	
—	□ Alter Casing	🗖 Нус	raulic Fracturing		□ Reclamation			U Well Integrity	
□ Subsequent Report	Casing Repair	—	New Construction			nplete	🗖 Other		
Final Abandonment Notice	□ Change Plans			lon	Temporarily Abandon Water Disposal				
Attach the Bond under which the wo following completion of the involver testing has been completed. Final A determined that the site is ready for the 1. MIRU P&A Unit. 2. POOH w/rod pump and 2-7 3. Set CIBP @ 6,840'. Tag CI 4. Spot 25 sx (250') CI C @ 6 5. Spot 25 sx (250') CI C @ 4 6. Perf @ 4,222'. Pump 300 s boundary. Salt from 4,222' - 1	d operations. If the operation re bandonment Notices must be fi final inspection. 7/8" production tubing ass IBP. Circulate wellbore w, 840' - 6,590'. 550' - 4,300'. Tag TOC. x: (1280') CI C in/out @ 4 1,110')	esults in a multip led only after all sembly from ~ '10# salt gel n ',222' - 2,942'.	le completion requirements 8,165'. nud.	i or recon , includi R- /	mpletion in ng reclamat	a new interval, tion, have been P	a Form 316 completed a lid of a s NM OI	0-4 must be filed once	
 Perf @ 2,920'. Pump 300 sx (1280') CI C in/out @ 2,920' - 1,640'. Perf @ 1,620'. Pump 200 sx (855') CI C in/out @ 1,620' - 765'. Perf @ 160'. Pump 40 sx CI C in/out to surface. Cut wellhead off 3' BGL. Set dry hole marker. 							А	UG 0 3 2017	
Below ground	level a	ry h	le r	MA	er Ker	- ^4	1 Extre	RECEIVED	į
 I hereby certify that the foregoing i Cor Name (Printed/Typed) RONNIE 	Electronic Submission # For DEVON ENERC nmitted to AFMSS for proc	GY PRODUCTION	ÓN COM LP ISCILLA PE	, sent REZ on	to the Car 06/30/201	ion System Isbad 17 (17PP0563 ECHNICIAN	د ۱	tor record	
							epter	NOCD	
Signature (Electronic Submission) THIS SPACE FOR FEDERA				6/26/20			- Vi	R. h. P.	
								7791	=
_Approved By	r_Q_	~		ک	PET	r		7.29.1 Date	/
Conditions of approval, if any, are attached certify that the applicant holds legal or eq which would entitle the applicant to cond	uitable title to those rights in th		Office	C	FD				
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a statements or representations a	a crime for any p s to any matter w	erson knowin /ithin its juriso	gly and diction.	willfully to	make to any de	partment or	agency of the United	
(Instructions on page 2) ** BI M REV	ISED ** BLM REVISE	D ** BI M RI	EVISED *	* BLM	REVISE	ED ** BLM	REVISE	D **	

r

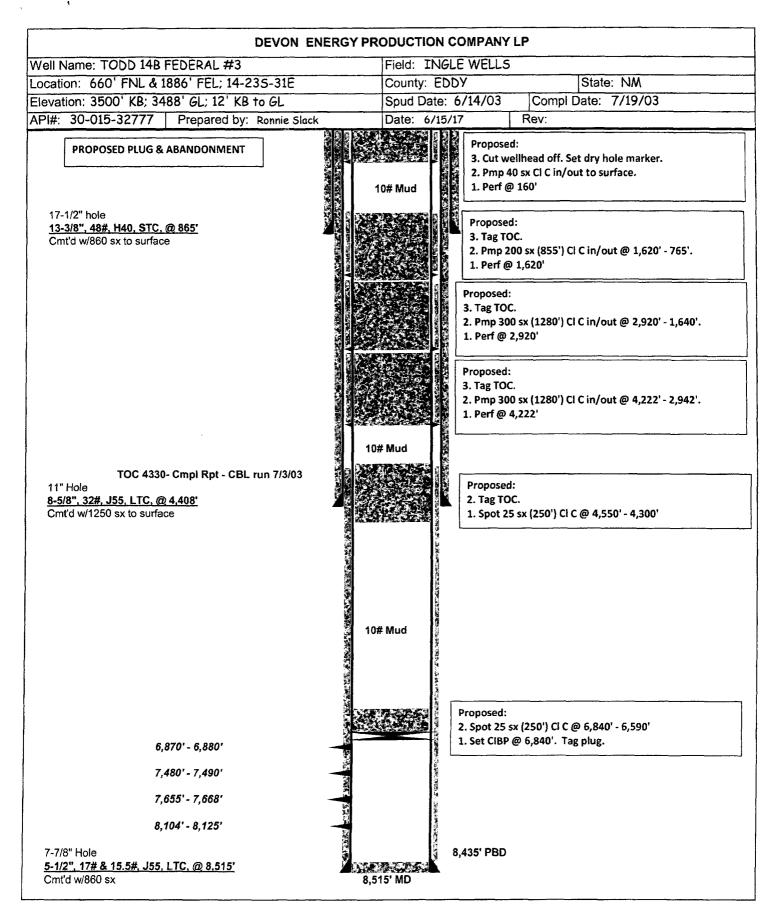

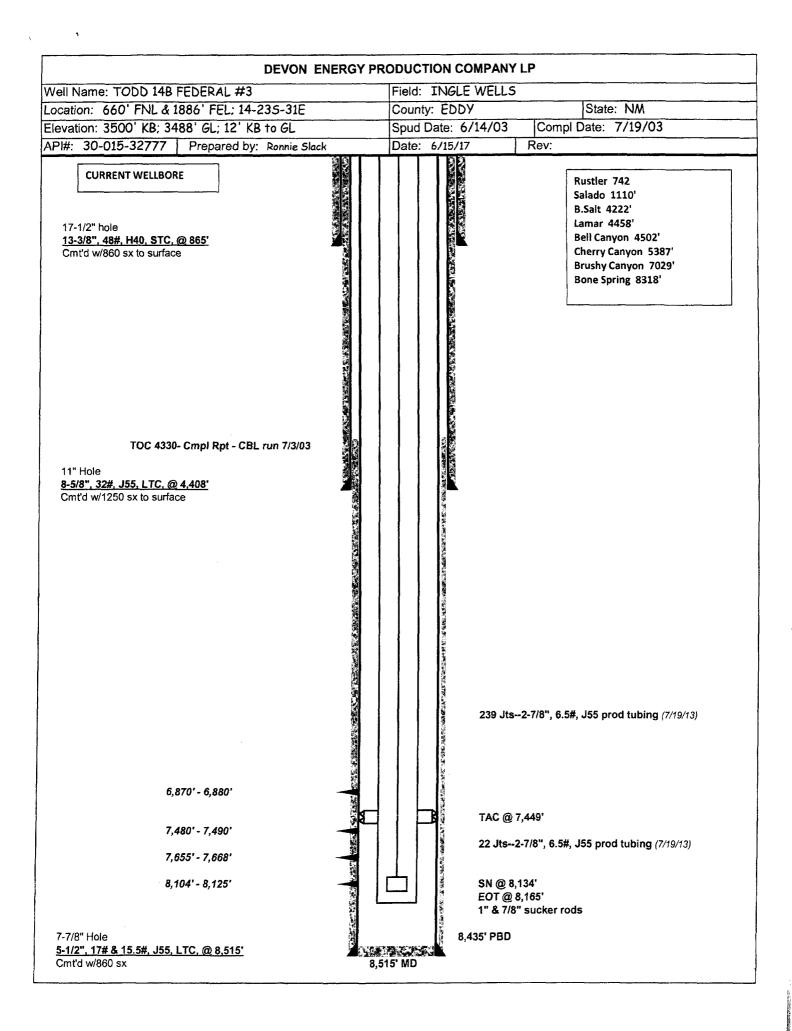

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Appropriate time for submittal would be when filing the Vell Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

ι.•

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612