#### **UNITED STATES** DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

OCD Artesia


FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

# 5. Lease Serial No. NMNM2747

	OTICES AND REPORTS ON WEL	
Do not use this	form for proposals to drill or to re-en	nter an
	Use form 3160-3 (APD) for such pro	

abandoned we	II. Use form 3160-3 (APD)	for such proposals.	6. If Indian, Allotto	ee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well  ☑ Oil Well ☐ Gas Well ☐ Oth	her		8. Well Name and JACKSON B 1		
2. Name of Operator EOG Y RESOURCES INC		INA HUERTA	9. API Well No.	0.00.04	
3a. Address			30-015-0404		
104S 4TH STREET ARTESIA, NM 88210		3b. Phone No. (include area code) Ph: 575-748-4168	SQUARE LA	or Exploratory Area KE	
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)		11. County or Paris	sh, State	
Sec1 T17S R30E NESE 1980	DFSL 660FEL		EDDY COUN	ITY, NM	
12. CHECK THE AI	PPROPRIATE BOX(ES) T	O INDICATE NATURE O	F NOTICE, REPORT, OR O	THER DATA	
TYPE OF SUBMISSION		TYPE OF	FACTION		
Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	■ Water Shut-Off	
_	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	☐ Well Integrity	
☐ Subsequent Report	Casing Repair	■ New Construction	☐ Recomplete	☐ Other	
☐ Final Abandonment Notice	□ Change Plans	Plug and Abandon	☐ Temporarily Abandon		
	☐ Convert to Injection	□ Plug Back	☐ Water Disposal		
EOG Y Resources, Inc. plans  1. MIRU all safety equipment a 2. RIH with GR/JB to 2850 ft. 3. Set a CIBP at 2830 ft. Load 4. Run Gyro Survey from CIBF 5. Spot a 25 sx Class C cemer 6. Spot a 25 sx Class C cemer 7. Perforate 5-1/2 inch casing	as needed. POOH with pro I hole with plugging mud an P up to surface. It plug on top of CIBP from	duction equipment.  d pressure test casing.  2580 ft - 2830 ft. WOC and	itag. Greyburg	HED FOR S OF APPROVAL	
7. Perforate 5-1/2 inch casing 8. Squeeze a 35 sx Class C in 9. Perforate 5-1/2 inch casing 10. Squeeze a 170 sx Class C	inside/outside cement plug	from 620 ft up to surface.	oc 72g	NOV 0 6 2018	
		le marker	required, DIST	RICT IL-ARTESIA O.C.D.	
14. I hereby certify that the foregoing is  Commi  Name (Printed/Typed) TINA HUE	Electronic Submission #43 For EOG Y RE tted to AFMSS for processing		Information System arlsbad in 09/28/2018 (18DLM0758SE) ATORY SPECIALIST	11-2-18 MMOCD	
			(عينها	102	
Signature (Electronic S	ubmission)	Date 09/27/20	D18 Acces		
	THIS SPACE FOR	FEDERAL OR STATE (	OFFICE USE		
Approved By	a Q. ann	Title Su	IV. PET	10-23-18 Date	
onditions of approval, if any, are attached ertify that the applicant holds legal or equi high would entitle the applicant to conduc	table title to those rights in the su	t warrant or bject lease Office			
tle 18 U.S.C. Section 1001 and Title 43 L States and false, fictitious or fraudulent st	J.S.C. Section 1212, make it a crit	ne for any person knowingly and	willfully to make to any department	or agency of the United	

(Instructions on page 2)
\*\* BLM REVISED \*\*

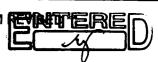

# Additional data for EC transaction #437479 that would not fit on the form

#### 32. Additional remarks, continued

11. Cut off wellhead. Install below ground level Dry Hole Marker. Clean location as per regulated.

Wellbore schematics attached

WELL NAME: Jackson B #18 FIELD:

LOCATION: 1980' FSL & 660' FEL Sec.1-17S-30E

GL: <u>3,731</u> ZERO: KB:

8 5/8" Csg @ 571' Cmt'd w/ 50sx

TOC by Temp Survey @ 1,820'

COMMENTS: API No.: 30-015-04040

### **CASING PROGRAM**

8 5/8" 24#	571'	Γ
5 1/2" 15.5#	3,222'	



## **TOPS**

T. Salt 557'
B. Salt 1,358'
Queen 2,345'
GB 2,746'
San Andres 3,052'
Lovington 3,167'

Perfs: 2,705' - squeezed


Perfs: 2,881' - 91'

Perfs: 2,916' - 30' & 80-86' Perfs: 3,044' - 54' & 26-32'

Perfs: 3,173' – 83' Perfs: 3,202

TD: 3,224' 5.5" Csg @ 3,222' Cmt'd w/ 190sx

Not to Scale 9/24/18 JDE

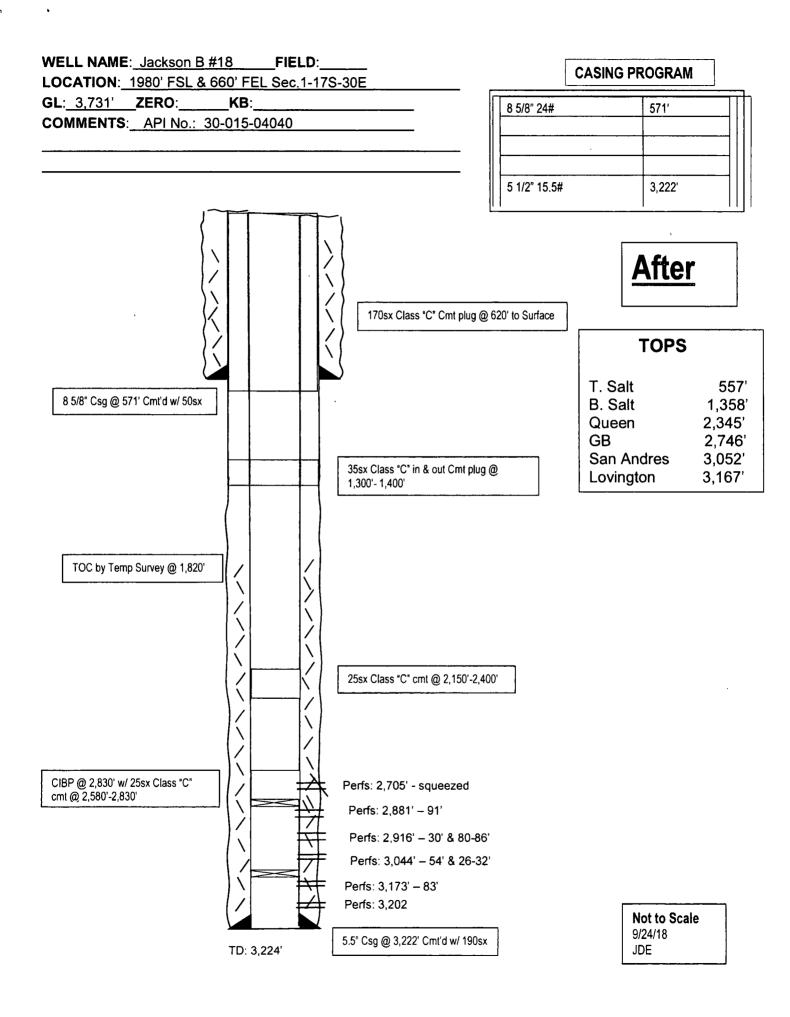

# BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

# Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted