UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Operator

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 201

	OMB NO. 1004- Expires: January 3
5.	Lease Serial No. NMNM88139

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter ar abandoned well. Use form 3160-3 (APD) for such proposal	1 S.
	_

	INIMINIO 139				
6.	If Indian, Allottee or	ribe Name			

SUBMIT IN T	7. If Unit or CA/Agreement, Name and/or No.							
1. Type of Well	8. Well Name and No. WOOD DRAW 35 FEDERAL 2							
2. Name of Operator OXY USA INCORPORATED	ART		9. API Well No. 30-015-35258-00					
3a. Address 5 GREENWAY PLAZA SUITE HOUSTON, TX 77046-0521	E-Mail: david_stew	OIL CONS include nea (Add) .5747 TES (Add)	ERVATION STRICT	10. Field and Pool or E	xploratory Area NYON-DELAWARE			
4. Location of Well (Footage, Sec. T.	, R., M., or Survey Description)		DEC 11	2018	11. County or Parish, State			
Sec 35 T24S R29E SWSE 330					EDDY COUNTY, NM			
			RECEIVED					
12. CHECK THE AP	PROPRIATE BOX(ES)	TO INDICAT	E NATURE OI	NOTICE,	REPORT, OR OTH	ER DATA		
TYPE OF SUBMISSION	TYPE OF ACTION							
Notice of Intent	☐ Acidìze	Deep	en	Product	tion (Start/Resume)	☐ Water Shut-Off		
Motice of Intent	☐ Alter Casing	☐ Hydr	aulic Fracturing	☐ Reclam	ation	■ Well Integrity		
☐ Subsequent Report	□ Casing Repair	□ New	Construction	Construction		Other		
☐ Final Abandonment Notice	□ Change Plans	🔀 Plug	and Abandon	☐ Tempor	rarily Abandon	/		
	Convert to Injection	Plug	Back	■ Water I	Disposal	<i>'</i>		
following completion of the involved operations. If the operation results in a multiple completion in a new interval, a Form 3160-4 must be filled once testing has been completed. Final Abandonment Notices must be filled only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. TD-7340'M 5345'V PBTD-7297'M 5347'V Perfs-5872-7050' 9-5/8" 36# csg @ 810' w/ 430sx, 12-1/4" hole, TOC-Surf-Circ 5-1/2" 17# csg @ 7340' DVT @ 4262' w/ 2650sx, 8-3/4" hole, TOC-Surf-Circ 1. RiH & set CIBP @ 5300' w/ 25sx cmt to 5150' 2. M&P 25sx cmt @ 4315-4165' WOC-Tag 4. M&P 25sx cmt @ 3229-2970' WOC-Tag 5. M&P 25sx cmt @ 3229-2970' WOC-Tag 5. M&P 110sx cmt @ 3229-2330' WOC-Tag 5. M&P 110sx cmt @ 366' to surface 970 - \$252 - \$2400 (7/22) \\ 1. 10# MLF between plugs - Above ground steel tanks will be utilized CONDITIONS OF APPROVAL								
14. I hereby certify that the foregoing is	Electronic Submission #	A INCORPORA	TED, sent to the	Carisbad	•			
Name (Printed/Typed) DAVID S	TEWART		Title REGUL	ATORY AL	OVISOR			
Signature (Electronic	Submission)		Date 09/13/2	2018				
	THIS SPACE FO	OR FEDERA	L OR STATE	OFFICE (JSE			
Approved By	12 Care		Title See	1.J. AL	57	9.22-18 Date		
Approved By Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would enable the applicant to conduct operations thereon. Title Sugu. IET Date Office Carlshaf F. W Office								
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.								
(Instructions on page 2) ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** Leve we d from Opnata- Never received from Blm 13.11-18								

OXY USA Inc. - Proposed Wood Draw 35 Federal #2 API No. 30-015-35258 900


110sx @ 860'-Surface


2522-2400 25sx @ 2460-2336' WOC-Tag

32TD--35sx @ 8220-2970' WOC-Tag

25sx @ 4315-4165' WOC-Tag

CIBP @ 5300' w/ 25ex to 5150'

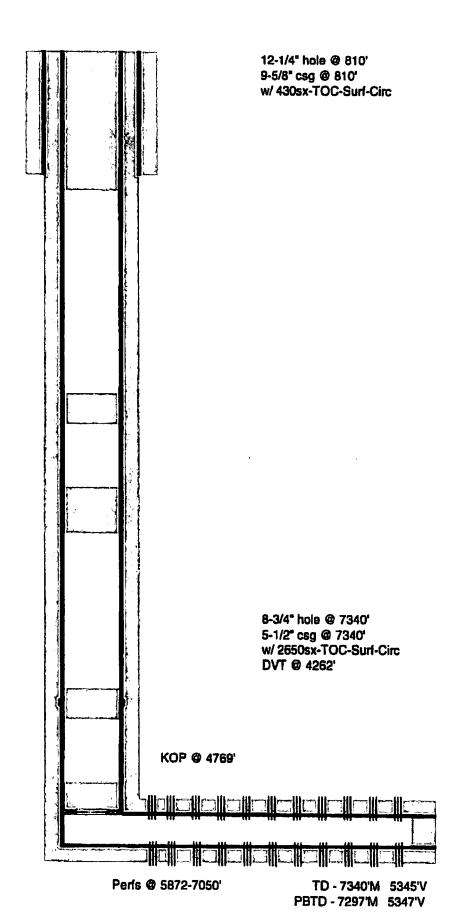

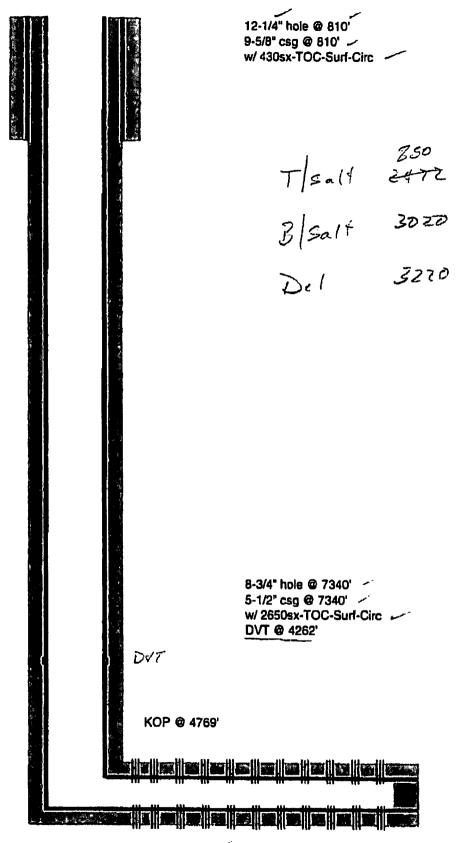

Perfs @ 5872-7050' /

TD - 7340'M 5345'V PBTD - 7297'M 5347'V

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.