Form 3160-5 (June 2015)

Name of Operator

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED

	OMB NO. 1004-0137
	Expires: January 31, 2018
5.	Lease Serial No.
	NMLC037777A

SUNDRY NOTICES AND REPORTS ON Do not use this form for proposals to drill or to abandoned well. Use form 3160-3 (APD) for suc	re-enter an
SUBMIT IN TRIPLICATE - Other instructions	on page 2
1. Type of Well R Oil Well Gas Well Gas Well Other	

6. If Indian, Allottee or Tribe Name	
7. If Unit or CA/Agreement, Name a	and/or No.
8. Well Name and No. LEVERS 3Y	
9. API Well No.	

WICH OPERATING OF NWILLC	E-Mail: appym@pcmandassociates.com	30-015-02/87-00-\$1
3a. Address 107 MAIN STREET SEALY, TX 77474	3b. Phone No. (include area code) Ph: 432-580-7161	10. Field and Pool or Exploratory Area GRAYBURG JACKSON-SR-Q-GRB0
4. Location of Well (Footage, Sec., T., R.,	M., or Survey Description)	11. County or Parish, State
Sec 33 T16S R29E SESW 330FSI	. 1970FWL	EDDY COUNTY, NM

Contact: ABIGAIL ANDERSON

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION				
☑ Notice of Intent☐ Subsequent Report☐ Final Abandonment Notice	☐ Acidize ☐ Alter Casing ☐ Casing Repair ☐ Change Plans ☐ Convert to Injection	 □ Deepen □ Hydraulic Fracturing □ New Construction ☑ Plug and Abandon □ Plug Back 	☐ Production (Start/Resume) ☐ Reclamation ☐ Recomplete ☐ Temporarily Abandon ☐ Water Disposal	☐ Water Shut-Off ☐ Well Integrity ☐ Other	

1. Set 5 1/2" CIBP @ 2316'. Circulate hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 2316-2116'. Add Plus from 2. Perf & Sqz 50 sx cmt @ 750-550'. WOC & Tag (B/Salt) 3. Perf & Sqz 50 sx cmt @ 368-200'. WOC & Tag (8 5/8" Shoe & T/Salt) 1430 (Du) 4. Perf & Sqz 25 sx cmt @ 60'-Surface. Deep Shots, Both 5/2 & 85/8" C59. Soz Surf. Both 5. Cut off well head, verify cmt to surface, weld on Below-Ground Dry Hole Marker.

5/2 £ 85/8" CSq. SOZ Sunf. Both.

RECEIVED

C c 4/36/19 Accepted for record NMOCD

APR 2 5 2019

SEE ATTACHED FOR CONDITIONS OF APPROVAL

	DISTRICT II-	ARTES	AO.C.D.	
14. I hereby certify that t	he foregoing is true and correct. Electronic Submission #461194 verific For MCI OPERATING OF N Committed to AFMSS for processing by DEBC	d by the	e BLM Well Information System sent to the Carlsbad	
Name (Printed/Typed)	ABIGAIL ANDERSON	Title	AGENT	
Signature	(Electronic Submission)	Date	04/11/2019	,
	THIS SPACE FOR FEDERA	AL OR	STATE OFFICE USE	
		T		11-111-10

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.


Title

Title & U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

rtinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.


MCI Ope	rating		
Author:	BCM & Associates, Inc		•
Well Name	Levers Federal	Well No.	#3Y
Field		API #:	30-015-02787
County	Eddy	Lease/ID#	
State	New Mexico	Zone:	Grbg Jackson
Spud Date	12/11/1958		330'FSL & 1970'FWL
GL	3599'		Sec 33, T16S, R29E

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8		28#	318	12 1/4	75	79'
Prod Csg	5 1/2		17#	2,502	7 7/8	150	1360'

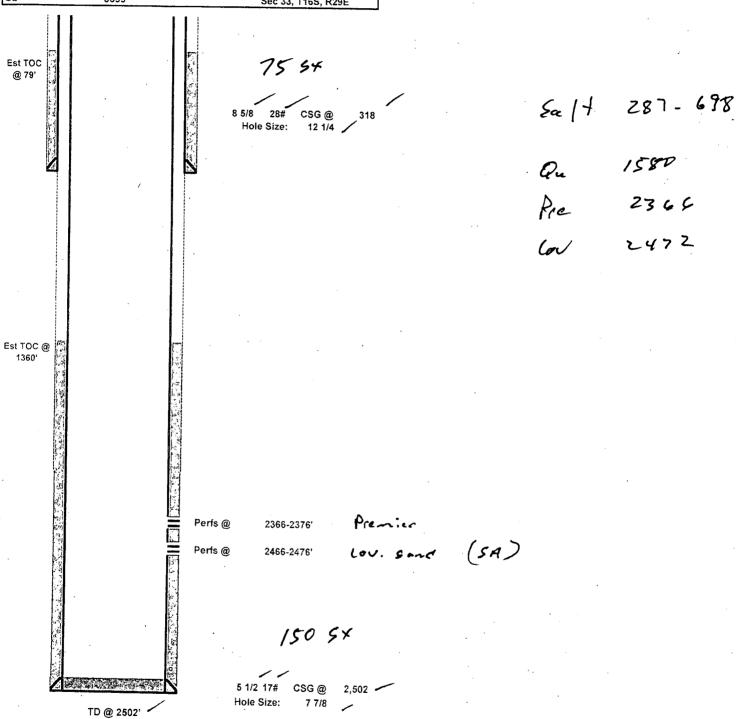

MCI Ope	rating		
Author: Well Name	BCM & Associates, Inc	·	
	Levers Federal	Well No.	#3Y
Field		API#:	30-015-02787
County	Eddy .	Lease/ID#	
State	New Mexico	Zone:	Grbg Jackson
Spud Date	12/11/1958	:	330'FSL & 1970'FWL
GL	3599'		Sec 33, T16S, R29E

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8		28#	318	12 1/4	75	· 79'
Prod Csg	5 1/2		17#	2,502	7 7/8	150	1360'

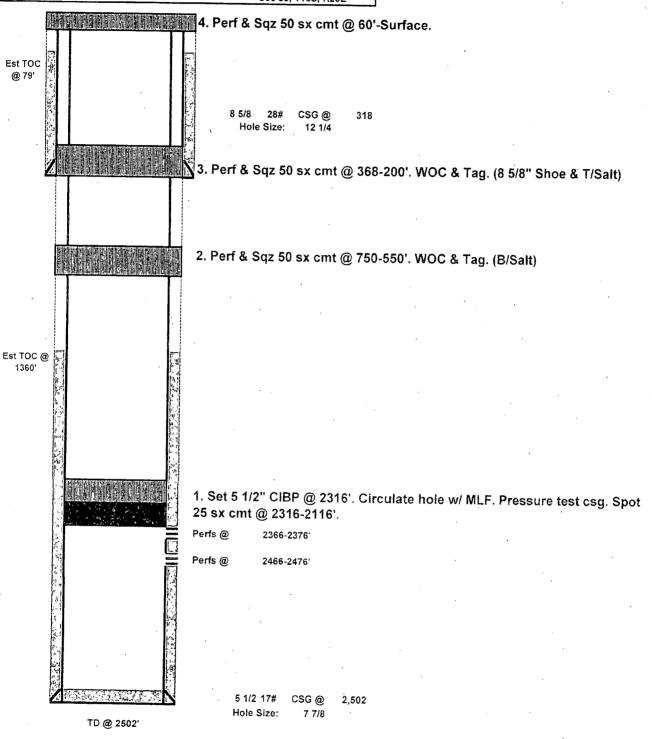

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.