
Form 3160-5 (June 2015)						FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018		
	SUNDRY	NOTICES AND REPO	RTS ON WELLS		10010	 Lease Serial No. NMLC065457 		
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.						6. If Indian, Allottee or Tribe Name		
	SUBMIT IN	TRIPLICATE - Other ins	tructions on page 2			7. If Unit or CA/Agre	ement, Name and/or N	
1. Type of Well						8. Well Name and No. J M GATES FEDERAL NCT-1 3		
2. Name of Operator Contact: DAVID A EYLER CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@MILAGRO-RES.COM						9. API Well No. 30-015-34030-00-S1		
3a. Address 600 N MARIEI MIDLAND, TX	NFELD STE 60	0	3b. Phone No. (include area code) Ph: 432-687-3033			 Field and Pool or Exploratory Area WHITE CITY-PENN (GAS) 		
4. Location of Well		1)			11. County or Parish, State			
Sec 30 T24S I	R26E NESW 13				EDDY COUNTY, NM			
12. C	HECK THE A	PPROPRIATE BOX(ES)	TO INDICATE NAT	URE OF	NOTICE,	REPORT, OR OTI	HER DATA	
TYPE OF SU			TYPE OF ACTION					
Notice of Int	ont	Acidize	Deepen		Product	ion (Start/Resume)	U Water Shut-O	
. —		Alter Casing	-		🗖 Reclam	ation	🗖 Well Integrity	
□ Subsequent I	Report -	Casing Repair	New Construction		Recomplete		Other	
Final Abandonment Notice		 Change Plans Convert to Injection 			Tempor	arily Abandon		
13. Describe Propose	d or Completed Op	eration: Clearly state all pertine ally or recomplete horizontally	Plug Back	ed starting of	iate of any p	roposed work and appro	ximate duration there	
determined that th 1) SET 5-1/2" 2) PUMP 25 S 3) PUMP 25 S 4) PUMP 50 S 5) PERF. X Cl 6) DIG OUT X	ne site is ready for f CIBP @ 8,950'; XS.CMT. @ 7,2 XS.CMT. @ 5,2 XS.CMT. @ 1,7 IRC. TO SURF.	PUMP 85 SXS.CMT. @ 293'-7,123'(5-1/2''DV TOC 347'-5,197'(T/BNSG.). 702'-1,355'(T/DLWR.,9-5/ , FILLING ALL ANNULI, LLHEAD 3' B.G.L.; VERIF	8,950'-8,262'(T/WCMF DL); WOC X TAG CMT 8"CSG.SHOE,B/SALT 100 SXS.CMT. @ 285'-	P.); CIRC. . PLUG.); WOC X -3'.	WELL.		·	
DURING THIS THE REQUIR	S PROCEDURE ED DISPOSAL,	WE PLAN TO USE THE PER OCD RULE 19.15.	CLOSED-LOOP SYS	TEM W/ A	STEEL -	FANK AND HAUL C	ONTENTS TO	
	,		S	SEE A	TTAC	HED FOR		
			(COND	ITION	SOFAPPR	OVAL	
14. I hereby certify		s true and correct. Electronic Submission # For CIMAREX ENI nmitted to AFMSS for proc	469411 verified by the E ERGY COMPANY OF CO essing by PRISCILLA P	BLM Well I), sent to EREZ on (nformation the Carlsb 06/17/2019	n System ad (19PP2486SE)		
Name(Printed/Ty	ped) DAVID A	EYLER	Title ,	AGENT				
Signature	(Electronic S	Submission)	Date	Date 06/17/2019				
			OR FEDERAL OR S	TATE O	FFICE U	SE	<u>. </u>	
	Jamas	a. amos	Title	SAE			6-22 Date	
Approved By	· · · · · · · · · · · · · · · · · · ·	d. Approval of this notice does	s not warrant or					
Conditions of approval	nt holds legal or equ	uitable title to those rights in th act operations thereon.	e subject lease Office	(fo				
Conditions of approval certify that the applicat which would exitle the Title 18 L.S.C. Section	nt holds legal or eque e applicant to condu- n 1001 and Title 43	uitable title to those rights in th act operations thereon. U.S.C. Section 1212, make it a statements or representations as	Office crime for any person know	ingly and w	illfully to m	ake to any department or	agency of the United	

Cimarex Energy Co. of Colorado CIMAREX KB - 23' above GL J M Gates NCT-1 Federal #3 SHL - 1350' FSL & 2050' FWL BHL - 1374' FSL & 1616' FWL Sec. 30, T-24-S, R-26-E, Eddy Co., NM API # 30-015-34030 S. Gengler 01/30/2012 T/Salt 200 171/2 **24ч** 13-3/8", 54.5# J-55 csg @ 235' cmtd w/ 250 sx, cmt circ B/salt 800 Del 1500 TOC @ 980' by CBL 121/1 9-5/8", 40# N-80 csg @ 1570 1572 cmtd w/ 1125 sx. cmt circ 5272 BS 273 jts 2-3/8" 4.7# L-80 Tbg DV Tool @ 7208' cmtd w/ 2270 sx 1st stage Core 834 the WC 18312 On-off Tool w/ 1.875" X Profile nipple @ 8887' Arrowset 1-X pkr @ 8895' 1.875" XN Profile Nipple @ 8902' End of tbg @ 8907' Wolfcamp perfs (9009' - 9747') -----9876 C.Sco-CAN 1 23 5-A PBTD @ 10414' 10182 54 CIBP @ 10450' 11023 CIBP @ 10450' *M* **e** Morrow perfs (11491' - 11500')-Composite BP @ 11550' Morrow perfs (11572' - 11603') Composite BP @ 11760' Morrow perfs (11786' - 11795') 12215 PBTD @ 12117 5-1/2" 17# P-110 @ 12207' cmtd w/ 1200 sx, cmt circ TD @ 12207' rinted 6/10/20

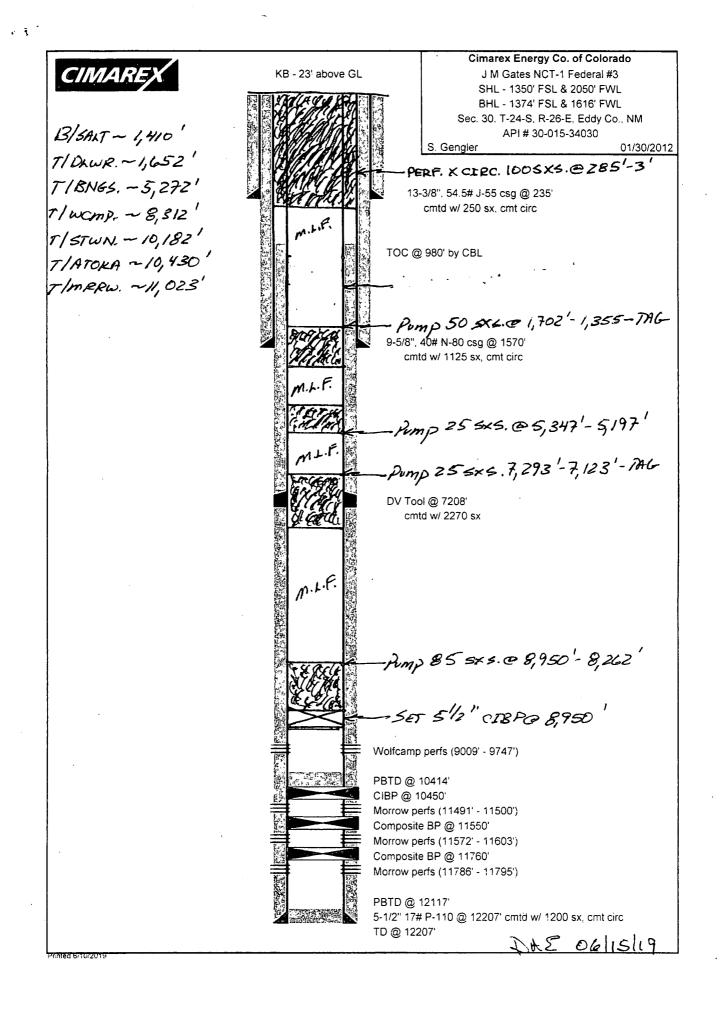

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

. 1

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>mimety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.