Form 3160-5 (June 2015) 1

UNITED STATES DEPARTMENT OF THE INTERIOR ISDACION FIELD STATES OMB NO. 1004-0137 BUREAU OF LAND MANAGEMENT ISDACION FIELD ST. Lease Serial No. NMNM118707

SUNDRY NOTICES AND REPORTS ON WELLS CO. A PIESTS

abandoned wel	I. Use form 3160-3 (APD) for	such proposals.	6. If Indian, Allottee	or Tribe Name	
SUBMIT IN 1		7. If Unit or CA/Agreement, Name and/or No.			
1. Type of Well	8. Well Name and No DELAWARE RA	8. Well Name and No. DELAWARE RANCH 13/24 W1DM FEDC 2H			
Oil Well Gas Well Oth Name of Operator MEWBOURNE OIL COMPAN	9. API Well No. 30-015-43471				
3a. Address P O BOX 5270 HOBBS, NM 88241	Phone No. (include area code) 575-393-5905	10. Field and Pool o	r Exploratory Area E-WOLFCAMP (GAS)		
4. Location of Well (Footage, Sec. 7) Sec 13 T26S R28E NWNW 54	30 18-5		11. County or Parish EDDY COUNT		
12. CHECK THE AF	PPROPRIATE BOX(ES) TO I	NDICATE NATURE OI	F NOTICE, REPORT, OR OT	THER DATA	
TYPE OF SUBMISSION		ACTION			
☐ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	■ Water Shut-Off	
	Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	■ Well Integrity	
Subsequent Report	Casing Repair	■ New Construction .	☐ Recomplete	Other	
☐ Final Abandonment Notice	☐ Change Plans	Plug and Abandon	□ Temporarily Abandon	Well Spud	
	Convert to Injection	Plug Back	■ Water Disposal		
testing has been completed. Final Ab determined that the site is ready for final No. 109/09/19 Spud 17 1/2" hole. TD hole @ Class C w/additives. Mixed @ 09/09/19. Circ 210 sks of cmt 09/12/19, tested csg to 1500# bit.	nal inspection. 304'. Ran 290' of 13 3/8" 54.5 14.8#/g w/1.34 yd. Displaced to the pit. Test BOPE to 5000#	# J55 ST&C Csg. Cemer W/38 bbls FW. Plug dowr t & Annular to 3500#. At	nted with <u>425 sks</u> n @ 10:45 PM 1:00 A.M. with 12 1/4"	•	
Charts & Schematic attached.				CONSERVATION ESIA DISTRICT	
Bond on file: NM1693 nationwide & NMB000919			SEP 23		
		GC 10	ng - rimercu	RECEIVED	
14. I hereby certify that the foregoing is	Electronic Submission #48357	OIL COMPANY, sent to the	e Carlsbad		
Name(Printed/Typed) JACKIE LATHAN		Title AUTHO	Title AUTHORIZED REPRESENTATIVE		
Signature (Electronic S	Submission)	Date 09/16/20	019		
	THIS SPACE FOR F	EDERAL OR STATE (OFFICE USE		
Approved By Conditions of approval, if any, are attached sertify that the applicant holds legal or equivalent would entitle the applicant to conduct the applicant	itable title to those rights in the subje	Title	cepted for Record Jonathon Shepard Carlsbad Field Office	SEP _{ate} 1 7 2019	
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s			willfully to make to any department	or agency of the United	


MAN WELDING SERVICES, W.

Company Mey, barne Date 9-11-19
Lease Dr 13/24 WIDM F. J. Com 24 County Eddy
\wedge
Drilling Contractor Patterson Plug & Drill Pipe Size 41/2 1 F/XT-39
Accumulator Pressure: Manifold Pressure: Annular Pressure:
Accumulator Function Test - OO&GO#2
To Check - USABLE FLUID IN THE NITROGEN BOTTLES (III.A.2.c.i. or ii or iii)
 Make sure all rams and annular are open and if applicable HCR is closed. Ensure accumulator is pumped up to working pressure! (Shut off all pumps)
Open HER Valve. (If applicable) Close annular. Close all pipe rams.
 4. Open one set of the pipe rams to simulate closing the blind ram. 5. For 3 ram stacks, open the annular to achieve the 50+ % safety factor. (5M and greater systems).
6. Record remaining pressure 1300 psi. Test Fails if pressure is lower than required. a (950 psi for a 1500 psi system) b. (1200 psi for a 2000 & 3000 psi system) 7. If annular is closed, open it at this time and close HCR.
7. Il aminiai is closed, open it at this time and close treet.
To Check - PRECHARGE ON BOTTLES OR SPHERICAL (III.A.2.d.)
To Check - PRECHARGE ON BOTTLES OR SPHERICAL (III.A.2.d.) Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system}
Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure) 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to.
Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure)
Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure) 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to. 3. Record pressure drop psi. Test fails if pressure drops below minimum. 4. Minimum: a. [700 psi for a 1500 psi system] b. {900 psi for a 2000 & 3000 psi system} To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.)
O Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure) 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to. 3. Record pressure drop psi. Test fails if pressure drops below minimum. Minimum: a. {700 psi for a 1500 psi system} b. {900 psi for a 2000 & 3000 psi system} To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.) • Isolate the accumulator bottles or spherical from the pumps & manifold.
Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure) 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to. 3. Record pressure drop psi. Test fails if pressure drops below minimum. 4. Minimum: a. [700 psi for a 1500 psi system] b. {900 psi for a 2000 & 3000 psi system} To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.)
O Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure) 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to. 3. Record pressure drop psi. Test fails if pressure drops below minimum. Minimum: a. {700 psi for a 1500 psi system} b. {900 psi for a 2000 & 3000 psi system} To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.) • Isolate the accumulator bottles or spherical from the pumps & manifold.
Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure) 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to. 3. Record pressure drop psi. Test falls if pressure drops below minimum. 9 Minimum: a. {700 psi for a 1500 psi system} b. {900 psi for a 2000 & 3000 psi system} To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.) 9 Isolate the accumulator bottles or spherical from the pumps & manifold. Open the bleed off valve to the tank. [manifold psi/should/go/to 0 psi } close bleed valve. 1. Open the HCR valve, (if applicable) 2. Close annular.
Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure) 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to. 3. Record pressure drop
Start with manifold pressure at, or above, maximum acceptable pre-charge pressure: a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system} 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure) 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to. 3. Record pressure drop psi. Test falls if pressure drops below minimum. 9 Minimum: a. {700 psi for a 1500 psi system} b. {900 psi for a 2000 & 3000 psi system} To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.) 9 Isolate the accumulator bottles or spherical from the pumps & manifold. Open the bleed off valve to the tank. [manifold psi/should/go/to 0 psi } close bleed valve. 1. Open the HCR valve, (if applicable) 2. Close annular.

2	
	WELDING SERVICES
Allon a	40 mb 100
nut to	Mouthailas

WELDING • BOP TESTING NIPPLE UP SERVICE • BOP LIFTS • TANDEM MUD AND GAS SEPARATORS

Lowington, NM · 576-390-4548

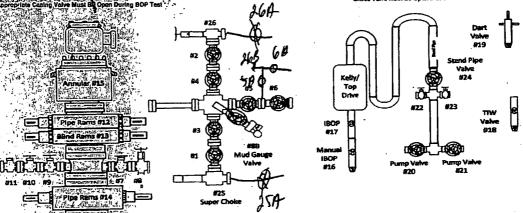

TEST 0	TIBAB TESTED	TEST LENGTH	LOW PS	HIGH PSI	REMARKS
/23	826A 25A 646	10-0	20	5000	Assal
7	8 2526866	BUMP	TOST	500/	Asd
3	17 9718	10-10	20	500	Passed, 4/2if-
1	12/08-19	N-W	27	Sou	PGSSed 4/2/2
5	14/19	10-10	ZV	5000	Resser U/2 if
6	1897.19	70-0	ZV	350	Livil 4/hil
7	131112568	10=0	20	500U	Passal
9	19/18	10=0	250	500	Kasin XT-39
7	1298334596	10:00	20)	Sad	Passed VI-39
1	19.99	10-60.	2h	30	A 5126 17-39
1300	14/	1V-W	200	3000	Passed 1739
7	70/2/22238	10-11	20	500	land
12	24	10-4	F-45	Da/	Prived
4	16	1040	20	50W	Paris
<u>' -</u>	1.4	1 3	<u> </u>	7.47.	
		2		,07515	
	<u> </u>	-	<u> </u>		
		-	 	 	
		-	 	ļ	

Used single port Pump in SUB on Both 41/2 if 1 XT-39

