

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	1
ALBUQUERQUE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

SEP 9 1980

5a. Indicate Type of Lease

State Fee

5. State Oil & Gas Lease No.
647-368
647-363 647-320

SUNDRY NOTICES AND REPORTS ON WELLS

O. C. D.

ARTESIA, OFFICE

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT DEPTH. USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name Empire Abo Pressure Maintenance Project
2. Name of Operator ARCO Oil & Gas Company Division of Atlantic Richfield Company ✓	8. Farm or Lease Name Empire Abo Unit "F"
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240	9. Well No. 382
4. Location of Well UNIT LETTER <u>F</u> <u>2400</u> FEET FROM THE <u>North</u> LINE AND <u>1600</u> FEET FROM THE <u>West</u> LINE, SECTION <u>35</u> TOWNSHIP <u>17S</u> RANGE <u>28E</u> NMPM.	10. Field and Pool, or Wildcat Empire Abo
15. Elevation (Show whether DF, RT, GR, etc.) 3675.6' GR	12. County Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK
TEMPORARILY ABANDON
PULL OR ALTER CASING

PLUG AND ABANDON
CHANGE PLANS

REMEDIAL WORK
COMMENCE DRILLING OPNS.
CASING TEST AND CEMENT JOBS
OTHER

ALTERING CASING
PLUG AND ABANDONMENT

OTHER Repair Water flow

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Rig up, kill well, install BOP, POH w/ comp assy.
- Set RBP above present Abo perms, spot sd on top.
- Run CBL.
- Perf 5 1/2" csg 15-20' above TOC as indicated by CBL.
- Run pkr, set above perms & break circ. POH w/ pkr.
- Run & set cmt retr above squeeze perms, circ cmt thru squeeze holes to surface, close BH valve & pump cmt until press builds up. WOC.
- Drill out retr & cmt, press test squeeze job, rec BP, run comp assy & returns to production

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED George W. Schmidt

TITLE Dist. Drlg. Supt.

DATE 9/8/80

APPROVED BY W.A. Gussert

TITLE SUPERVISOR, DISTRICT II


DATE SEP 10 1980

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

SEP 9 1980

O. C. D.
ARTESIA, OFFICE

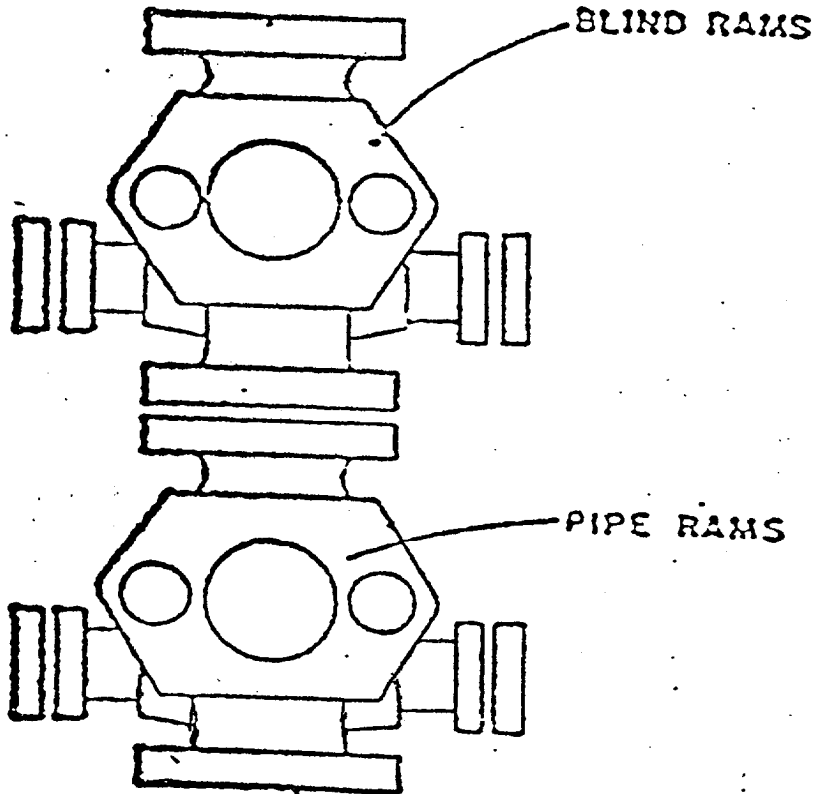

ATLANTIC RICHFIELD COMPANY
Blow Out Preventer Program

Lease Name Empire Abo Unit "F"

Well No. 382

Location 2400' FNL & 1600' FWL

Sec 35-17S-28E, Eddy County, N M

BOP to be tested before installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.