


General Purpose Worksheet

Subject	TURNER 'A' #17		Page No.	01
File	PROPOSED P & A.	By	WCH	Date 10-24-85

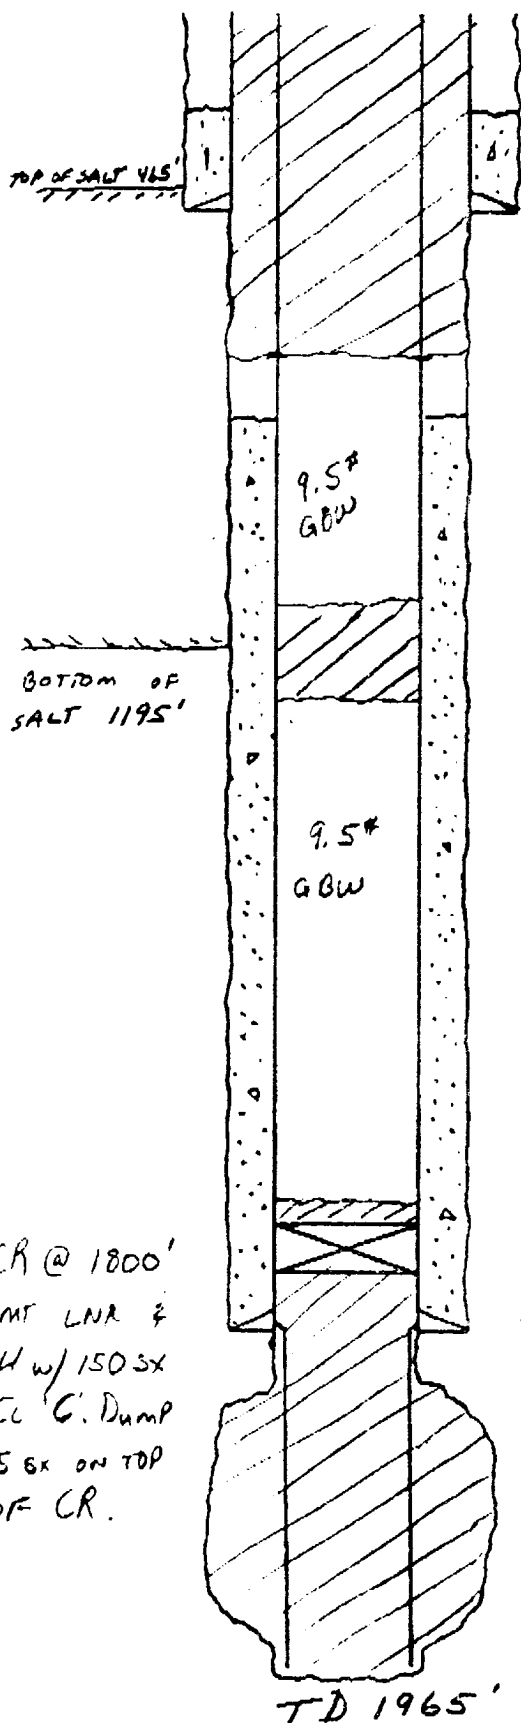

7" 17# CS₄ @ 493' w/50 SX. TOC @ 240'-CALC

PERF 5 1/2" @ 700'. EST IR DOWN CS₄. CMT 5 1/2" CS₄ & 5 1/2" X 7" ANN F/700-SURF w/ 275 SX CL 'C'. WHEN CMT RETURNS OUT 5 1/2" X 7" ANN, CLOSE CS₄ VALVE & SQZ REMNG CMT INTO FORM.

200' CMT PLUG F/1300-1100' w/25 SX CL 'C'.

CR @ 1800'
CMT LNR &
OH w/150 SX
CL 'C'. Dump
35 SX ON TOP
OF CR.

5 1/2" 14# CS₄ @ 1847' w/100 SX. TOC @ 810'-CALC

SEVEN RIVERS OH 1847-1965'
1870-1945' SHOT w/200 OTS NITRO

4 1/2" INSERT LNR @ 1950', TOL 1843'. NOT CMTD.

TD 1965'