

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN DUPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> P & A		2. NAME OF OPERATOR Atlantic Richfield Company		3. ADDRESS OF OPERATOR P. O. Box 1978, Roswell, New Mexico 88201		4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1650' FNL & 2310' FWL (Unit letter F)		5. LEASE DESIGNATION AND SERIAL NO. LC 047633 (a)		6. IF INDIAN, ALLOTTEE OR TRIBE NAME		7. UNIT AGREEMENT NAME		8. FARM OR LEASE NAME Swearingen "A"		9. WELL NO. 1		10. FIELD AND POOL, OR WILDCAT Shugart		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 14, T18S, R31E		12. COUNTY OR PARISH Eddy		13. STATE N.M.	
14. PERMIT NO.		15. ELEVATIONS (Show whether DF, RT, CR, etc.)																							

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This well has been plugged & abandoned in the following manner:

Set 7" CIBP @ 3140' WLM & capped w/2 sx cement. Shot off 7" casing and recovered 28 jts 7" 20# 10V casing = 880.67'. Spotted 46 sack cement plug 780-940'; 24 sack cement plug 90' to surface. Erected dry hole marker. 8-1/4" casing string remains intact. 9#/gal gel mud was left between plugs. Well P & A 9/10/71.

Your office will be notified when location is ready for inspection.

18. I hereby certify that the foregoing is true and correct

SIGNED

A. D. Letcher

TITLE

Dist. Drlg. Supervisor

DATE

9/15/71


(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

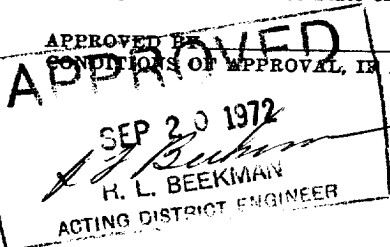

*See Instructions on Reverse Side