

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

c/18p

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240


DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30-015-22694
Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE
State Oil & Gas Lease No. 352350
Lease Name or Unit Agreement Name Indian Hills State Comm
Well No. 2
Pool name or Wildcat Cemetery; Morrow

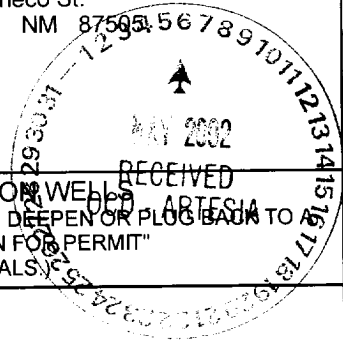

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER
Name of Operator Marathon Oil Company
Address of Operator 929 Marathon Road Artesia, New Mexico 88254 <i>P.O. Box 552 MIDLAND, TX 79702</i>
Well Location Unit Letter P : 660 Feet From The South Line and 660 Feet From The East Line Section 36 Township 20 S Range 24E NMPM Eddy County
Elevation (Show whether DF, RKB, RT, GR, etc.)

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	
OTHER: <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ANBANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>	

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11 3/4 @ 410' TOC @ surface, 8 5/8 @ 3000' TOC @ surface, 4 1/2 @ 9747' TOC @ 4360'
CIBP Set prior to P & A @ 9225' with 35' of cement on top

4-9-2002 Set CIBP @ 8453' Circ well with P & A mud Spot 25 sks of cement @ 8453'-8075' Spot 25 sks @ 7159'-6781' Spot 25 sks @ 6200'-5822'

4-10-2002 Cut and pull 4 1/2" casing from 3050'

4-11-2002 Spot 60 sks @ 4000' WOC & Tag @ 2830' Spot 25 sks @ 460' woc & tag @ 330'

4-11-2002 Spot 10 sk surface plug 10'-surface

Cut off wellhead & anchors 3' BGL. Install dry hole marker

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE <i>Bobby Gray</i>	TITLE <i>P.A. SUPERVISOR</i>	DATE 04-29-02
TYPE OR PRINT NAME <i>BOBBY GRAY</i>		TELEPHONE NO. <i>915 638 9132</i>

Post Path

(This space for State Use)

APPROVED BY <i>[Signature]</i>	TITLE <i>Wild Dept ID</i>	DATE FEB 12 2003
CONDITIONS OF APPROVAL, IF ANY:		