

HYDROSTATIC PRESSURE TEST - B.O.P.'s
Great Western Drilling Co. - Burton State #1


November 19, 1974

by

Yellow Jacket Tools and Services, Inc.


Odessa, Texas

BLOWOUT CONTROL EQUIPMENT... ..GREAT WESTERN DRILLING COMPANY... ..BURTON STATE #1

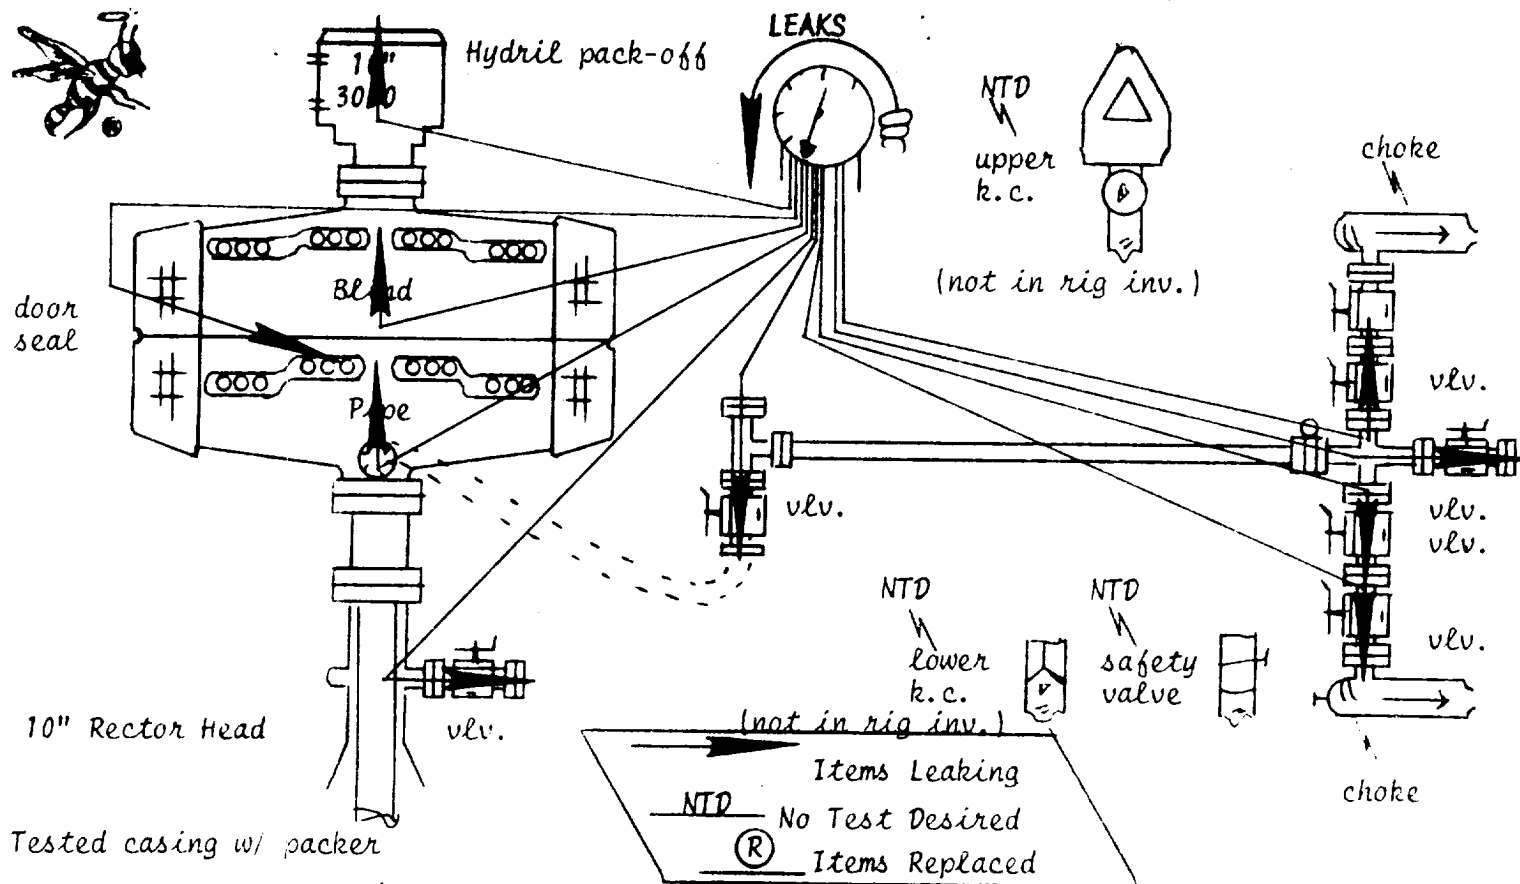

Items Leaking DURING Testing 11/19/74

BLOWOUT CONTROL EQUIPMENT... ..GREAT WESTERN DRILLING COMPANY... ..BURTON STATE #1

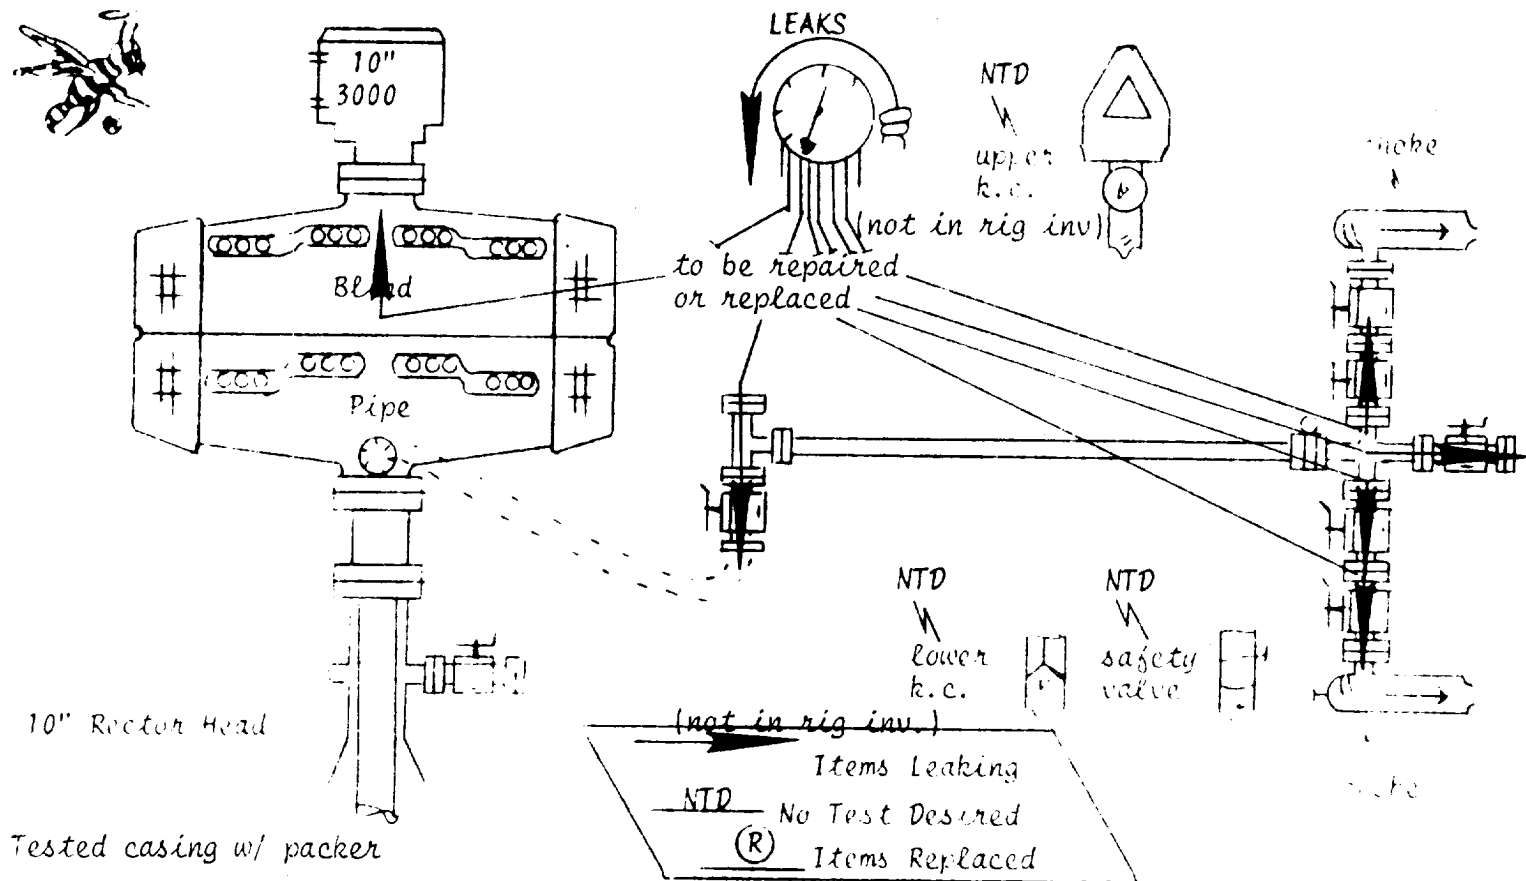

Items Leaking at the CONCLUSION of Testing 11/19/74

November 20, 1974

Great Western Drilling Company

Midland, Texas

Attn: Drilling Dept.

RE: BOP Test - Your Burton State #1

Gentlemen:

We made a hydrostatic pressure test to captioned blowout control equipment on November 19, 1974, and wish to advise the following:

At the conclusion of testing:

BOP: Leak thru blind rams - to be repaired
or replaced as needed.

- Valves:
1. Leak thru valve next to stack on chokeline - to be repaired or replaced as needed.
 2. Leak thru inside wing valve off manifold cross (pump side) - to be repaired or replaced as needed.
 3. Leak thru inside wing valve off manifold cross (pipe rack side) - to be repaired or replaced as needed.
 4. Leak thru outlet valve off choke-manifold cross (bull plugged) - to be repaired or replaced as needed.
 5. Leak thru outside wing valve off manifold cross (pipe rack side) bull plugged - to be repaired or