


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	<input checked="" type="checkbox"/>
LAND OFFICE	<input checked="" type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

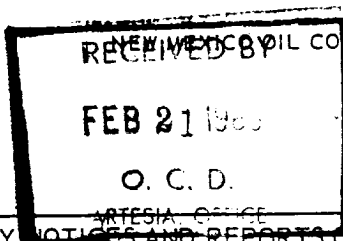

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-85

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>

5. State Oil & Gas Lease No.
K-6203

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - D" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL <input type="checkbox"/> GAS <input checked="" type="checkbox"/> WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator TXO Production Corp.	8. Farm or Lease Name Cal-Mon State Com.
3. Address of Operator 900 Wilco Bldg., Midland, TX 79701	9. Well No. 1
4. Location of Well UNIT LETTER <u>P</u> <u>990</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>7</u> TOWNSHIP <u>21S</u> RANGE <u>26E</u> NMPM.	10. Field and Pool, or Wildcat undes - Avalon Morrow
15. Elevation (Show whether DF, RT, GR, etc.) 3340.5 G-1	12. County Eddy

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐
ALTERING CASING ☐
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-7-83 LD csg w/34 bbl 10# BW. Unseat Uni-6 & TOH w/tbg & pkr. Set 4 1/2" CIBP @ 10450'.
Dump 35' cmt.
10-8-83 TIH open-ended. Set 25 sx plug "H" cmt @ 10250. Set 25 sx plug "H" cmt @ 7650'
10-11-83 Removed tbg spool. Weld on 4 1/2" pull nipple. Free pt 4 1/2" csg. Free @
7325'. Cut 4 1/2" csg @ 7250'. TOH w/csg.
10-12-83 Set 25 sx "H" plug @ 7300'.
10-13-83 Set 35 sx "H" plug @ 5700'.
Set 35 sx "H" plug @ 3950'.
Set 50 sx "H" plug @ 2300'.
Set 75 sx "H" plug @ 570'.
10-14-83 Cut of WH. Set 10 sx surf plug. Weld on dry hole marker.

Post ID-2
3-1-85
YET

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Lane Griffing TITLE Production Engineer DATE 2-15-85

APPROVED BY Danell Moore TITLE Geologist DATE 12/12/85

CONDITIONS OF APPROVAL, IF ANY: