

UNITED STATES DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

NM OIL CONS. CC  
PERMIT IN TRI. STATE  
(with instructions on re-  
vised side)  
Artesia, NM 88210

Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 0502925A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

BR Federal

9. WELL NO.

3

10. FIELD AND POOL, OR WILDCAT

Washington Ranch - Strawn

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 33, T25S, R24E

12. COUNTY OR PARISH

Eddy

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Alpha Twenty-One Production Company

3. ADDRESS OF OPERATOR

2100 First National Bank Building, Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)

At surface

330 FWL and 330 FSL

14. PERMIT NO.

30-015-21706

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3802 Ground Level

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT\*

(Other)

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any  
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-  
nent to this work.) \*

We Plugged and Abandoned this well using the following procedure:

Placed a CIBP at 5850' and Dumped 40' of cement on top  
Cut off 4 1/2" casing at approximately 4226' and placed a 100' cement plug  
across the stub at approximately 4156' to 4256'.  
Placed a 100' cement plug across top of Bone Spring at 3575' to 3675'.  
Placed a 100' cement plug at 1898' to 1998'.  
Placed a 150' cement plug across shoe of the 9-5/8" casing at 564' to 714'.  
Placed 15 sacks cement plug at the surface.  
Erected monument at the wellsite.

(USGS Rep. Bert Jones was on location)

We will notify USGS when location is cleaned and ready for inspection.

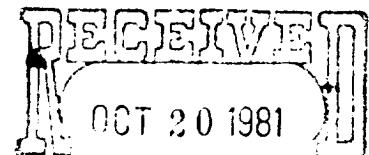

18. I hereby certify that the foregoing is true and correct

SIGNED

Tommy Phipps

TITLE: Executive Vice President

DATE: October 19, 1981

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: