

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

RECEIVED

MAR 01 2019

FORM APPROVED  
OMB No. 1004-0135  
Expires November 30, 2000

## SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

## 1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

## 2. Name of Operator

Epic Energy, LLC

## 3a. Address

7415 East Main, Farmington, NM 87402

## 3b. Phone No. (include area code)

505-327-4892

## 4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

790' FNL &amp; 790' FWL; Section 17, T23N, R2W

## 5. Lease Serial No.

Jicarilla Lease #162

## 6. If Indian, Allottee or Tribe Name

Jicarilla Apache

## 7. If Unit or CA/Agreement, Name and/or N

## 8. Well Name and No.

Mobil Apache #3

## 9. API Well No.

30-039-05073

## 10. Field and Pool, or Exploratory Area

Blanco South Pictured Cliffs

## 11. County or Parish, State

Rio Arriba County, NM

## 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

## TYPE OF SUBMISSION

☒ Notice of Intent☐ Subsequent Report☐ Final Abandonment Notice

## TYPE OF ACTION

☐ Acidize☐ Alter Casing☐ Casing Repair☐ Change Plans☐ Convert to Injection☐ Deepen☐ Fracture Treat☐ New Construction☒ Plug and Abandon☐ Plug Back☐ Production (Start/Resume)☐ Reclamation☐ Recombine☐ Temporarily Abandon☐ Water Disposal☐ Water Shut-Off☐ Well Integrity☐ Other

13. Describe Proposed or Completed Operations (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once Testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

Epic Energy, LLC, proposes to permanently plug and abandon the Mobil Apache #3 as per the attached procedure:

NMOCD

Notify NMOCD 24 hrs  
prior to beginning  
operations

AUG 16 2019

DISTRICT III

SEE ATTACHED FOR  
CONDITIONS OF APPROVAL

## 14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

John C. Thompson

Title

VP of Engineering &amp; Operations

Signature

Date

February 20, 2019

## THIS SPACE FOR FEDERAL OR STATE USE

Approved by

Title

Office

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title 18 U.S.C. Section 1001, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

NMOCD 17

## **P&A Procedure**

### **EPIC Energy – Mobil Apache #3**

**API: 30-039-05073**

South Blanco Pictured Cliffs

790' FNL & 790' FWL, Section 17, T23N, R2W

Rio Arriba County, New Mexico, API #30-043-05073

### **Plug & Abandonment Procedure:**

---

1. **Plug #1, 2954' - 2250' (Pictured Cliffs Top: 3000', Perfs: 3004' – 3014', Fruitland Top: 2550', Kirtland Top: 2505', Ojo Alamo top: 2350'):** RIH & set CICR at 2954'. Pressure test tubing prior to pumping cement to 1000 psi. Sting out of retainer, mix & pump 55 sxs (65 cf) of Class B cement (or equivalent) leaving 704' of cement on top of retainer – covering PC, FTC, KT, and Ojo Alamo tops. Pull up and circulate hole clean. WOC. TIH & confirm cement top. Spot additional cement if necessary.
2. **Plug #2, 1160' – 1010' (Nacimiento Top: 1110'):** Spot 12 sxs (14.2 cf) Class B cement in a balanced plug inside casing to cover Nacimiento top. PUH. WOC. TIH to confirm top of plug. Re- spot if necessary.
3. **Plug #3, (8-5/8" Surface casing shoe, 150' to Surface):** Note – circulated cement on primary cement job. Mix and pump ~ 12 sx (14.2 cf) of cement for surface plug, top off as necessary.
4. ND BOP and cut off wellhead below surface casing flange, top off casing and annulus as necessary. Install P&A marker and cut off and/or remove anchors. RD, MOL - Restore location per BLM and Jicarilla Tribal stipulations.

### Mobil Apache #3

#### Proposed P&A


South Blanco Pictured Cliffs

790' FNL & 790' FWL, Section 17, T23N, R2W, Rio Arriba County, NM

API 30-039-05073

Spud: 9/26/1960

Procedure Date: 2/1/2019

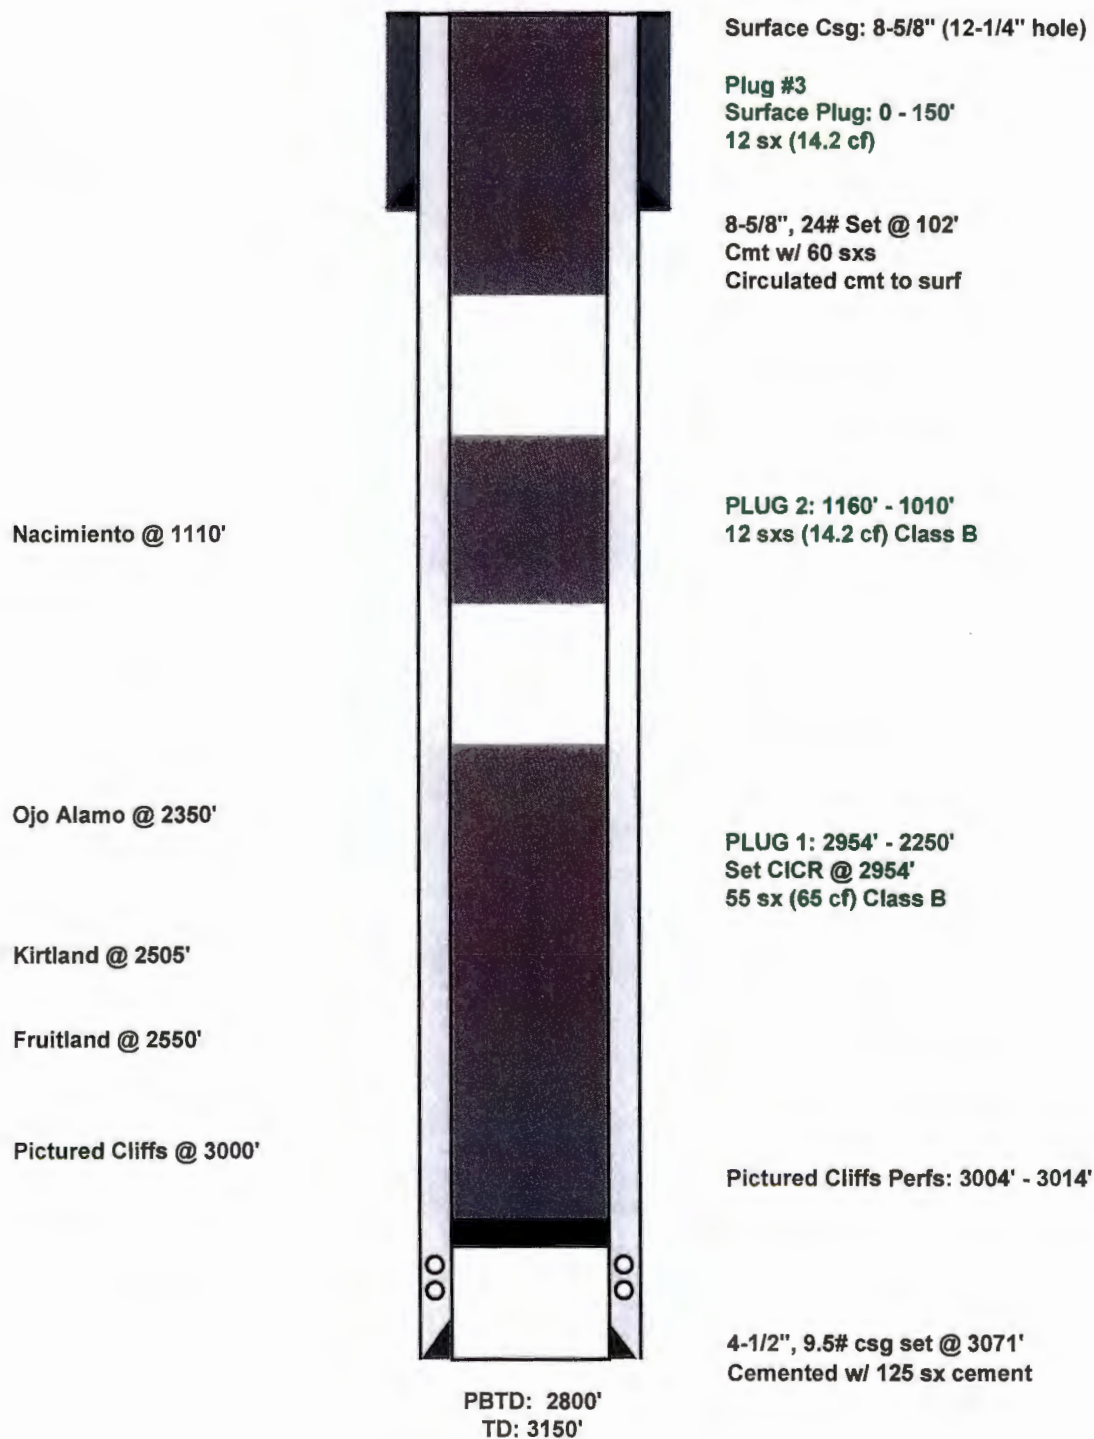

UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
FARMINGTON DISTRICT OFFICE  
6251 COLLEGE BLVD.  
FARMINGTON, NEW MEXICO 87402

Attachment to notice of  
Intention to Abandon:

Re: Permanent Abandonment  
Well: Mobil Apache #3

**CONDITIONS OF APPROVAL**

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

3. The following changes are to be made:

I: Set plug #2 (1520-1420 ft.) to cover the top of the Nacimiento top. BLM picks top of Nacimiento @ 1468 ft. Adjust cement volume accordingly.

BLM has no record for TOC behind 4.5" production casing. Therefore, CBL is required to be ran from CICR AT 2954 ft. to surface to verify cement top.



**GENERAL REQUIREMENTS FOR  
PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES  
FARMINGTON FIELD OFFICE**

1.0 The approved plugging plans may contain variances from the following minimum general requirements.

1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.

1.2 Requirements may be added to address specific well conditions.

2.0 Materials used must be accurately measured. (densimeter/scales)

3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.

3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.

4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.

4.1 The cement shall be as specified in the approved plugging plan.

4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.

4.3 Surface plugs may be no less than 50' in length.

4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.

4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.

4.6 **A cement bond log (CBL) is required to be ran if one had not been previously ran or cement did not circulate to surface during the primary cement job or subsequent cement job.**

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. **If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.**

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H<sub>2</sub>S.

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.