

**UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT**

RECEIVED

AUG 24 2011

Sundry Notices and Reports on Wells

Farmington Field Office  
Bureau of Land Management

1. Type of Well  
GAS

2. Name of Operator  
**BURLINGTON**  
RESOURCES OIL & GAS COMPANY LP

3. Address & Phone No. of Operator


PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M

Surface: Unit P (SESE), 1100' FSL & 940' FEL, Section 13, T32N, R8W, NMPM

BHL: Unit B (NWNE), 700' FNL & 1500' FEL, Section 13, T32N, R8W, NMPM

5. Lease Number  
NMNM-6892
6. If Indian, All. or  
Tribe Name
7. Unit Agreement Name
8. Well Name & Number  
Reese Mesa 101H
9. API Well No.  
30-045-26977
10. Field and Pool  
Basin Fruitland Coal
11. County and State  
Rio Arriba, NM

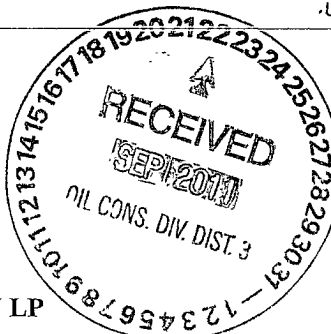

**12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA**

Type of Submission	Type of Action			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans	<input checked="" type="checkbox"/> Other	<input type="checkbox"/> Lateral change
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction		
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging	<input type="checkbox"/> Non-Routine Fracturing		
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut off		
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection		

BP

**13. Describe Proposed or Completed Operations**

While drilling the first (lower Lateral) we fell out of the coal and never was able to get back in. Cut the window for the lateral @ 3575' (VD) and entered the coal @ 4094' (MD) 3897' (VD); Drilled approx. 584' of coal before losing site of the coal. Entered the PC @ 4678' MD (3908 VD) skimmed the top of the PC approx. 825' to TD 5502' (MD) 3881' (VD). Want to POH; RIH w/pre-perf'd liner with shoe to 4670' and leave the rest of the hole open without setting a plug and plugging back. Plans are NOT to stimulate the FC.

Supplied OCD with a summary of work to date, a schematic and mud log. Troy Salyers (BLM) and Brandon Powell (OCD) both approved our plans to run preperf'd liner with shoe and not plug back the open hole section as long as we do NOT stimulate the FC on this lateral.

**14. I hereby certify that the foregoing is true and correct.**

Signed Patsy Clugston Patsy Clugston Title Sr. Regulatory Specialist Date 8/23/11

(This space for Federal or State Office use)

APPROVED BY Troy L Salyers Title Petroleum Engineer Date 9/19/2011

CONDITION OF APPROVAL, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

NMOC

A