

**UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT**
Sundry Notices and Reports on Wells

2005 SEP 8 AM 9 34

1. Type of Well

Oil Well

2. Name of Operator

Central Resources, Inc.

3. Address & Phone No. of Operator

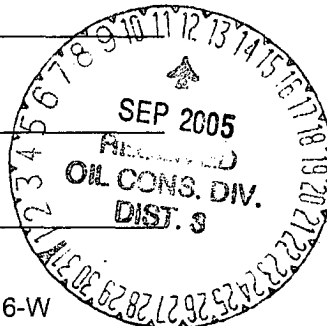
1775 Sherman St., Denver, CO 80203-4313

4. Location of Well, Footage, Sec., T, R, M

660' FSL and 660' FWL, Section 20, T-31-N, R-16-W

RECEIVED
070 FARMINGTON NM

- 5. Lease Number**
BIA #14-20-600-3531
- 6. If Indian, All. or Tribe Name**
Navajo
- 7. Unit Agreement Name**
Horseshoe Gallup
- 8. Well Name & Number**
HSGU #114
- 9. API Well No.**
30-045-10511
- 10. Field and Pool**
Horseshoe Gallup
- 11. County & State**
San Juan County, NM

**12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA****Type of Submission**☐ Notice of Intent☒ Subsequent Report☐ Final Abandonment**Type of Action**☒ Abandonment☐ Recompletion☐ Plugging Back☐ Casing Repair☐ Altering Casing☒ Other - Final Abandonment☐ Change of Plans☐ New Construction☐ Non-Routine Fracturing☐ Water Shut off☐ Conversion to Injection**13. Describe Proposed or Completed Operations**

Plug and abandon the above well as follows:

6/30/05 MOL.

7/5/05 RU rig. Check well pressures: 0# on BH, 30# on casing, 0# on tubing. Pull on rods and unseat pump. Hot oil rods and tubing with water. TOH and LD 48 - 3/4" rods and pump. ND wellhead. NU BOP and companion flange. TOH and LD 38 joints 2.375" tubing. TIH with casing scraper and A+ workstring to 1232'. Shut in well.

7/6/05 TOH and LD scraper. TIH and set 4.5" DHS CR at 1200'. Pressure test casing to 550#, held OK. Inject waste fluid below CR. Sting out of CR. Plug #1 with CR at 1200', spot 26 sxs Type III cement (34 cf) inside the 4.5" casing above the CR up to 835' to isolate the Gallup perforations. PUH. Connect pump on bradenhead and pressure test to 500#, held OK. Found old cement in BH valve. Plug #2 with 24 sxs Type III cement (32 cf) inside the 4.5" casing from 221' to surface, circulate good cement out the casing valve. TOH and LD all tubing. Shut in well and WOC. ND BOP. Dig out and cut off wellhead. Mix 15 sxs cement to fill casing and install P&A marker. RD and MOL.

W. Ashley, Navajo Nation Minerals, was on location.

SIGNATURE William F. Clark Contractor

July 31, 2005

(This space for Federal or State Office use)

ACCEPTED FOR RECORD

APPROVED BY _____ Title _____

CONDITION OF APPROVAL, if any: _____

SEP 8 2005

NMOC

FARMINGTON FIELD OFFICE
BY sm