

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
OMB NO. 1004-0135  
Expires: July 31, 2010

**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.*

**SUBMIT IN TRIPLICATE - Other instructions on reverse side.**

1. Type of Well <input type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other: COAL BED METHANE		5. Lease Serial No. NOG96021301
2. Name of Operator COLEMAN OIL & GAS INCORPORATED		6. If Indian, Allottee or Tribe Name EASTERN NAVAJO
3a. Address FARMINGTON, NM 87499		7. If Unit or CA/Agreement, Name and/or No. NMNM104858
3b. Phone No. (include area code) Ph: 505.327.0356		8. Well Name and No. STACEY 2
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec. 7 T26N R12W NENE 700FNL 1000FEL 36.507836 N Lat, 108.147272 W Lon		9. API Well No. 30-045-20552-00-S1 73473
		10. Field and Pool, or Exploratory BASIN FRUITLAND COAL
		11. County or Parish, and State SAN JUAN COUNTY, NM

**12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

Coleman Oil & Gas proposes to P&A this well per the attached procedure, Reclamation Plan and Field Sketch.

**BLM'S APPROVAL OR ACCEPTANCE OF THIS ACTION DOES NOT RELIEVE THE LESSEE AND OPERATOR FROM OBTAINING ANY OTHER AUTHORIZATION REQUIRED FOR OPERATIONS ON FEDERAL AND INDIAN LANDS**

**SEE ATTACHED FOR CONDITIONS OF APPROVAL**  
Notify NMOCD 24 hrs prior to beginning operations  
OIL CONS. DIV DIST. 3  
OCT 03 2016

14. I hereby certify that the foregoing is true and correct. Electronic Submission #352518 verified by the BLM Well Information System For COLEMAN OIL & GAS INCORPORATED, sent to the Farmington Committed to AFMSS for processing by JACK SAVAGE on 09/28/2016 (16JWS0095SE)	
Name (Printed/Typed) MICHAEL T HANSON	Title ENGINEER
Signature (Electronic Submission)	Date 09/26/2016

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved By JACK SAVAGE	Title PETROLEUM ENGINEER	Date 09/28/2016
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		
Office Farmington		

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

**\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\***

**NMOCD**

# Coleman Oil & Gas, Inc.

## Final P&A Procedure Basin Fruitland Coal Formation

Monday, September 26, 2016

**Well:** **Stacey #2**  
**SL Location:** 2045' FNL & 790' FEL (SENE)  
Sec 6, T26N, R12W, NMPM  
San Juan County, New Mexico

**Field:** Basin Fruitland Coal  
**Elevation:** 5894' RKB  
5889' GL  
**Lease:** NOG96061302  
**API#:** 30-045-29473

Fruitland Coal: 1101-1119, Producing.  
Original PBTD at 1236 FT GL

**Procedure:** All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class B, mixed at 15.6 ppg with a 1.18 cf/sx yield.

(Note: This procedure will be adjusted on site based upon actual conditions)

1. Review and Comply with Regulatory Requirements.
2. MIRU Well Service Rig and Equipment.
3. POOH with Rods & Pump.
4. Nipple up BOP equipment. Function test BOP.
5. Tag with Production Tubing. POOH and Tally Tubing.
6. RIH with Cement Retainer on tubing and set at  $\pm$  1051 FT KB.
7. Place Minimum 10 sacks cement on top of retainer.
8. Attempt to pressure test Braden head annulus to 300 psig, note volume to load.
9. Plug #2 Cement Fruitland Top from 860'-915' Inside 4 1/2" Casing with 12 sacks neat cement. Plug #2 inside plug based on Long String Cement to Surface.
10. Plug #3 Cement Kirtland Top and Surface Casing, 174' to surface. Attempt to pressure test braden head annulus to 300 psig, note volume to load. Perforate 4 1/2" casing at 174'. Establish circulation out of braden head valve with water. Mix 50 sacks cement and pump cement down 4 1/2" casing to circulate good cement out braden head valve. If unable to establish circulation out the braden head valve, fill the inside of the 4 1/2" casing from 174' to Surface. Circulate good cement out casing valve. Shut down wait on cement.
11. Cut off well head and top off casing and annulus as necessary with cement.



12. Install dry hole marker, remove production equipment and reclaim location.

**COLEMAN OIL GAS, INC.  
Stacey #2 PRODUCING**

**SURFACE CASING**  
7" 23# J-55 LT&C @ 124 FT GL  
CEMENTED WITH 50 SXS  
CLASS B W/ 2% CAL CL 1/4 #/SX

**PRODUCTION CASING**  
4-1/2" 10.50# J-55 LT&C @ 1247 FT GL  
CEMENTED WITH 85 SXS LITE  
TAIL WITH 75 SACKS REG.


**CEMENT CIRCULATED TO SURFACE  
ON SUFACE & PRODUCTION CASING**

**TUBING STRING**  
34 JTS 2-3/8 TBG 1141 FT  
SEATING NIPPLE  
1 JT 2-3/8 MA 19 FT.

**Seating Nipple @ 1141 FT GL  
Bottom of TBG @ 1161 FT GL**

**Fruitland Coal  
Perforations @ 1101-1119**

**PBTD @ 1236' FT. GL.  
PIPE LANDED @ 1247' FT. GL.  
T.D. @ 1259' FT. GL.**

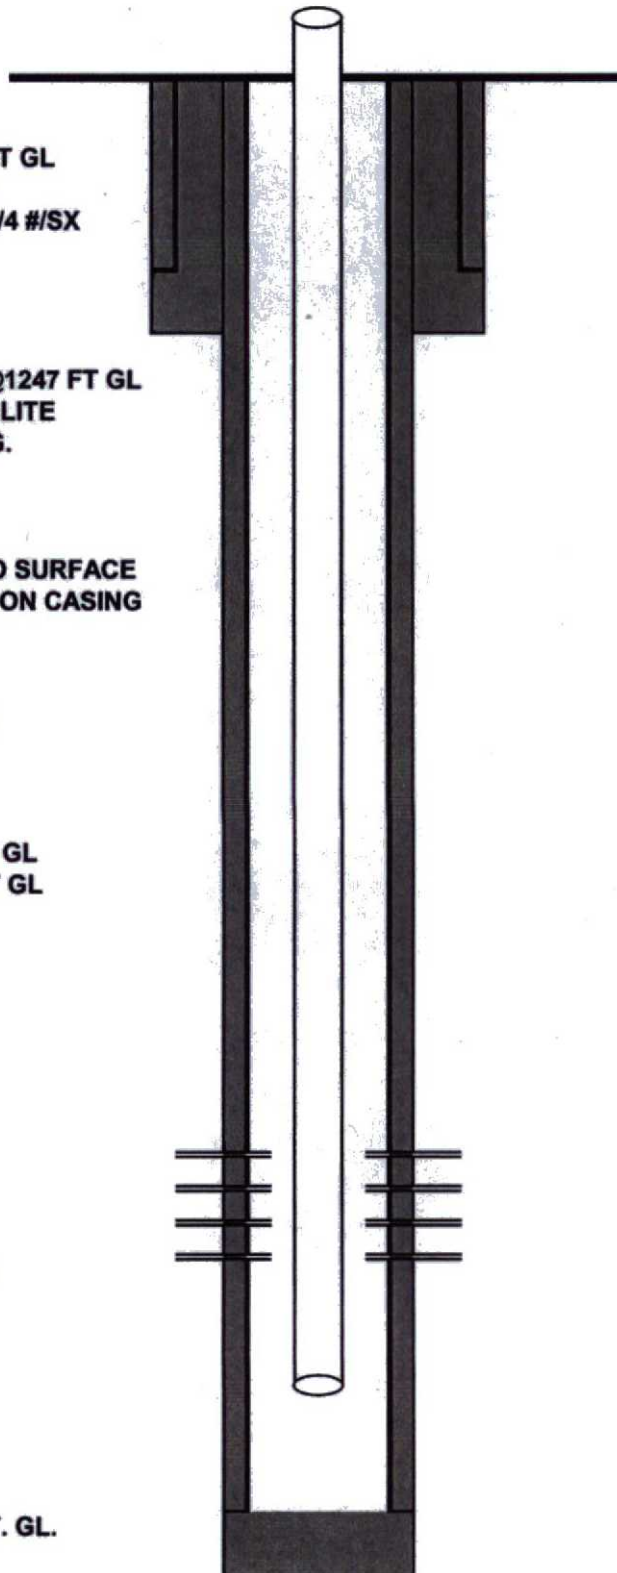

**COLEMAN OIL GAS, INC.  
Stacey #2 PROPOSED P&A**

**SURFACE CASING**

7" 23# J-55 LT&C @ 124 FT GL  
CEMENTED WITH 50 SXS  
CLASS B W/ 2% CAL CL 1/4 #/SX

Plug #3 0-174  
7" Set @ 124 FT GL  
50 Sacks Cement

**PRODUCTION CASING**

4-1/2" 10.50# J-55 LT&C @ 1247 FT GL  
CEMENTED WITH 85 SXS LITE  
TAIL WITH 75 SACKS REG.

**CEMENT CIRCULATED TO SURFACE  
ON SURFACE & PRODUCTION CASING**

**TUBING STRING**

34 JTS 2-3/8 TBG 1141 FT  
SEATING NIPPLE  
1 JT 2-3/8 MA 19 FT.

Seating Nipple @ 1141 FT GL  
Bottom of TBG @ 1161 FT GL


Plug #2 905-1005  
Fruitland Top @ 865'  
12 Sacks Cement

Retainer @ ± 1051

Plug #1 1001-1051  
Pictured Cliffs Perforations  
10 Sacks Cement

Fruitland Coal  
Perforations @ 1101-1119

PBTD @ 1236' FT. GL.  
PIPE LANDED @ 1247' FT. GL.  
T.D. @ 1259' FT. GL.

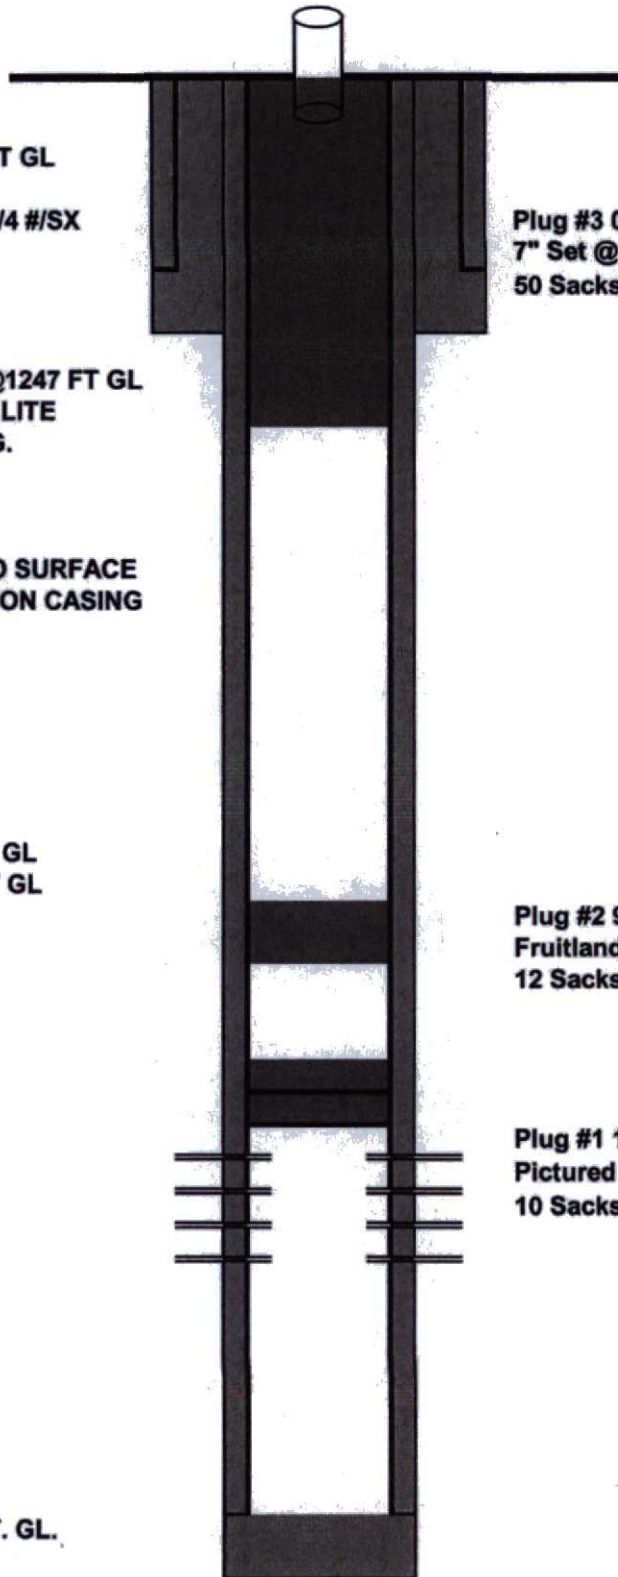

UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
FARMINGTON DISTRICT OFFICE  
6251 COLLEGE BLVD.  
FARMINGTON, NEW MEXICO 87402

Attachment to notice of  
Intention to Abandon:

Re: Permanent Abandonment  
Well: Stacey #2

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.
3. The following modifications to your plugging program are to be made:

- a) Set plug #2 (878-778) ft. to cover the Fruitland top. BLM picks top of Fruitland at 828 ft.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.