Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

NAY 17 2013 FORM APPROVED OMB No. 1004-0137 Expires: July 31, 2010

			Farm	In bease Serial Noffice	
				of Land Management	SF-078305
	DRY NOTICES AND REPO	6. If Indian, Allottee or Tribe N	lame		
	this form for proposals t				
	well. Use Form 3160-3 (A		oposais.		
	IBMIT IN TRIPLICATE - Other inst	ructions on page 2.		7. If Unit of CA/Agreement, N	ame and/or No.
1. Type of Well	K C W-II Other			0 W-11 Name and Na	
Oil Well	Gas Well Other			8. Well Name and No.	n 29-5 Unit 21A
2. Name of Operator				9. API Well No.	III 20-0 OIIII 21A
	Hilcorp Energy Compa	ny		30-0	39-21342
3a. Address		3b. Phone No. (included)		10. Field and Pool or Explorate	*
382 Road 3100, Aztec, N	NM 87410	505-59	9-3400	Gobenador P	C/Blanco Mesaverde
4. Location of Well (Footage, Sec., T.,R Surface Unit O (S	R.,M., or Survey Description) SWSE) 800'FSL & 1460' FE	L, Sec. 08, T29	N, R05W	11. Country or Parish, State Rio Arriba	, New Mexico
12. CHECK	THE APPROPRIATE BOX(ES)	TO INDICATE NA	ATURE OF NO	TICE, REPORT OR OTH	ER DATA
TYPE OF SUBMISSION			TYPE OF AC	TION	
X Notice of Intent	Acidize	Deepen	P	roduction (Start/Resume)	Water Shut-Off
	Alter Casing	Fracture Treat	R	eclamation	Well Integrity
Subsequent Report	Casing Repair	New Construction	on X R	ecomplete	Other
	Change Plans	Plug and Aband	on T	emporarily Abandon	
Final Abandonment Notice	Convert to Injection	Plug Back	v	Vater Disposal	
Testing has been completed. Final determined that the site is ready for Hilcorp Energy Comparthe existing Mesaverde	red operations. If the operation results Abandonment Notices must be filed or final inspection.) ny plans to recomplete the with the Pictured Cliffs. A fill be submitted and approximately approximately and approximately appro	only after all requirements e subject well in Attached is the	n the Pictured PC C102, red	mation, have been completed a d Cliffs formation and complete procedure &	d downhole commingle wellbore schematic.
SEE ATTACHED FOR CONDITIONS OF APPROVAL		0 C D 3 O 2018 C T		OPERATOR FROM OBT	LIEVE THE LESSEE AND AINING ANY OTHER UIRED FOR OPERATIONS
14. I hereby certify that the foregoing is	s true and correct. Name (Printed/Type	ed)			
Etta Trujillo		Title	Operations/R	tegulatory Technician -	Sr.
Signature AC	Tool	Date	5-17-	-18	
	THIS SPACE FO	R FEDERAL O	R STATE OF	FICE USE	
Approved by William Conditions of approval, if any, are attac	mbekou	warrant or certify	Title Per	roleum Engineer	Date 5/24/2018
11			1	//	

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

entitle the applicant to conduct operations thereon.

that the applicant holds legal or equitable title to those rights in the subject lease which would

Office

FFD

District I

1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 **District IV**

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico **Energy, Minerals and Natural** Resources Oil Conservation Division

August 1, 2011 Permit 252612

Form C-102

1220 S. St Francis Dr. Santa Fe, NM 87505

WELL LOCATION AND ACREAGE DEDICATION PLAT

1. API Number 30-039-21342	2. Pool Code 77440	3. Pool Name GOBERNADOR PICTURED CLIFFS (GAS)
4. Property Code 318837	5. Property Name SAN JUAN 29 5 UNIT	6. Well No. 021A
7. OGRID No. 372171	8. Operator Name HILCORP ENERGY COMPANY	9. Elevation 6509


10. Surface Location

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County	
0	8	29N	05W		800	S	1460	E	RIO ARRIBA	ı

11. Bottom Hole Location If Different From Surface

11. Bottom Hole Eccation if Different From Surface									
UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
12. Dedicated Acres 320.00 E/2		13. Joint or Infil	13. Joint or Infill		14. Consolidation Code			15. Order No.	

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

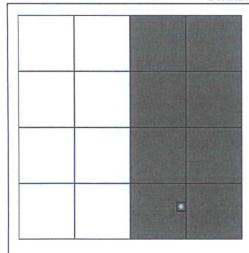

OPERATOR CERTIFICATION

I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location(s) or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.

E-Signed By: Operations/Regulatory Tech

Title: Etta Trujillo Date: 05/17/2018

SURVEYOR CERTIFICATION

I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief.

Surveyed By:

Fred B. Kerr Jr

Date of Survey:

1/25/1977

Certificate Number:

3950




HILCORP ENERGY COMPANY SAN JUAN 29-5 UNIT 21A PICTURED CLIFFS RECOMPLETION SUNDRY

JOB PROCEDURES

- 1. MIRU service rig and associated equipment; test BOP.
- 2. TOOH with 2 3/8" tubing set at 5,837'.
- 3. Set a 4-1/2" cast iron bridge plug at +/- 4,100' to isolate the Mesa Verde. (Note: Intermediate TOC @ 2,950' by CBL).
- 4. Load the hole and pressure test the casing to frac pressure.
- 5. N/D BOP, N/U frac stack and test frac stack to frac pressure.
- 6. Perforate and frac the Pictured Cliffs in a single stage (Top Perforation @ 3,614'; Bottom Perforation @ 3,731').
- 7. Isolate frac stage with a composite bridge plug.
- 8. Nipple down frac stack, nipple up BOP and test.
- 9. TIH with a mill and drill out top Pictured Cliffs isolation plug.
- 10. Clean out to Mesa Verde isolation plug and, when water and sand rates are acceptable, flow test the Pictured Cliffs.
- 11. Drill out Mesa Verde isolation plug and cleanout to PBTD of 5,904'. TOOH.
- 12. TIH and land production tubing. Get a commingled Mesa Verde/Pictured Cliffs flow rate.



HILCORP ENERGY COMPANY SAN JUAN 29-5 UNIT 21A PICTURED CLIFFS RECOMPLETION SUNDRY

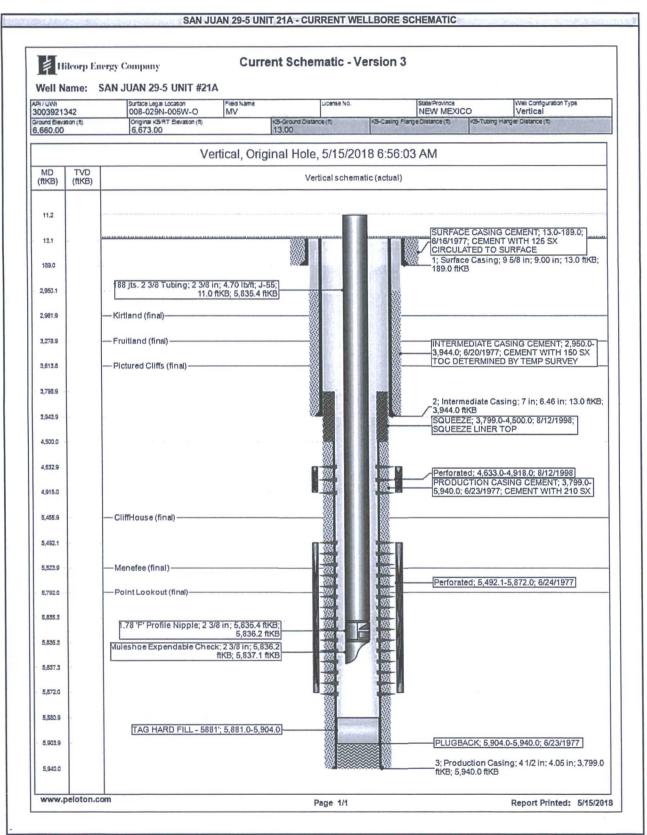



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Farmington District Office 6251 College Blvd. - Suite A Farmington, New Mexico 87402 www.blm.gov/nm



CASING REPAIR, WORKOVER, AND RECOMPLETION CONDITION OF APPROVAL

- 1. If casing repair operations are needed, obtain prior approval from this office before commencing repairs.
- 2. If a CBL or other logs are run, provide this office with a copy.
- 3. After any casing repair operations, test cement squeeze to a minimum of 500# for 30 minutes with no more than 10 % pressure fall off in the 30 minutes test period. Provide test chart with your subsequent report of operations
- 4. A properly functioning BOP and related equipment must be installed prior to commencing workover, casing repair, and/or recompletion operations.
- 5. Contact this office at (505) 564-7750 prior to conducting any cementing operations

SPECIAL STIPULATIONS:

- 1. Pits will be fenced during work-over operation.
- 2. All disturbance will be kept on existing pad.
- 3. All pits will be pulled and closed immediately upon completion of the recompletion and work-over activities.
- 4. Pits will be lined with an impervious material at least 12 mils thick.