Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

MAY	FORM APPROVED
	FORM APPROVED
	OMB No. 1004-0137

Farmingto Expires: July 31, 2010

6. If Indian, Allottee or Tribe Name

Temporarily Abandon

Water Disposal

5. Lease Serial No. and NMNM012698

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an

Change Plans

Convert to Injection

abandoned well. Use Form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on page 2. 7. If Unit of CA/Agreement, Name and/or No. 1. Type of Well Oil Well X Gas Well Other 8. Well Name and No. San Juan 29-6 Unit 17C 2. Name of Operator 9. API Well No. Hilcorp Energy Company 30-039-27599 3a. Address 3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area 382 Road 3100, Aztec, NM 87410 505-599-3400 Gobernador PC/Blanco MV 4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) 11. Country or Parish, State Surface Unit O (SWSE) 500'FSL & 1900' FEL, Sec. 1, T29N, R06W Rio Arriba **New Mexico** 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION X Notice of Intent Acidize Deepen Production (Start/Resume) Water Shut-Off Alter Casing Fracture Treat Reclamation Well Integrity Casing Repair New Construction Recomplete Subsequent Report

Plug and Abandon

Plug Back

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once Testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

Hilcorp Energy Company plans to recomplete the subject well in the Pictured Cliffs formation and downhole commingle with the existing Mesaverde. Attached is the PC C102, recomplete procedure & wellbore schematic. The DHC application will be submitted and approved prior to commingling. A Closed Loop system will be utilized.

SEE ATTACHED FOR CONDITIONS

OF APPROVAL

Final Abandonment Notice

NMOCD MAY 3 0 2018 DISTRICT 111

Notify NMOCD 24 hrs

prior to beginning

BLM'S APPROVAL OR ACCEPTANCE OF THIS ACTION DOES NOT RELIEVE THE LESSEE AND **OPERATOR FROM OBTAINING ANY OTHER AUTHORIZATION REQUIRED FOR OPERATIONS** ON FEDERAL AND INDIAN LANDS

operations	
14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)	
Tammy Jones	Title Operations/Regulatory Technician - Sr.
Signature Tammy Sones	Date 5/17/2018
THIS SPACE FOR FEDI	ERAL OR STATE OFFICE USE
Approved by William Tambekon	Title Petroleum Engineer Date 5/24/2018
Conditions of approval, if any, are attached. Approval of this notice does not warrant or that the applicant holds legal or equitable title to those rights in the subject lease which ventitle the applicant to conduct operations thereon.	pertify

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

District I

1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico **Energy, Minerals and Natural** Resources Oil Conservation Division 1220 S. St Francis Dr.

Santa Fe, NM 87505

Form C-102 August 1, 2011

Permit 252401

WELL LOCATION AND ACREAGE DEDICATION PLAT

1. API Number 30-039-27599	2. Pool Code 77440	3. Pool Name GOBERNADOR PICTURED CLIFFS (GAS)
4. Property Code 318838	5. Property Name SAN JUAN 29 6 UNIT	6. Well No. 017C
7. OGRID No. 372171	8. Operator Name HILCORP ENERGY COMPANY	9. Elevation 6450


10. Surface Location

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
0	1	29N	06W		500	S	1900	E	RIO ARRIBA

11. Bottom Hole Location If Different From Surface

			III. Dottoiii	HOIC ECOULION	i ii billoronii i	om ounded			
UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
12. Dedicated Acres 232.73 E/2		13. Joint or Infil	13. Joint or Infill		14. Consolidation Code				

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

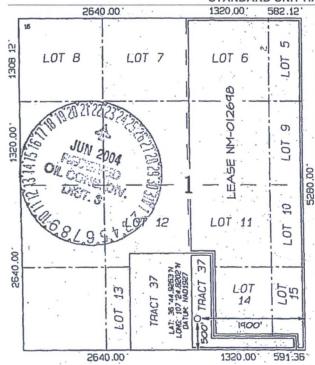

OPERATOR CERTIFICATION

I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location(s) or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.

E-Signed By: Tammy Jones

Title:

Operations/Regulatory Technician - Sr. 5/17/2018 Date:

SURVEYOR CERTIFICATION

I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief.

Jason C. Edwards Surveyed By:

9/18/2003

Date of Survey:

15269 Certificate Number:




HILCORP ENERGY COMPANY SAN JUAN 29-6 UNIT 17C PICTURED CLIFFS RECOMPLETION SUNDRY

JOB PROCEDURES

- 1. MIRU service rig and associated equipment; test BOP.
- 2. TOOH with 2 3/8" tubing set at 5,636'.
- 3. Set a 4-1/2" cast iron bridge plug at +/- 3,600' to isolate the Mesa Verde. Note: TOC at 3000' by CBL.
- 4. Load the hole and pressure test the casing to frac pressure.
- 5. N/D BOP, N/U frac stack and test frac stack to frac pressure.
- 6. Perforate and frac the Pictured Cliffs in a single stage (Top Perforation @ 3,400'; Bottom Perforation @ 3,446').
- 7. Isolate frac stage with a composite bridge plug.
- 8. Nipple down frac stack, nipple up BOP and test.
- 9. TIH with a mill and drill out top Pictured Cliffs isolation plug.
- 10. Clean out to Mesa Verde isolation plug and, when water and sand rates are acceptable, flow test the Pictured Cliffs.
- 11. Drill out Mesa Verde isolation plug and cleanout to PBTD of 5,890'. TOOH.
- 12. TIH and land production tubing. Get a commingled Mesa Verde/Pictured Cliffs flow rate.



HILCORP ENERGY COMPANY SAN JUAN 29-6 UNIT 17C PICTURED CLIFFS RECOMPLETION SUNDRY

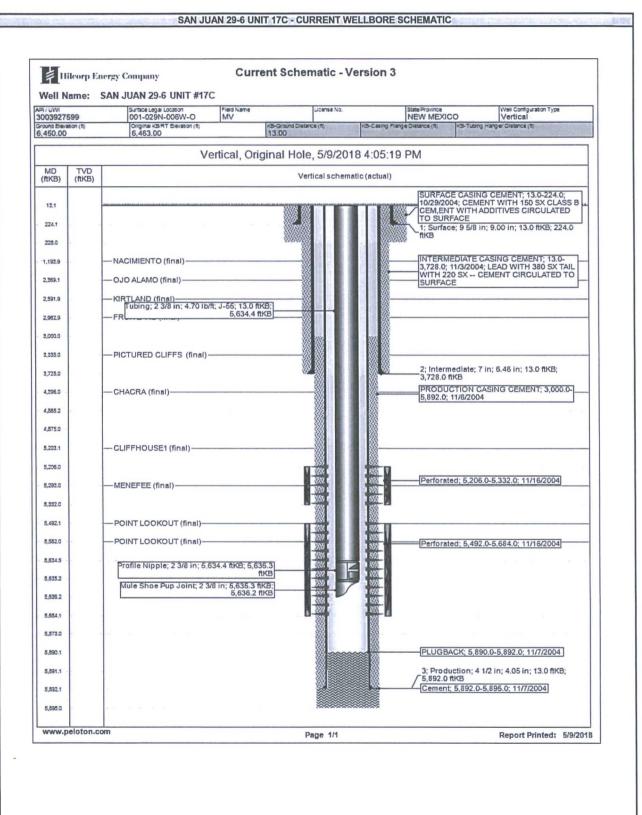



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Farmington District Office 6251 College Blvd. - Suite A Farmington, New Mexico 87402 www.blm.gov/nm



CASING REPAIR, WORKOVER, AND RECOMPLETION CONDITION OF APPROVAL

- 1. If casing repair operations are needed, obtain prior approval from this office before commencing repairs.
- 2. If a CBL or other logs are run, provide this office with a copy.
- 3. After any casing repair operations, test cement squeeze to a minimum of 500# for 30 minutes with no more than 10 % pressure fall off in the 30 minutes test period. Provide test chart with your subsequent report of operations
- 4. A properly functioning BOP and related equipment must be installed prior to commencing workover, casing repair, and/or recompletion operations.
- 5. Contact this office at (505) 564-7750 prior to conducting any cementing operations

SPECIAL STIPULATIONS:

- 1. Pits will be fenced during work-over operation.
- 2. All disturbance will be kept on existing pad.
- 3. All pits will be pulled and closed immediately upon completion of the recompletion and work-over activities.
- 4. Pits will be lined with an impervious material at least 12 mils thick.