Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB No. 1004-0137 Expires: July 31, 2010

5. Lease Serial No.

				NM	NM03188	
SUN	DRY NOTICES AND REPO	ORTS ON WEL	LS	6. If Indian, Allottee or Tribe N	ame	
	this form for proposals t					
abandoned	well. Use Form 3160-3 (A	PD) for such p	roposals.			
su	BMIT IN TRIPLICATE - Other ins	7. If Unit of CA/Agreement, Na	7. If Unit of CA/Agreement, Name and/or No.			
1. Type of Well						
Oil Well	Gas Well Other		8. Well Name and No.			
					n 29-5 Unit 65F	
2. Name of Operator	Hilcorp Energy Compa	mv		9. API Well No.	39-29554	
3a. Address	Thicorp Energy Compa	3b. Phone No. (inclu	ide area code)	10. Field and Pool or Explorator		
382 Road 3100, Aztec, N	IM 87410	1 '	9-3400		/Blanco MV/Basin DK	
4. Location of Well (Footage, Sec., T.,R				11. Country or Parish, State		
	IWNW) 480'FNL & 15' FW	L, Sec. 28, T29	N, R05W	Rio Arriba	New Mexico	
12. CHECK T	HE APPROPRIATE BOX(ES)	TO INDICATE N	ATURE OF NO	OTICE, REPORT OR OTHE	R DATA	
TYPE OF SUBMISSION	<u> </u>		TYPE OF AC	CTION		
X Notice of Intent	Acidize	Deepen	Г	Production (Start/Resume)	Water Shut-Off	
	Alter Casing	Fracture Treat	Ti.	Reclamation	Well Integrity	
Subsequent Report	Casing Repair	New Constructi	on X	Recomplete	Other	
Subsequent Report	Change Plans	Plug and Aband		Temporarily Abandon		
Final Abandonment Notice	Convert to Injection	Plug Back	i i	Water Disposal		
13. Describe Proposed or Completed Op	eration: Clearly state all pertinent deta	ils, including estimat	ed starting date of	any proposed work and approxima	te duration thereof.	
Testing has been completed. Final determined that the site is ready for Hilcorp Energy Compan with the existing Mesav	d operations. If the operation results Abandonment Notices must be filed of final inspection.) by plans to recomplete the erde and Dakota. Attache submitted and approved	only after all requirem e subject well i ed is the PC C1	ents, including recl n the Picture 102, recomple	lamation, have been completed and ed Cliffs formation and ete procedure & wellbo	d the operator has downhole commingle are schematic. The	
	A A A A	000				
	87 AV	u c u		BLM'S APPROVAL OR ACC	EPIANCE OF THIS	
	MAY	0 2018		ACTION DOES NOT RELIE OPERATOR FROM OBTAIN	VE THE LESSEE AND NING ANY OTHER	
SEE ATTACHED	`	, 🕻 🗆	4	AUTHORIZATION REQUIR	LED FOR OPERATIONS	
FOR CONDITIONS	DISTRI	CT III	•	ON FEDERAL AND INDIAN	LANDS	
OF APPROVAL		Not	ify NMOCD 24	ı han		
		pr	or to beginni	ng		
			operations			
14. I hereby certify that the foregoing is	true and correct. Name (Printed/Type	ed)				
Tammy Jones		Title	Onerations/	Regulatory Technician - S	39	
2 300000		11110	- por actoris/1			
1.	Λ .		_ 17	1 1 1 1 1		
Signature AMM	UMUZ	Date	<u> 5-1/</u>	-2018		
	THIS SPACE FO	R FEDERAL O	R STATE OF	FICE USE		
Approved by			<u> </u>			

entitle the applicant to conduct operations thereon. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would

District I

1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

<u>District II</u>

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 **District III**

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 **District IV**

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources

Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

WELL LOCATION AND ACREAGE DEDICATION PLAT

1. API Number 30-039-29554	2. Pool Code 77440	3. Pool Name GOBERNADOR PICTURED CLIFFS (GAS)
4. Property Code 318837	5. Property Name SAN JUAN 29 5 UNIT	6. Well No. 065F
7. OGRID No. 372171	8. Operator Name HILCORP ENERGY COMPANY	9. Elevation 6734

10. Surface Location

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
D	28	29N	05W		480	N	15	W	RIO ARRIBA

11. Bottom Hole Location If Different From Surface

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
12. Dedicated A 320			13. Joint or Infill		14. Consolidatio	n Code		15. Order No.	

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

303		

OPERATOR CERTIFICATION

Form C-102

August 1, 2011

Permit 252610

I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location(s) or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.

E-Signed By: Tammy Jones

Title: Operations/Regulatory Technician - Sr.

Date: 5/17/2018

SURVEYOR CERTIFICATION

I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief.

Surveyed By:

Jason C. Edwards

Date of Survey:

7/17/2004

Certificate Number:

15269




HILCORP ENERGY COMPANY SAN JUAN 29-5 UNIT 65F PICTURED CLIFFS RECOMPLETION SUNDRY

JOB PROCEDURES

- 1. MIRU service rig and associated equipment; test BOP.
- 2. TOOH with 2 3/8" tubing set at 7,992'.
- 3. Set a 4-1/2" cast iron bridge plug at +/- 3,900' to isolate the Mesa Verde and Dakota Formations. (Note: TOC at 2,820' by CBL.)
- 4. Load the hole and pressure test the casing to frac pressure.
- 5. N/D BOP, N/U frac stack and test frac stack to frac pressure.
- 6. Perforate and frac the Pictured Cliffs in a single stage (Top Perforation @ 3,658*; Bottom Perforation @ 3,754*).
- 7. Isolate frac stage with a composite bridge plug.
- 8. Nipple down frac stack, nipple up BOP and test.
- 9. TIH with a mill and drill out top Pictured Cliffs isolation plug.
- 10. Clean out to Mesa Verde and Dakota isolation plug and, when water and sand rates are acceptable, flow test the Pictured Cliffs.
- 11. Drill out Mesa Verde and Dakota isolation plug and cleanout to PBTD of 8,126'. TOOH.
- 12. TIH and land production tubing. Get a tri-mingled Mesa Verde + Dakota + Pictured Cliffs flow rate.



HILCORP ENERGY COMPANY SAN JUAN 29-5 UNIT 65F PICTURED CLIFFS RECOMPLETION SUNDRY

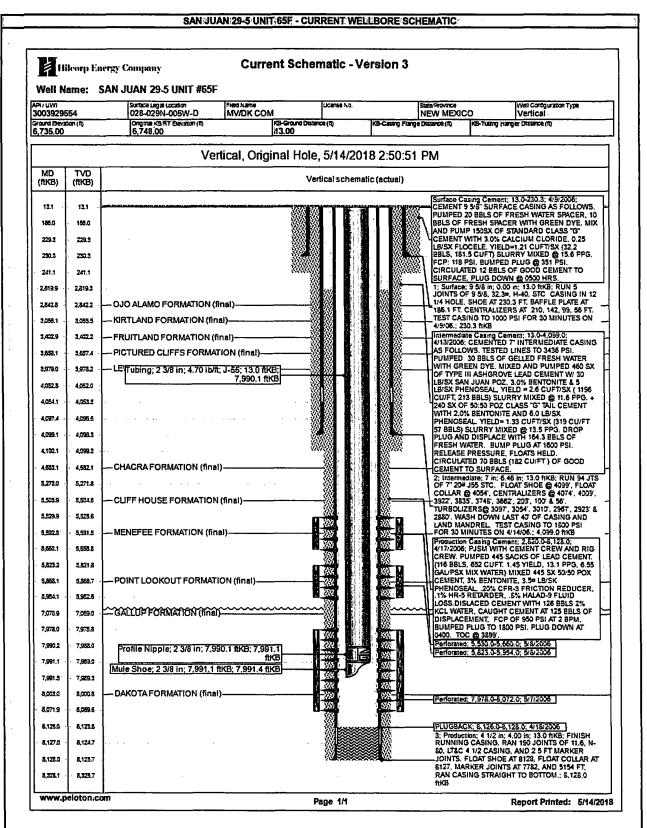



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Farmington District Office 6251 College Blvd. - Suite A Farmington, New Mexico 87402 www.blm.gov/nm



CASING REPAIR, WORKOVER, AND RECOMPLETION CONDITION OF APPROVAL

- 1. If casing repair operations are needed, obtain prior approval from this office before commencing repairs.
- 2. If a CBL or other logs are run, provide this office with a copy.
- 3. After any casing repair operations, test cement squeeze to a minimum of 500# for 30 minutes with no more than 10 % pressure fall off in the 30 minutes test period. Provide test chart with your subsequent report of operations
- 4. A properly functioning BOP and related equipment must be installed prior to commencing workover, casing repair, and/or recompletion operations.
- 5. Contact this office at (505) 564-7750 prior to conducting any cementing operations

SPECIAL STIPULATIONS:

- 1. Pits will be fenced during work-over operation.
- 2. All disturbance will be kept on existing pad.
- 3. All pits will be pulled and closed immediately upon completion of the recompletion and work-over activities.
- 4. Pits will be lined with an impervious material at least 12 mils thick.