### **UNITED STATES** DEPARTMENT OF THE INTERIOR

₹	F	C	E	ı	V	E	D

FORM APPROVED Form 3160-5 OMB No. 1004-0137 (August 2007) **BUREAU OF LAND MANAGEMENT** Expires: July 31, 2010 Bureau of Ir findian, Alloftee or Tribe Name SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on page 2 7. If Unit of CA/Agreement, Name and/or No. 1. Type of Well Oil Well X Gas Well Other 8. Well Name and No. San Juan 29-5 Unit 22 2. Name of Operator 9. API Well No. **Hilcorp Energy Company** 30-039-07659 3a. Address 10. Field and Pool or Exploratory Area 3b. Phone No. (include area code) 382 Road 3100, Aztec, NM 87410 505-599-3400 Gobernador PC/Blanco Mesaverde 4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) 11. Country or Parish, State Unit L (NWSW) 1790'FSL & 890' FWL, Sec. 8, T29N, R05W Rio Arriba New Mexico 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION X Notice of Intent Acidize Production (Start/Resume) Water Shut-Off Deepen Alter Casing Fracture Treat Reclamation Well Integrity Subsequent Report Casing Repair New Construction X Recomplete Change Plans Plug and Abandon Temporarily Abandon Final Abandonment Notice Convert to Injection Plug Back Water Disposal 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once Testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.) Hilcorp Energy Company plans to recomplete the subject well in the Pictured Cliffs formation and downhole commingle with the existing Mesaverde. Attached is the PC C102, recomplete procedure & wellbore schematic. The DHC application will be submitted and approved prior to commingling. A Closed Loop system will be utilized. Notify NMOCD 24 hrs prior to beginning NMOCD operations BLM'S APPROVAL OR ACCEPTANCE OF THIS MAY 3 0 2018 ACTION DOES NOT RELIEVE THE LESSEE AND **OPERATOR FROM OBTAINING ANY OTHER AUTHORIZATION REQUIRED FOR OPERATIONS** SEE ATTACHED DISTRICT III FOR CONDITIONS ON FEDERAL AND INDIAN LANDS OF APPROVAL 14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed) **Tammy Jones** Operations/Regulatory Technician - Sr. Signature THIS SPACE FOR FEDERAL OR STATE OFFICE USE Approved by Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any

false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

District I

1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

**District II** 

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 **District III** 

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 **District IV** 

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462 State of New Mexico
Energy, Minerals and Natural
Resources
Oil Conservation Division
1220 S. St Francis Dr.

Santa Fe, NM 87505

Form C-102 August 1, 2011

Permit 252395

#### WELL LOCATION AND ACREAGE DEDICATION PLAT

1. API Number 30-039-07659	2. Pool Code 77440	3. Pool Name GOBERNADOR PICTURED CLIFFS (GAS)
4. Property Code	5. Property Name	6. Well No.
318837	SAN JUAN 29 5 UNIT	022
7. OGRID No.	8. Operator Name	9. Elevation
372171	HILCORP ENERGY COMPANY	6549


10. Surface Location

ſ	UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County	
	L	8	29N	05W		1790	S	890	W		RIO ARRIBA

11. Bottom Hole Location If Different From Surface

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
12. Dedicated Acres 320.00 W/2			13. Joint or Infill		14. Consolidation Code			15. Order No.	

#### NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

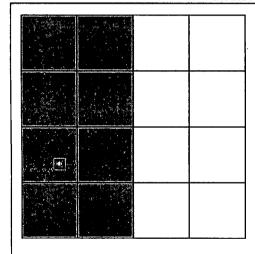

#### **OPERATOR CERTIFICATION**

I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location(s) or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.

E-Signed By: Tammy Jones

Title: Operations/Regulatory Technician - Sr.

Date: 5/17/2018

#### SURVEYOR CERTIFICATION

I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief.

Surveyed By:

James P. Leese

Date of Survey:

8/29/1955

Certificate Number:

1463




## HILCORP ENERGY COMPANY SAN JUAN 29-5 UNIT 22 PICTURED CLIFFS RECOMPLETION SUNDRY

#### JOB PROCEDURES

- 1. MIRU service rig and associated equipment; test BOP.
- 2. TOOH with 2 3/8" tubing set at 5,778'.
- 3. Set a 4-1/2" cast iron bridge plug at +/- 3,800' to isolate the Mesa Verde. Note: TOC at 2,405' by Temperature Survery.
- 4. RU Wireline. Run CBL. Record Top of Cement.
- 5. IF NECESSARY (Based on the results of the CBL top of cement) Perform cement squeeze work.
- 6. Load the hole and pressure test the casing to frac pressure.
- 7. N/D BOP, N/U frac stack and test frac stack to frac pressure.
- 8. Perforate and frac the Pictured Cliffs in a single stage (Top Perforation @ 3,501"; Bottom Perforation @ 3,566").
- 9. Isolate frac stage with a composite bridge plug.
- 10. Nipple down frac stack, nipple up BOP and test.
- 11. TIH with a mill and drill out top Pictured Cliffs isolation plug.
- 12. Clean out to Mesa Verde isolation plug and, when water and sand rates are acceptable, flow test the Pictured Cliffs.
- 13. Drill out Mesa Verde isolation plug and cleanout to PBTD of 7,567'. TOOH.
- 14. TIH and land production tubing. Get a commingled Mesa Verde/Pictured Cliffs flow rate.



## HILCORP ENERGY COMPANY SAN JUAN 29-5 UNIT 22 PICTURED CLIFFS RECOMPLETION SUNDRY

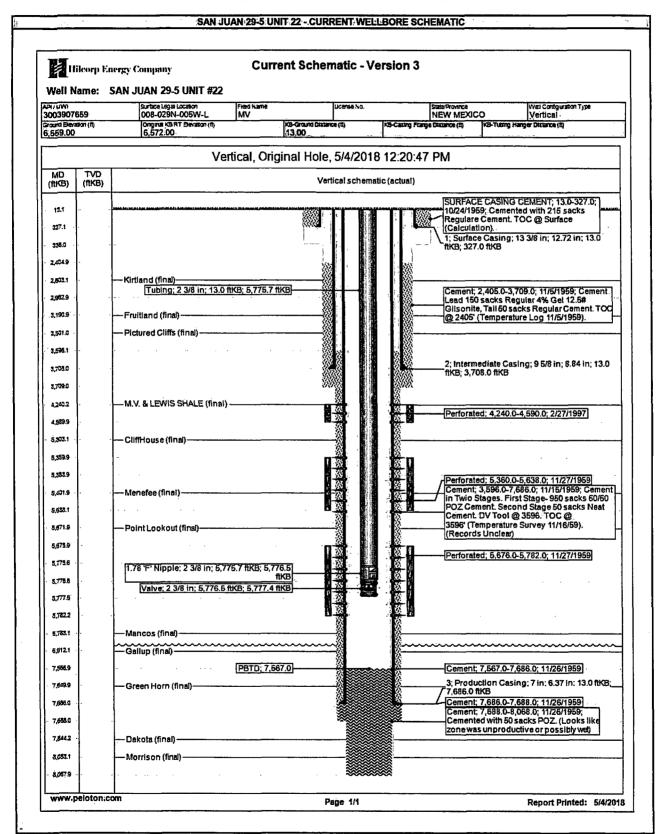



### United States Department of the Interior

#### **BUREAU OF LAND MANAGEMENT**

Farmington District Office 6251 College Blvd. - Suite A Farmington, New Mexico 87402 www.blm.gov/nm



# CASING REPAIR, WORKOVER, AND RECOMPLETION CONDITION OF APPROVAL

- 1. If casing repair operations are needed, obtain prior approval from this office before commencing repairs.
- 2. If a CBL or other logs are run, provide this office with a copy.
- 3. After any casing repair operations, test cement squeeze to a minimum of 500# for 30 minutes with no more than 10 % pressure fall off in the 30 minutes test period. Provide test chart with your subsequent report of operations
- 4. A properly functioning BOP and related equipment must be installed prior to commencing workover, casing repair, and/or recompletion operations.
- 5. Contact this office at (505) 564-7750 prior to conducting any cementing operations

### SPECIAL STIPULATIONS:

- 1. Pits will be fenced during work-over operation.
- 2. All disturbance will be kept on existing pad.
- 3. All pits will be pulled and closed immediately upon completion of the recompletion and work-over activities.
- 4. Pits will be lined with an impervious material at least 12 mils thick.