

Submit a Copy To Appropriate District Office  
District I – (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II – (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III – (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV – (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103  
Revised July 18, 2013

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-031-20339
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Dominion Production Company, LLC		6. State Oil & Gas Lease No.
3. Address of Operator 1414 W Swann Av, Suite 100, Tampa, FL 33606		7. Lease Name or Unit Agreement Name Hospah Sand Unit
4. Well Location Unit Letter C 530 feet from the N line and 2560 feet from the W line Section 1 Township 17N Range 9W NMPM County McKinley		8. Well Number 4Y
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 6950 GR		9. OGRID Number
		10. Pool name or Wildcat Upper Hospah

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Dominion Proposes to plug this well in accordance with the attached procedure and any agreed modifications thereto.

ESTIMATED START DATE 10/30/19

NMOCD

OCT 04 2019

DISTRICT III

Spud Date:

Point Lookout Top 350'

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Drake McCulloch TITLE Authorized Contractor DATE 10/4/19

Type or print name Drake McCulloch E-mail address: [drake@dwsrigs.com](mailto:drake@dwsrigs.com) PHONE: 505 320 1180

For State Use Only

APPROVED BY: Drake McCulloch TITLE SUPERVISOR DISTRICT #3 DATE 10/17/19

Conditions of Approval (if any):

AV

**Plug and Abandonment Plan**  
**Dominion Production Co, LLC.**  
**Hospah Sand Unit 4Y**  
**API# 3003120339**  
**530' FNL & 2560' FWL**  
**Sec. 1 T17N R9W**  
**McKinley County, New Mexico**

1. Comply with all OCD, DPC and contractor safety rules and regulations. Hold safety meetings each morning.
2. MIRU, Check Braden head for pressure. Bleed pressure off of well if necessary.
3. **Plug # 1- (Gallup Perforations and Formation Top 1581'-1420')** RIH with 2 7/8" 4.7#, WS with mule shoe sub. Wash wellbore to depth of 1581'. Mix and Pump 20 Sks, Class G Cement @ 15.5 ppg to cover Gallup with 50' cap and 50' excess.
4. **Plug #2-(Mancos Plug/ Surface Plug, 750'-Surface)** MIRU Wireline Truck, RIH with CBL Tool, from approx 1581' to Surface. Shoot 3-3/8" Squeeze holes (120 Degree Phasing) at approx. 750', actual to be determined from Bond Log. MIRU Pump Truck, Pump Approx. 20 bbls Fresh Water to establish circulation through Squeeze Holes. At Successful Circulation, Mix and Bullhead 130 Sks, Class B Cement @ 15.5 ppg, for outside annulus, Mancos Surface Plug, followed with 102 Sks of Class B Cement @ 15.5 ppg from 750' to Surface. Allow well to stabilize overnight. Top Casing off with Cement if necessary.
5. Cut off well 3' below ground and install P&A marker per OCD specifications. RD, cleanup MOL.
6. Restore location to OCD specifications.
7. All cement volumes are subject to change once surface and production casing sizes are confirmed in the field when operations begin. All current volumes and depths are assumptions based on previous wellbores.

---

# Wellbore Diagram

Hospah Sand Unit 4Y

API #: 3003120339

McKinley County, New Mexico

GR - 6950 feet

Surface Casing

8.625" 24#@ 74 ft  
Cemented with 60 sacks

Formations


Menefee - 350 ft  
Mancos - 560 ft  
Gallup - 1540 ft

Production Casing

5.5" 14# @ 1556 ft  
Cemented with 150 sacks

Perforations

Gallup - 1556 ft - 1581 ft

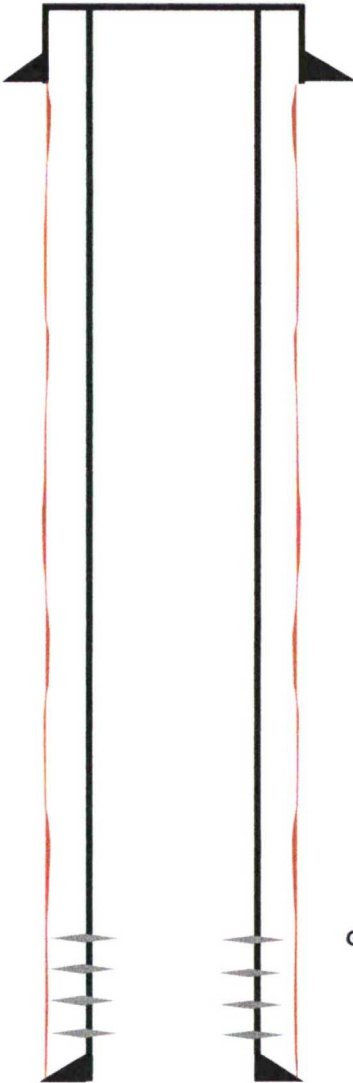

---

## Wellbore Diagram

Hospah Sand Unit 4Y

API #: 3003120339

McKinley County, New Mexico

### Plug 2

750 feet - Surface

750 feet plug

232 sacks of Class G Cement

### Plug 1

1581 feet - 1420

161 feet plug

20 sacks of Class G Cement

### Surface Casing

8.625" 24# @ 74 ft

### Formations


Menefee - 350 ft

Mancos - 560 ft

Gallup - 1540 ft

### Production Casing

5.5" 14# @ 1556 ft

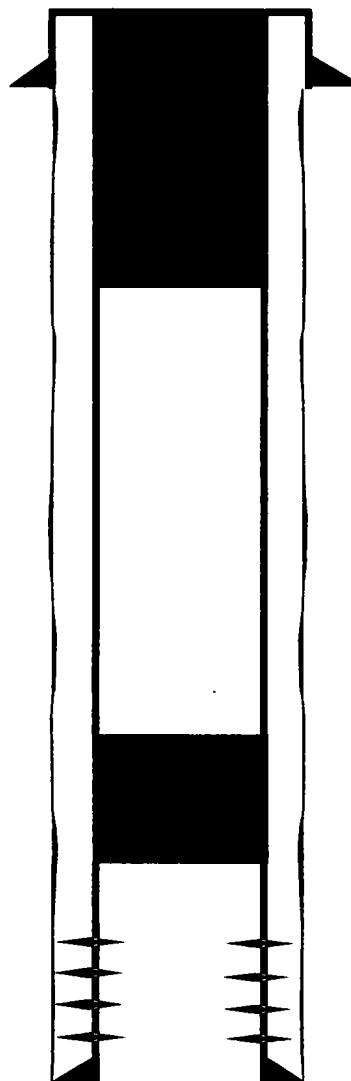

### Perforations

Gallup - 1556 ft - 1581 ft