Form 3160-5 (June 2015)			FORM APPROVED OMB NO. 1004-0137				
DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS				Expires: January 31, 2018 5. Lease Serial No. NOG13121863			
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name EASTERN NAVAJO		
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No. NMNM135216A		
1. Type of Well		8. Well Name and No.					
2. Name of Operator		9. API Well No.					
ENDURING RESOURCES LL	ces.com	30-045-35769-00-X1					
3a. Address 3b. Phone No. 1050 17TH STREET SUITE 2500 Ph: 505-63 DENVER, CO 80265 Ph: 505-63			. (include area code) 6-9743	LYBROOK MANCOS W			
4. Location of Well (Footage, Sec., 7	11. County or Parish, State						
Sec 23 T23N R9W SWSW 58 36.206768 N Lat, 107.765030		SAN JUAN COUNTY, NM					
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	HER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent	Acidize	Dee			on (Start/Resume)	UWater Shut-Off	
Subsequent Report	□ Alter Casing		raulic Fracturing	Reclamation		U Well Integrity	
	Casing Repair	□ New Construction		□ Recomplete		□ Other	
□ Final Abandonment Notice	 Change Plans Convert to Injection 				emporarily Abandon ater Disposal		
Enduring Resources is reques #30-045-35769 per procedure MIRU cement equipment (no safety and environmental regu Check casing pressure. Ensu Remove existing piping on ca RIH with 2 in. poly pipe to PB Rig up to pump cement down	and attached wellbore d rig is required). Hold pre-j ulations. re there is no pressure on sing valve. Cut-off wellhe TD (9-5/8 float collar).	iagram. job safety me n the well. ad.	eting. Comply wi	th all NMOC	NMO		
Pump Cement Plug 1: 9-5/8 s	urface casing float collar	to surface, 19	0 Sacks Class G	Cement (15	5.8 MAR 0 (5 2 02 0	
					DISTRIC	111	
14. I hereby certify that the foregoing is Commit	Electronic Submission # For ENDURING ted to AFMSS for processing	504887 verifie RESOURCES ng by ALBER1	A WETHINGTON	on 03/02/202	0 (20AMW0081SE)		
Name (Printed/Typed) LACEY G	BRANILLO		Title PERMIT	TTING SPEC	CIALIST		
Signature (Electronic	Submission)		Date 02/28/2	020			
	THIS SPACE FO	OR FEDERA	L OR STATE	OFFICE US	SE		
Approved By_JOE KILLINS			TitlePETROLEUM ENGINEER Date 03/06/2020				
Conditions of approval, if any, are attache certify that the applicant holds legal or eq which would entitle the applicant to condu-	uitable title to those rights in the	s not warrant or e subject lease	Office Farming	ton			
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a statements or representations as	crime for any post s to any matter w	erson knowingly and ithin its jurisdiction.	willfully to ma	ke to any department or	agency of the United	
(Instructions on page 2) ** BLM REV	ISED ** BLM REVISE	D ** BLM R	EVISED ** BLM		** BLM REVISE	D **	
		A	(20. 20 TTL 407	A A S	

NMOCD U

*

R

Additional data for EC transaction #504887 that would not fit on the form


32. Additional remarks, continued

١


.

Ib/gal, 1.17 cuft/sx, 5.03 gal/sx water, 2% calcium chloride, 50% excess). Establish circulation with cement down 2 in. poly pipe and back to surface. Ensure that good cement is circulated to surface.

Cut off casing and poly pipe below grade and install P&A marker to comply with regulations. Record GPS coordinates for P&A marker on EOW report. Photograph P&A marker in place. RDMO cement equipment.

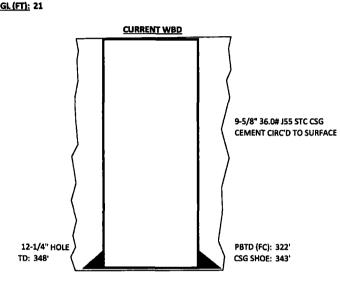

.

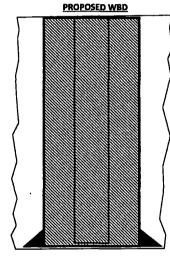

RIH W 2" POLY PIPE TO TD CEMENT W/ 190 SX CMT CLASS G, 15.8 PPG, 1.17 CUFT/SX

,

WELL: W LYBROOK UNIT 726Y API: 30-045-35769 <u>GL (FT):</u> 6,748 <u>KB (FT):</u> 6,769 KB - GL (FT): 21

.

• ٠

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE 6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment API: 30-045-35769

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.

- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
- 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)

3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.

3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.

4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.

- 4.1 The cement shall be as specified in the approved plugging plan.
- 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.3 Surface plugs may be no less than 50' in length.
- 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
- 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show <u>date</u> well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)