


(SUBMIT IN TRIPLICATE)

Land Office Farmington, New Mexico
Lease No. BLM-A018848-A
Unit Government

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

30-043-05045

Lease # 602 3982 1953

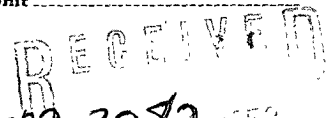


SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF REDRILLING OR REPAIR.....	A
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 8, 19 53

Well No. 1 is located 1557 ft. from N line and 1726 ft. from E line of sec. 30
NE/4 16N 1W NM PM
(¼ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Wildcat Sandoval New Mexico
(Field) (County or Subdivision) (State or Territory)

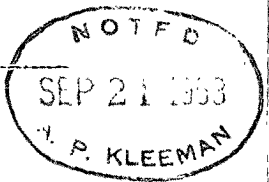

The elevation of the derrick floor above sea level is 6460 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled cable tool hole to 1442. No shows of oil or gas. 13 3/8" cemented at 209' w/100 sacks. Intermediate string of 10 3/4" hung at 756'. 8 5/8" cemented at 1293' w/25 sacks. Water not shut off.

Plugged inside of 8 5/8" with cement to approximately 1285'. Cut off 8 5/8" at 1101 and pulled.

10 3/4" casing will be left in hole and well completed as water well. Water sand 1075'-1085'.

Verbal approval 9-9-53.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Cities Service Oil Company
Address Box 97
Hobbs, New Mexico

By Charles M. Hasdell
Title District Superintendent