


30

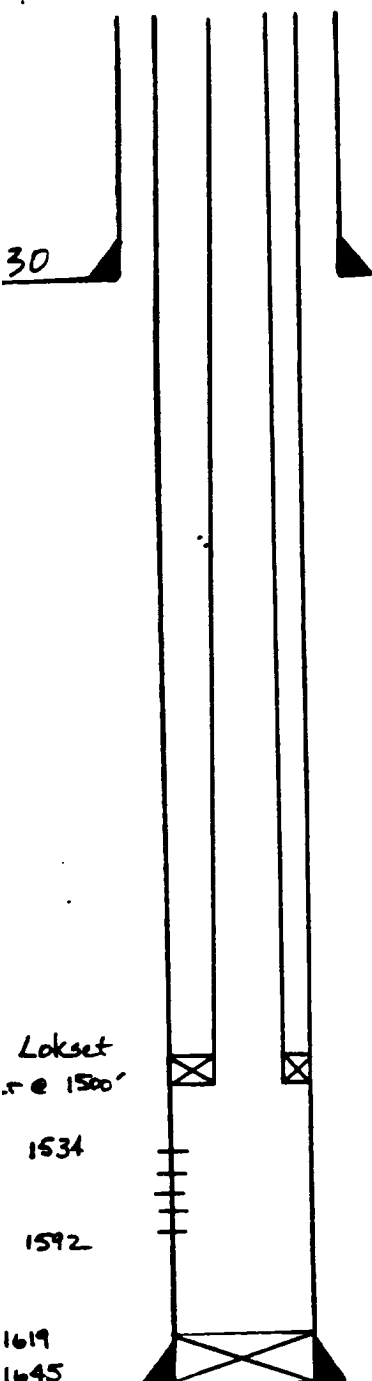

4418/3

LEASE HospahWELL NO. 5CASING:7 "OD, 17 LB, J-55 CSG. W/ 10 SXTOC @ Surface. HOLE SIZE 8 3/4" DATE 8-26-85

REMARKS _____

4 1/2 "OD, 10.5 LB, J-55 CSG. W/ 60 SXTOC @ 1127 (est). HOLE SIZE 6 1/4" DATE 9-1-65

REMARKS _____

TUBING:* 2 3/8 "OD, 4.7 LB, GRADE, B RD, EYE CPLGLANDED @ 1498. SN, PACKER, ETC. Lokset

* plastic coated tbg

PUMP _____ RODS _____ ANCHOR _____

DETAILED PROCEDURE:

1. MIRUSU.
2. NDWH. NUBOP.
3. TOOH w/tbg and packer.
4. RIH w/Model C RBP in tandem with fullbore retrievable cementer packer and SN above fullbore. Set standing valve in SN before running in hole.
5. RIH hydrotesting ~~the very~~ ^{every} 5 stands to 1000 psi.
6. Set RBP 20' above top perforation.
7. RIH w/standing valve retrieving head on sandline. Retrieve SV.
8. PUH w/fullbore pkr one jt.
9. PT RBP to 1000 psi. PT BS to 750 psi.
10. TOOH look for leak.
11. Isolate leak within one joint. TOOH w/tbg and pkr.
12. Dump one sx sand on top of RBP.
13. RIH w/tbg and pkr. Check location of leak again.