

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells

1. Type of Well OIL	API # (assigned by OCD) 30-031-05415 5. Lease Number Fee 6. State Oil & Gas Lease #
2. Name of Operator Geo Engineering	7. Lease Name/Unit Name Santa Fe Pacific I
3. Address & Phone No. of Operator P.O.Box 2966 Santa Fe, NM 87505	8. Well No. #10
4. Location of Well, Footage, Sec., T, R, M Sec. 20 T-20-N, R-9-W, NMPM, McKinley County Unit P	9. Pool Name or Wildcat 10. Elevation:

Type of Submission	Type of Action	
☐ Notice of Intent	☒ Abandonment	☐ Change of Plans
	☐ Recompletion	☐ New Construction
☒ Subsequent Report	☐ Plugging Back	☐ Non-Routine Fracturing
	☐ Casing Repair	☐ Water Shut off
☐ Final Abandonment	☐ Altering Casing	☐ Conversion to Injection
	☐ Other -	

13. Describe Proposed or Completed Operations

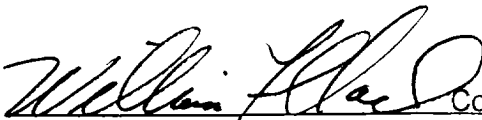
A-Plus Well Service, contractor, plugged and abandoned said well according to the attached Daily Report.

This work was completed under State of New Mexico Contract No. 98-521.25-059.

RECEIVED
MAR 13 1998

OIL CON. DIV.
DIST. 3

SIGNATURE



William F. Clark

Contractor

March 4, 1998

(This space for State Use)

Approved by



DEPUTY OIL & GAS INSPECTOR, DIST. #3
Title

Date

MAR 13 1998

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

Rig No _____

Date

2-23-98

Well No Santa Fe Pacific 1 #10 Location P-20-20N-094 Company Heo Engineering

FROM	TO	DESCRIPTION OF OPERATION
2-11-98		
12:00	12:30	Run in hole w/wk tag at 394'
2-17-98		
4:00	4:15	move to well set-up PT105 Pump down 2" csg. w/8 BBLs at 150 PSI at 1 BPM
4:15	4:45	Plug #1 mix 13 sxs cement disp to 300' shut in well w/350 PSI
		Rig-up w/lh to perf. at 300' Run in hole TAG at 320' perf 1 hole at 300' w/1 1/16 Biwire shot
4:45	5:00	Plug #2 pump into Perf w/10 BBLs. no circulation behind 2" csg. Mix 16 sxs disp. to 30' shut in well w/250 PSI
5:00	5:15	Perf 1 hole at 30' w/1 1/16 shot pump 1 1/2 BBL got circulation. Plug #3 mix 12 sxs. got 1 1/2 BBLs. cement return behind 2" csg. wash up move to SPP 1 #12
2-23-98		
11:30	12:00	Install Dry Hole Marker "

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing Plug #1 13 sxs Plug #2 16 sxsWireline ① 300' 1-1 1/16 bi-wire ① 30' 1-1 1/16 bi-wire