

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells

1. Type of Well
OIL

2. Name of Operator
Geo Engineering

3. Address & Phone No. of Operator
P.O.Box 2966
Santa Fe, NM 87505

4. Location of Well, Footage, Sec., T, R, M
Sec. 21 T-20-N, R-9-W, NMPM, McKinley County
Unit P, 565' FSL and 165' FEL

API # (assigned by OCD)
30-031-20062

5. Lease Number
Fee

6. State Oil & Gas Lease #

7. Lease Name/Unit Name
Santa Fe Pacific

8. Well No.
#102

9. Pool Name or Wildcat

10. Elevation:

Type of Submission

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment

Type of Action

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other -

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

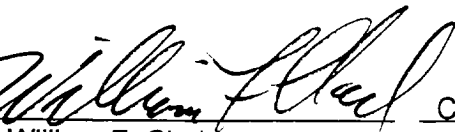
☐ Conversion to Injection

13. Describe Proposed or Completed Operations

A-Plus Well Service, contractor, plugged and abandoned said well according to the attached Daily Report.

This work was completed under State of New Mexico Contract No. 98-521.25-059.

SIGNATURE



William F. Clark

Contractor

March 4, 1998

(This space for State Use)

Approved by



DEPUTY OIL & GAS INSPECTOR, DIST. #3

Title

Date

MAR 13 1998

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

Rig No 6-7

Date 2/12/98

Well No Santa Fe Pacific #102 Location (P) 21-20N - 9W Company Geo Engineering

FROM	TO	DESCRIPTION OF OPERATION
2/12/98		
3:30	3:45 PM	move to Well Rig up Wh Run in Hole & Log Bottom at 328'
3:45		Rig up PT 105 to 5 1/2 csg. And Pump down csg + into
4:15		Open Hole AT 1 BPM AT 400 PSI w/ 10 ABL.
4:15		Plug #1 Mix 48 SX AT 15.4# Pump down 5 1/2 csg + in
5 PM		to Open Hole Disp cement to 30' shut well in w/ 500 PSI
5 PM	5:15	Perf 2 Holes w/ 2 1/8 Biwire shot AT 30'
		Pump 4 BBL. AT 0 PSI NO Return Behind 5 1/2 csg
5:15		Plug #2 Mix 20 SX Pump down 5 1/2 csg + out Perf
		AT 30' NO Return to Surface. Shut well in
	5:45 PM	wash PT & Drain up for day.
2/13/98		
	1/2 HR	Set Dry Hole Mark.

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing Plug #1 48sx Plug #2 20sx

Wireline Perf 2 Holes At 30' w/ 2 1/8 Biwire