

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

14-20-0603-9535

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Navajo-Allotted

7. UNIT AGREEMENT NAME

None

8. FARM OR LEASE NAME

Dosh e pl-Henlo

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Lone Pine Dakota

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

17-17N-8W

12. COUNTY OR PARISH

McKinley

13. STATE

New Mexico

1.

OIL WELL ☒ GAS WELL ☐ OTHER

2. NAME OF OPERATOR

Beard Oil Company

3. ADDRESS OF OPERATOR

2000 Classen Center, Oklahoma City, Oklahoma 73106

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

1800' FML & 330' FML of Sec. 17-17N-8W.
McKinley County, New Mexico

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

7006 GR

7020 KB

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*


Drill & set casing

XX

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Spud 12 1/4" hole 2/3/71 w/Rathole rig. Ran 3 jts. 8-5/8" 24# J-55 casing and set @ 91' KB meas. Cemented w/40 sx regular cement w/2% Cacl. circ. Approx. 20 sx to surface.
2. MIRU Aztec Well Service Co. 2/14/71. Hipple up & test casing & BOP to 500 psi for 30 min. Drilled under surface w/7-7/8" hole to TD 2875 2/16/71.
3. Ran Schlumberger Electric Logs to TD. Ran 89 jts 4 1/2" OD 9.5# K-55 STC casing and set @ 2874' KB. Cemented w/400 sx Class C W/10% salt. Good circulation thruout. Bumped plug w/1500 psi - held OK. Plug down @ 9:50 PM 2/17/71.
4. WOC prep to attempt completion in Dakota "D" sand.

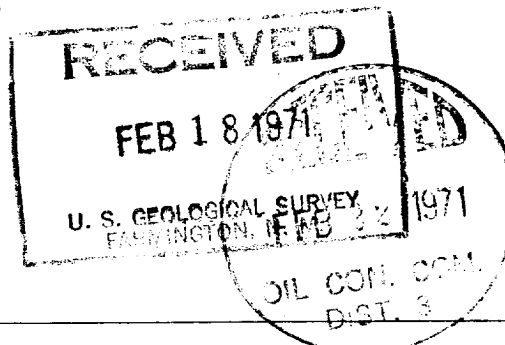

18. I hereby certify that the foregoing is true and correct

SIGNED

Ivan D. Allred

TITLE

Petroleum Engineer

DATE

2/18/71

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.