

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

N00-C-14-20-4305

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Navajo Allotted

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

BSK Edna

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Lone Pine Dakota

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 8, T17N, R8W

12. COUNTY OR PARISH

13. STATE

McKinley

N.M.

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Basin Fuels, Inc. (Formerly Burr &amp; Cooley)

3. ADDRESS OF OPERATOR

152 Petroleum Center Bldg., Farmington, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface

1650' FWL &amp; 2200' FNL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

7045 K.B.

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐  
☐  
☐  
☐

PULL OR ALTER CASING

☐  
☐  
☐  
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐  
☐  
☐  
☐

REPAIRING WELL

☐  
☐  
☐  
☐

FRACTURE TREATMENT

ALTERING CASING

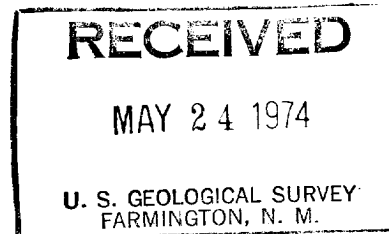
SHOOTING OR ACIDIZING

ABANDONMENT\*

(Other) Abandon Dakota &amp; Test Hospah

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Lone Pine Dakota "D" Perfs.5-18-74: Check PBTD @ 2820 ft. Spot 35 sack cement plug w/2% CaCl<sub>2</sub> over Dakota "D" perfs. 2813-16 ft. Check top of plug w/wireline after 4 hr. set @ 2564 ft. Dakota "D" plugging operation complete 5-18-74.Upper Hopsah SandRan GO International Cement bond log. Perf. Upper Hospah Sand from 1807-1811 (GO Depth) w/4 jets./ft. Swab test zone. Swab at final rate of 6 BFPH - 100% H<sub>2</sub>O - no shows. Hospah Upper Sand perfs. shut in 5-20-74. T.A.

18. I hereby certify that the foregoing is true and correct

SIGNED

Jack D. Cook

TITLE

Agent

DATE 5-22-74

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side