

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

Form 1000-1
Budget Bureau No. 42-1000-1

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> Dry Hole		5. LEASE DESIGNATION AND SERIAL NO. NM-0555674	
2. NAME OF OPERATOR Gulf Oil Corporation		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR Box 670, Hobbs, New Mexico 88240		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FSL & 700' FEL, Section 17, 17-N, 6-W		8. FARM OR LEASE NAME Beard Federal	
14. PERMIT NO.		9. WELL NO. 1	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6428' GL		10. FIELD AND POOL, OR WILDCAT Wildcat	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 17, 17-N, 6-W	
		12. COUNTY OR PARISH McKinley	
		13. STATE New Mexico	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2925' TD.

Reached TD of 7-7/8" hole at 2925' at 8:45 AM, December 3, 1971. No indication of commercial production. Obtained approval from Mr. Jerry Long with U. S. G. S. in Durango and plugged and abandoned as follows:

Spotted 55 sack cement plug No. 1 from 2725' to 2925'; 41 sack cement plug No. 2 from 1650' to 1800'; 27 sack cement plug No. 3 from 530' to 630' and 34 sack cement plug No. 4 from 125' to surface. Installed dry hole marker and cleaned location. Location is ready for your final inspection.

PLEASE CONSIDER THIS INFORMATION CONFIDENTIAL

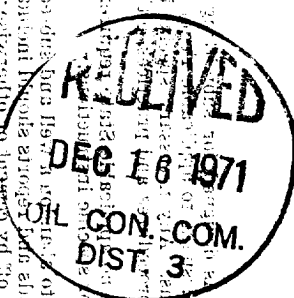

18. I hereby certify that the foregoing is true and correct

SIGNED ORIGINAL SIGNED BY
C. D. BORLAND

TITLE Area Production Manager

DATE December 14, 1971

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side