

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division


Sundry Notices and Reports on Wells

1. Type of Well
Oil

2. Name of Operator
NERDLIHC

3. Address & Phone No. of Operator
C/O NMOCD, 1000 Rio Brazos Road, Aztec, NM 87410

4. Location of Well, Footage, Sec., T, R, M
Sec 18, T-16-N, R-9-W, NMPM, McKinley County
Unit N, 700' FSL and 1850' FWL

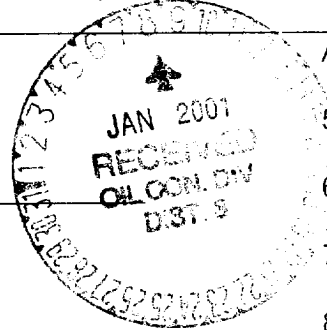

API # (assigned by OCD)
30-031-20424

5. Lease Number
Fee

6. State Oil & Gas Lease #
Fee

7. Lease Name/Unit Name
Bullseye

8. Well No.
#3

9. Pool Name or Wildcat

10. Elevation:

Type of Submission

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment

Type of Action

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other -

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

13. Describe Proposed or Completed Operations

This well was plugged under NMOCD Contract #00-521-25-205 per attached work report.

SIGNATURE

William F. Clark
William F. Clark, President, A-Plus Well

January 8, 2001

(This space for State Use)

Approved by

ORIGINAL SIGNED BY E. VILLANUEVA

DEPUTY OIL & GAS INSPECTOR, DIST. 9

Title

Date

JAN - 8 2001

Rig No

#1

Date

10/18/96

Well No

Bullseye #3

Location

N-18-16-9

Company

Nerdlike

FROM	TO	DESCRIPTION OF OPERATION
Sept 2000		MORU, Strip 56 hollow rods out of tubing, Pull and LD 59 jts 2 3/8" Hg. (18291)
Oct 31, 2000		Wireline Bruce Martin Nerdlike Run 4 1/2" Gauge sig to 1302', Set 4 1/2" CIBT at 1747'
Wed 11-15-00		R-u CUD + P-T #104 T.H. + TAG CIBT @ 1,752'; LOAD + CIRCULATE THE HOLE CLEAN WITH 21 BBLs WATER. TRY TO TEST CSG, CSG WOULD NOT TEST. 600' TO 0" in 30 sec. Plug #1 mix + Pump 20 SKS Cement, 15.6" from 1,752' to TO @ 1,488'. POOH WITH TAG TO 250'. CIRCULATE THE HOLE. POOH, ACIDIZE PUMP. DRAIN UP SLOW. BRUCE MARTIN W/ARMCO ON LOC.
Thu 11-16-00		R-u CUD + P-T #104 T.H. + TAG TO @ 1,521'. LOAD THE HOLE WITH 2 BBLs WATER. TRY TO TEST CSG, CSG WOULD NOT TEST. POOH WITH TAG TO 1,014'. LOAD THE HOLE WITH 1 BBL WATER. Plug #2 mix + Pump 25 SKS Cement, 15.6" from 1,014' to TO @ 685'. POOH WITH TAG TO 250'. CIRCULATE THE HOLE. POOH, R-D EQUIP. MAH. BRUCE MARTIN W/ARMCO ON LOC.
Mon 11-20-00		T.H. WITH WIRELINE + TAG TO @ 713'. PULL UP HOLE + PERFORATE 2-HSC HOLES @ 190'. POOH, HEAVY VIBRATOR W/ARMCO ON LOC.
Tue 11-21-00		BREAK CIRCULATION OUT THE B-H WITH 2 BBLs WATER. Plug #3 mix + Pump 55 SKS Cement, 15.6" from 190' with good cement. RETURNS OUT THE B-H. HEAVY VIBRATOR W/ARMCO ON LOC.
Fri 12-1-00		CUT OFF WELL HEAD. INSTALL MARKER WITH 12 SKS Cement 4 1/2" + 9 5/8" DOWN 3' FROM SURF.
Dec 2000		Remove heater meter; 3 pump units

Fuel & Motor Oil

Water Hauled

Rental Equipment

Cement Retainers

Cementing

P-#1-20 SKS P-#2-25 SKS P-#3-55 SKS MARKER 12 SKS - 112 SKS (bid)

Wireline

4 1/2" C-1200 CIBT 2-HSC HOLES @ 190'

102 SKS

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	Bell Clark	45		
Operator	Bob Stuart	131		
Helper	Sam Stuart	161		
Helper				
Helper				