

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

RECEIVED
BLM

5. Lease Designation and Serial No.
SF-080515 NM 084735

6. If Indian, Allottee or Tribe Name
01

SUBMIT IN TRIPLICATE

070 FARMINGTON

7. If Unit or CA, Agreement Designation
NM

1. Type of Well
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Texaco Exploration & Production Inc.

3. Address and Telephone No.
3300 N. Butler, Farmington N.M. 87401 (505)325-4397

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
933' FNL & 1065' FEL
Unit A, Sec. 8, T23N, R1W

8. Well Name and No.
Peggy Federal #1

9. API Well No.
30-039-05119

10. Field and Pool, or Exploratory Area
South Blanco P.C.

11. County or Parish, State
Rio Arriba, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input checked="" type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

RECEIVED
MAY 20 1993
OIL CON. DIV
DIST. 3

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Texaco E. & P. Inc. proposes to plug and abandon the subject well. The following procedure will be followed:

1. MIRUSU. Notify BLM to witness.
2. TOOH w/ TBG. TIH w/ 4-1/2" CMT RET. Set RET @ 2900'. Test RET & TBG.
3. Establish rate and pressure into Pictured Cliffs perforations (3150'-3237') and SQZ perms using 58 SX class "G" CMT (12 BBS).
4. Sting out of RET and spot POZ CMT inside CSG to 1600'. POOH w/ TBG.
5. RU wireline, RIH and shoot 2 SQZ holes @ 1600', RD wireline. (Nacimiento plug)
6. RIH w/ 4-1/2" CMT RET, set RET @ 1550'.
7. Open bradenhead @ surface and attempt to achieve circulation to surface through SQZ holes @ 1600'.
*IF CIRCULATION IS ACHIEVED: Circ. POZ CMT to surface outside CSG (approx. annular vol. = 42 BBLs). Sting out of RET and spot POZ CMT to surface inside CSG (approx. CSG vol. = 25 BBLs).
*IF CIRCULATION IS NOT ACHIEVED: SQZ holes @ 1600' w/ 50 sx POZ CMT. Sting out of RET and spot POZ CMT to 150' inside CSG. POOH w/ TBG, RU wireline and perf 2 sqz holes @ 150'. RD wireline. Establish circ. to surface through SQZ holes @ 150', circ. "G" CMT to surface in/out CSG.
8. Remove all surface equipment. Reclaim location. Erect P&A marker.

14. I hereby certify that the foregoing is true and correct

Signed Shirley Mondy Title Area Manager Date 3/23/92

(This space for Federal or State office use)
Approved by SHIRLEY MONDY Acting AREA MANAGER
Conditions of approval, if any: Title RIO PUERCO RESOURCE AREA Date MAY 17 1993

Minimum mud weight of 9 PPG mud must be used

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.



3/22/93

PEGGY FEDERAL No. 1

CURRENT COMPLETION

WELL:

Peggy Federal No. 1

LOCATION:

**933' FNL & 1063' FEL, Unit A
NE/4, NE/4, Sec. 8, T23N, R1W
Rio Arriba County**

SPUD DATE: 4/15/62

COMPL DATE: 4/23/62

FORMATION TOPS:


Pictured Cliffs 3150'

Pictured Cliffs

Perforations:

3150' - 3237'

TD - 3269'

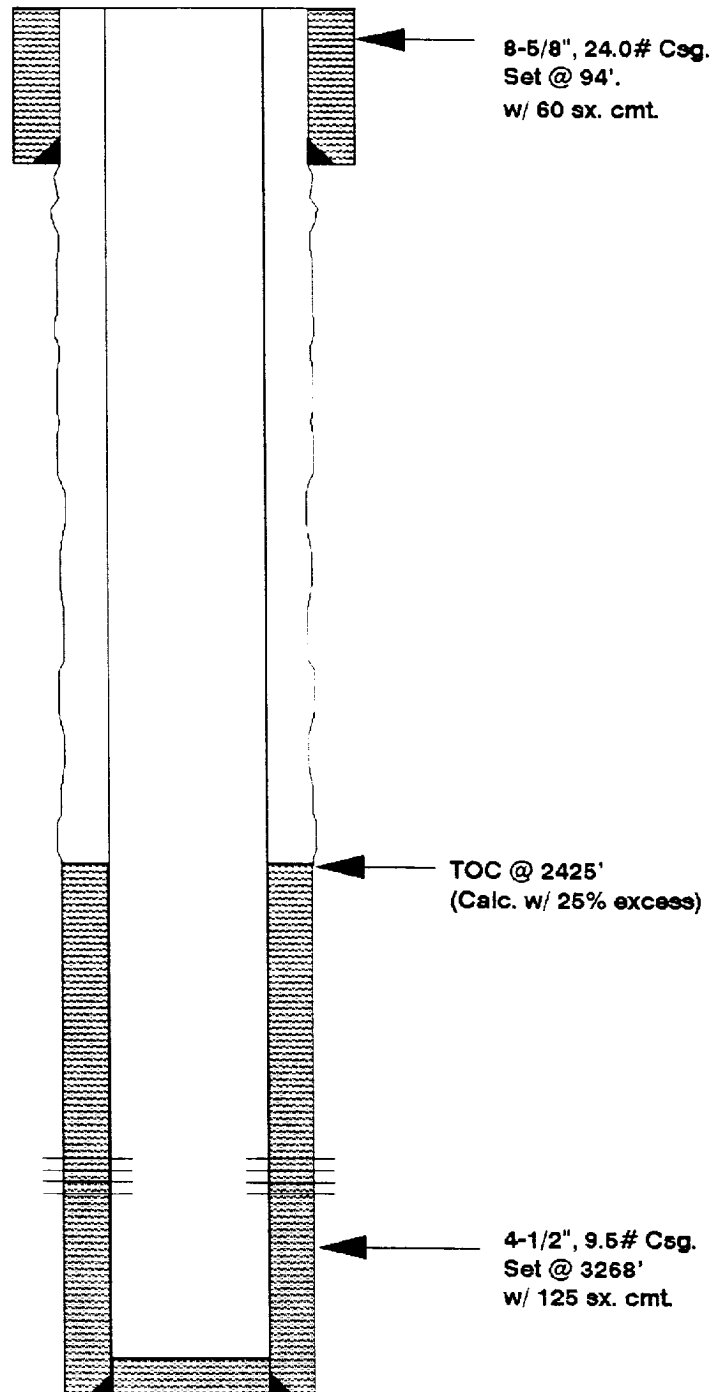



3/22/93

PEGGY FEDERAL No.1

PROPOSED PLUG & ABANDONMENT

WELL:

Peggy Federal No. 1

LOCATION:

933' FNL & 1063' FEL, Unit A
NE/4, NE/4, Sec. 8, T23N, R1W
Rio Arriba County

SPUD DATE: 4/15/62

COMPL DATE: 4/23/62

FORMATION TOPS:

Pictured Cliffs 3150'

Pictured Cliffs

Perforations:

3150' - 3237'

TD - 3269'

