

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	5. LEASE DESIGNATION AND SERIAL NO. Contract No. 38
2. NAME OF OPERATOR CONOCO INC.	6. IF INDIAN, ALLOTTEE OR TRIBE NAME Ticarilla Apache
3. ADDRESS OF OPERATOR P. O. Box 460, Hobbs, N.M. 88240	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface Unit M	8. FARM OR LEASE NAME AXI Apache H
14. PERMIT NO. 30-039-05150	9. WELL NO. 7
15. ELEVATIONS (Show whether DF, RT, GR, etc.) BUREAU OF LAND MANAGEMENT FARMINGTON RESOURCE AREA	10. FIELD AND POOL, OR WILDCAT Ballard Pictured Cliffs
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 6-23-5W
	12. COUNTY OR PARISH Rio Arriba
	13. STATE NM

RECEIVED

AUG 12 1986

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- ① MIRU, pull Hbg
- ② Bullhead 135 sxs Class "B" w/2% CaCl₂ down 5 1/2" CSG
- ③ Fill hole w/9.2 ppg mud, then pump 10 add'l bbls mud to sqz 50 sxs cmt into perfs.
- ④ Tag TOC @ ±1400'. 6 IH & perf @ 166' w/4 JS PF.
- ⑤ Establish circ., then pump 50 sxs Class "B" cmt & circ. to surface
- ⑥ Cut off CSG a minimum of 3' below final restored ground level & install P&A marker.
- ⑦ Clean location & rig down
- ⑧ A proposed P&A sketch is attached.

RECEIVED
AUG 25 1986
OIL CON. DIV. I
DIST. 3

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Administrative Supervisor

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

DATE 8-11-86
APPROVED

AS AMENDED

DATE

AUG 22 1986

AREA MANAGER

SEE ATTACHED FOR
CONDITIONS OF APPROVAL


*See Instructions on Reverse Side

NMOCC

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

BLM-Farmington (6) File

P&A Marker includes:
 "AXI Apache H No. 7"
 "M-6-23N-5W"

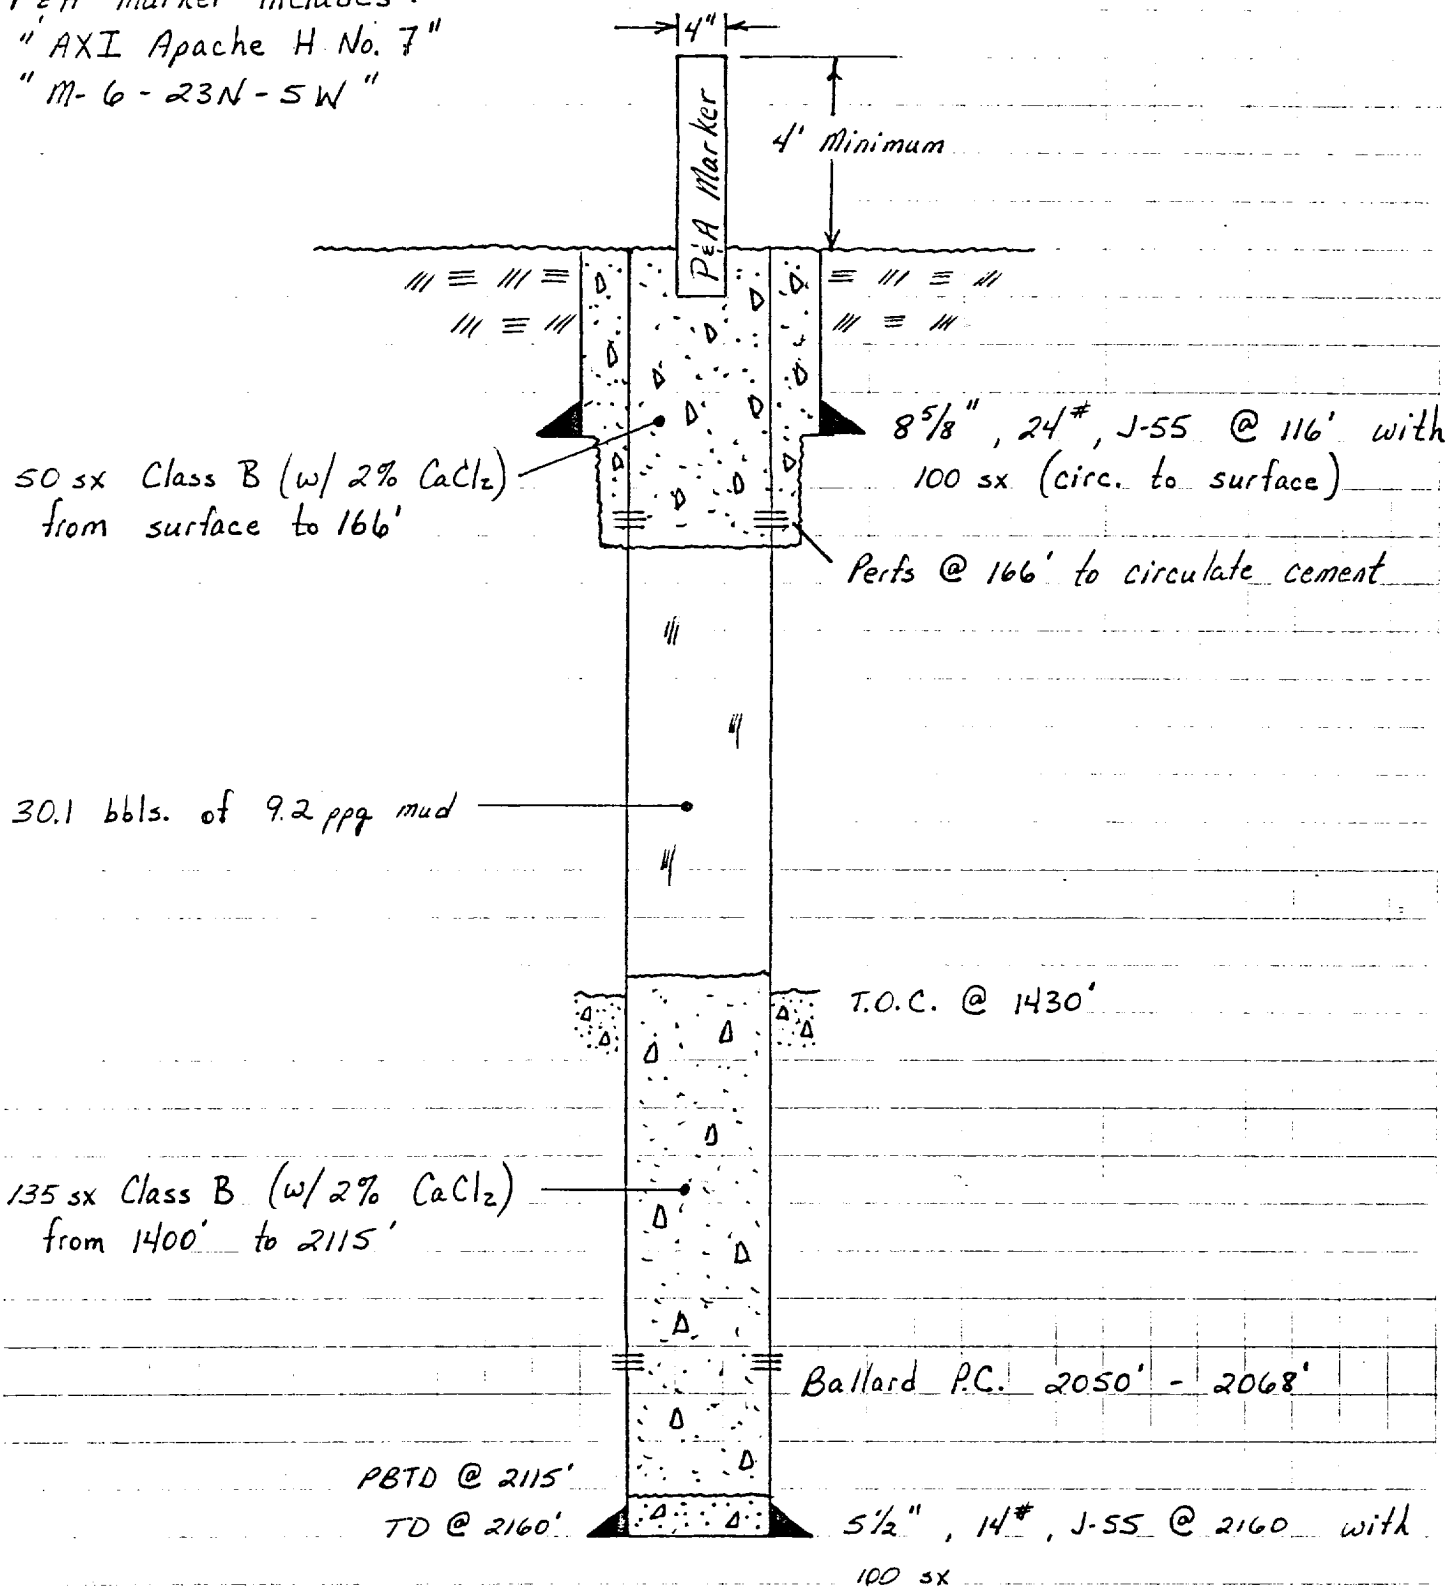

Made By Greg Ashdown

Checked By

Date 7/18/86

Conoco Inc.
 Calculation Sheet

Title Proposed P&A Sketch
AXI Apache H #7

Job No.

Field Ballard
New Mexico