

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells

1. Type of Well GAS	5. Lease Number Cont #54
2. Name of Operator Meridian Oil Inc.	6. If Indian, All.or Tribe Name Jic.Apache
3. Address & Phone No. of Operator Box 4289, Farmington, NM 87499 (505) 326-9700	7. Unit Agreement Name
4. Location of Well, Footage, Sec, T, R, M. 790'N, 1850'W Sec.33, T-23-N, R-3-W, NMPM	8. Well Name & Number Stromberg #7
	9. API Well No.
	10. Field and Pool Ballard Pic.Cliffs
	11. County and State Sandoval County, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission	Type of Action
<input checked="" type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracture
	<input type="checkbox"/> Water Shut Off
	<input type="checkbox"/> Conversion to Inject

13. Describe Proposed or Completed Operations

It is intended to plug and abandon the subject well by placing a cement plug in the casing from PBTD of 2967' to 1900'. 9.2 ppg mud will be set in the casing from 1900' to 200'. The 4 1/2" csg will be perforated at 200' and cement placed inside and outside the casing from 200' to surface. This work will be scheduled for late 1990 and will be performed pending approval.

RECEIVED
JUN 25 1990

SEE ATTACHED FOR
CONDITIONS OF APPROVAL

OIL CON. DIST. 3

14. I hereby certify that the foregoing is true and correct
Signed Deanna Smithfield (LS) Title Regulatory Affairs Date 5-25-90

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE MAY 31 1990
CONDITION OF APPROVAL, IF ANY:


CHOCF

AREA MANAGER

Stromberg #7
Unit C Sect 33-T23N-R3W
Sandoval County, New Mexico

Wellbore Schematic

CURRENT

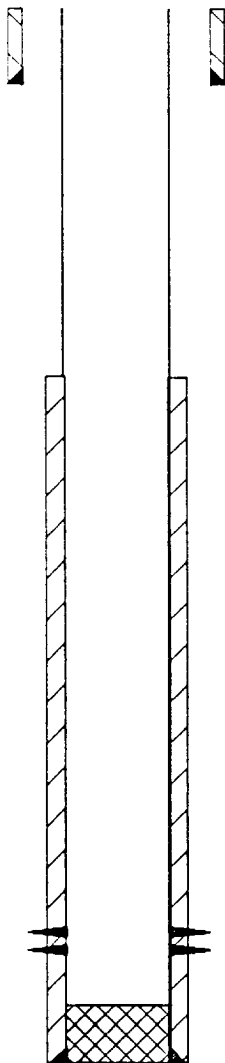

Class B cmt 200' to
surf. (annulus & csg)

8 5/8" set @ 100'

9.2 PPG Mud
from 1900 to 200'

Top of cmt @ 2000' (calc.)


100 sxs Class B cmt
Calculated fill from
PBTD to 1900'

PC perfs @ 2893-97' (10 SPF)

PBTD @ 2967'

TD @ 3047'

PROPOSED

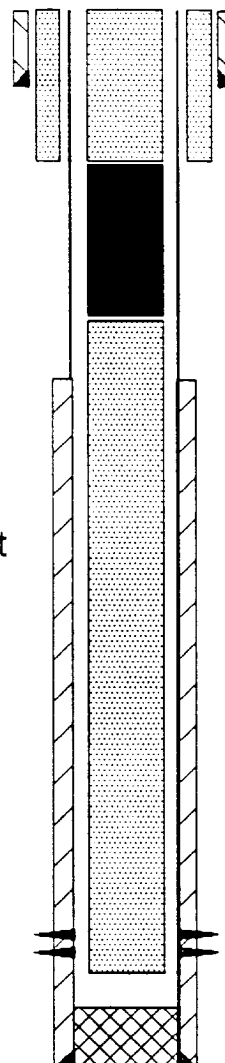

Class B cmt 200' to
surf. (annulus & csg)

8 5/8" set @ 100'

9.2 PPG Mud
from 1900 to 200'

Top of cmt @ 2000' (calc.)

100 sxs Class B cmt
Calculated fill from
PBTD to 1900'

PC perfs @ 2893-97' (10 SPF)

PBTD @ 2967'

TD @ 3047'

IN REPLY REFER TO
(019)

UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT
FARMINGTON RESOURCE AREA
1235 LA PLATA HIGHWAY
FARMINGTON, NEW MEXICO 87401

Attachment to Notice of

Re: Permanent Abandonment

Intention to Abandon

Well: 7 Stromberg

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal Leases."
2. Mark Kelly with the Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 326-6201.
3. Blowout prevention equipment is required.
4. The following modifications to your plugging program are to be made (when applicable):

*Add a plug from 1300-1200 inside & outside production casing
(Fresh water zone)*

Office Hours: 7:45 a.m. to 4:30 p.m.

GENERAL REQUIREMENTS FOR
PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES
FARMINGTON RESOURCE AREA

1. Secure prior approval either on a Sundry Notice (Form 3160-5) or verbally from the Fluids Drilling & Production Section at this office before changing the approved plugging program.
2. Plugging equipment used shall have separate mixing and displacement pumps and a calibrated tank to assure proper displacement of plugs. The Operator is responsible for providing all measuring devices needed to assure proper measurement of materials being used.
3. A proper tank or pit will be used to contain all fluids pumped from the well during plugging operations. Unattended pits are to be fenced.
4. All cement plugs are to be placed through tubing (or drillpipe) and shall be a minimum of 100 feet in length with 50% excess inside casing or 100% excess when plug is set in open hole or squeezed into perforations. 15.6#/gal slurry weight is to be used when using class B neat cement or when CaCl_2 is used. Use the recommended slurry weight of other type cements when they are used (Class C, Pozzolan etc.).
5. Any cement plugs placed when well is not full of fluid, or when well may be taking fluid, (i.e. across perfs-unless bridge plug or retainer is used, across bad csg., or fresh water formations) will be tagged (touched) after cement has set to verify proper location.
 - 5a. Testing The first plug below the surface plug shall generally be tested by either tagging the plug with the working pipe string, or pressuring to a minimum pump (surface) pressure of 1000 psig, with no more than a 10 percent drop during a 15-minute period (cased hole only). If the integrity of any other plug is questioned, it must be tested in the same manner. Also, any cement plug which is the only isolating medium for a fresh water interval or a zone containing a valuable mineral deposit should be tested by tagging with the drill string.
6. Mud must be placed between plugs. Plugging mud is to be made up with a minimum of 15 lbs/bbl of sodium bentonite, and a nonfermenting polymer. Minimum consistency of plugging mud must be 9 lbs/gal and with a minimum viscosity of 50 sec/qt. Fresh water is to be utilized for mixing mud.
7. Following the placement of a cement plug, the withdrawal rate for at least the length of the cement plug shall not exceed 30 ft/min, in order to minimize the contamination of the plug.

8. Within 30 days after plugging work is completed, file a Sundry Notice (Subsequent Report of Abandonment, Form 3160-5), in quintuplicate with Area Manager, Bureau of Land Management, 1235 La Plata Highway, Farmington, NM 87401. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.

9. All permanently abandoned wells are to be marked with a regulation marker (4" pipe extending 4' above the ground line) containing the information as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10. After plugging work is completed the surface is to be rehabilitated in accord with instructions from the Fluids Surface Management Section of the Farmington Resource Area Office.

All above are minimum requirements. The period of liability under the bond of record will not be terminated until the lease is inspected and surface work approved.

Please advise this office when the well location is ready for final inspection.

Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1.

You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.