

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

14-20-0603-1649

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Allotment 114

Piz-ele-Pah

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Navajo Lands

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA

Sec. 25, T-22-N, R-9-W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

1.

OIL WELL ☐ GAS WELL ☐ OTHER ☒ Dry Hole

2. NAME OF OPERATOR

SUN OIL COMPANY

3. ADDRESS OF OPERATOR

P. O. Box 1861, Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

2260' FWL and 2035' FNL of Section 25, T-22-N, R-9-W

14. PERMIT NO.

Approved 1-5-71

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6531.0' Gd 3548.0 KB

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☒

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

PRESENT CONDITIONS: Original TD 10,897 PBTD 4710'. 13 3/8" OD casing set at 368' Cement circulated. 8 5/8" OD casing set at 4893'. Cemented with 470 sacks. Calculated top cml. - 3573.

PROPOSED PLUGGING PROCEDURE:

1. Perforate 8 5/8" casing with 4 holes at approximately 850 ft.
2. Establish circulation and cement down 8 5/8" casing with approximately 225 sacks cement. Leave minimum 100' cement inside 8 5/8" casing (750' - 850') and use sufficient volume to over-lap 13 3/8" OD casing.
3. Cut casing off below ground level and cement inside and outside top of 8 5/8" casing with approximately 15 sacks cement.
4. Install permanent marker.

18. I hereby certify that the foregoing is true and correct

SIGNED

W. E. Westbrook, Jr.

TITLE

District Drilling Engineer

DATE 6-2-71



(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

*See Instructions on Reverse Side

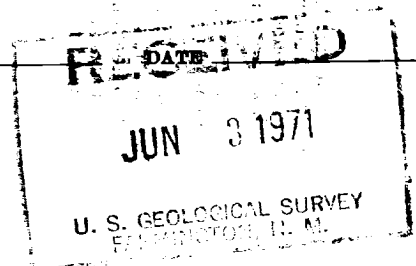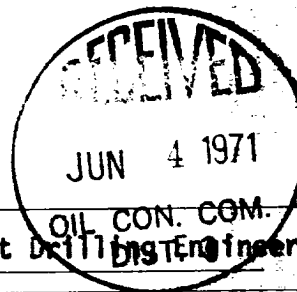

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of sealing of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963-O-685-229

847-881

