

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐

2. NAME OF OPERATOR
CONOCO INC.

3. ADDRESS OF OPERATOR
P. O. Box 460, Hobbs, N.M. 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface Unit A

14. PERMIT NO.
30-039-05267

15. ELEVATIONS (Show whether OF, RT, GR, etc.)
908' FNL & 1011' FEL

5. LEASE DESIGNATION AND SERIAL NO.
Contract No. 38

6. IF INDIAN, ALLOTTEE OR TRIBE NAME
Jicarilla Apache

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
AXI Apache H

9. WELL NO.
10

10. FIELD AND POOL, OR WILDCAT
Ballard Pictured Cliffs

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 32-24N-5W

12. COUNTY OR PARISH
Rio Arriba

13. STATE
NM

RECEIVED

SEP 11 1986

BUREAU OF LAND MANAGEMENT
FARMINGTON RESOURCE AREA

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	☐	PULL OR ALTER CASING	☐
FRACTURE TREAT	☐	MULTIPLE COMPLETE	☐
SHOOT OR ACIDIZE	☐	ABANDON*	☒
REPAIR WELL	☐	CHANGE PLANS	☐
(Other)	☐		☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF	☐	REPAIRING WELL	☐
FRACTURE TREATMENT	☐	ALTERING CASING	☐
SHOOTING OR ACIDIZING	☐	ABANDONMENT*	☐
(Other)	☐		☐

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- ① MIRU, Pull tbg. Bullhead 104 SXS Class "B" w/ 2% CaCl₂ down 4 1/2" CSG
- ② Fill hole w/ 9.2 ppg mud and pump an additional 10 bbls mud to sqz 50 SXS cmf into perfs.
- ③ Tag TOC @ ±1500' & pull up to perf @ 331' w/ 4 JS PF. Establish circ. & pump 91 SXS Class "B" w/ 2% CaCl₂ to surface.
- ④ Cut off CSG a min. of 3' below restored ground level & install abandonment marker. Rig down.
- ⑤ A P&A sketch is attached.

RECEIVED

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature]

TITLE Administrative Supervisor

DATE 9-9-86

(This space for Federal or State office use)

APPROVED BY [Signature]
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE SEP 12 1986


*See Instructions on Reverse Side

NMOCO

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

BLM-Farmington(6) File

PeA Marker includes:
 "AXI Apache H No. 10"
 "A-32-24N-SW"

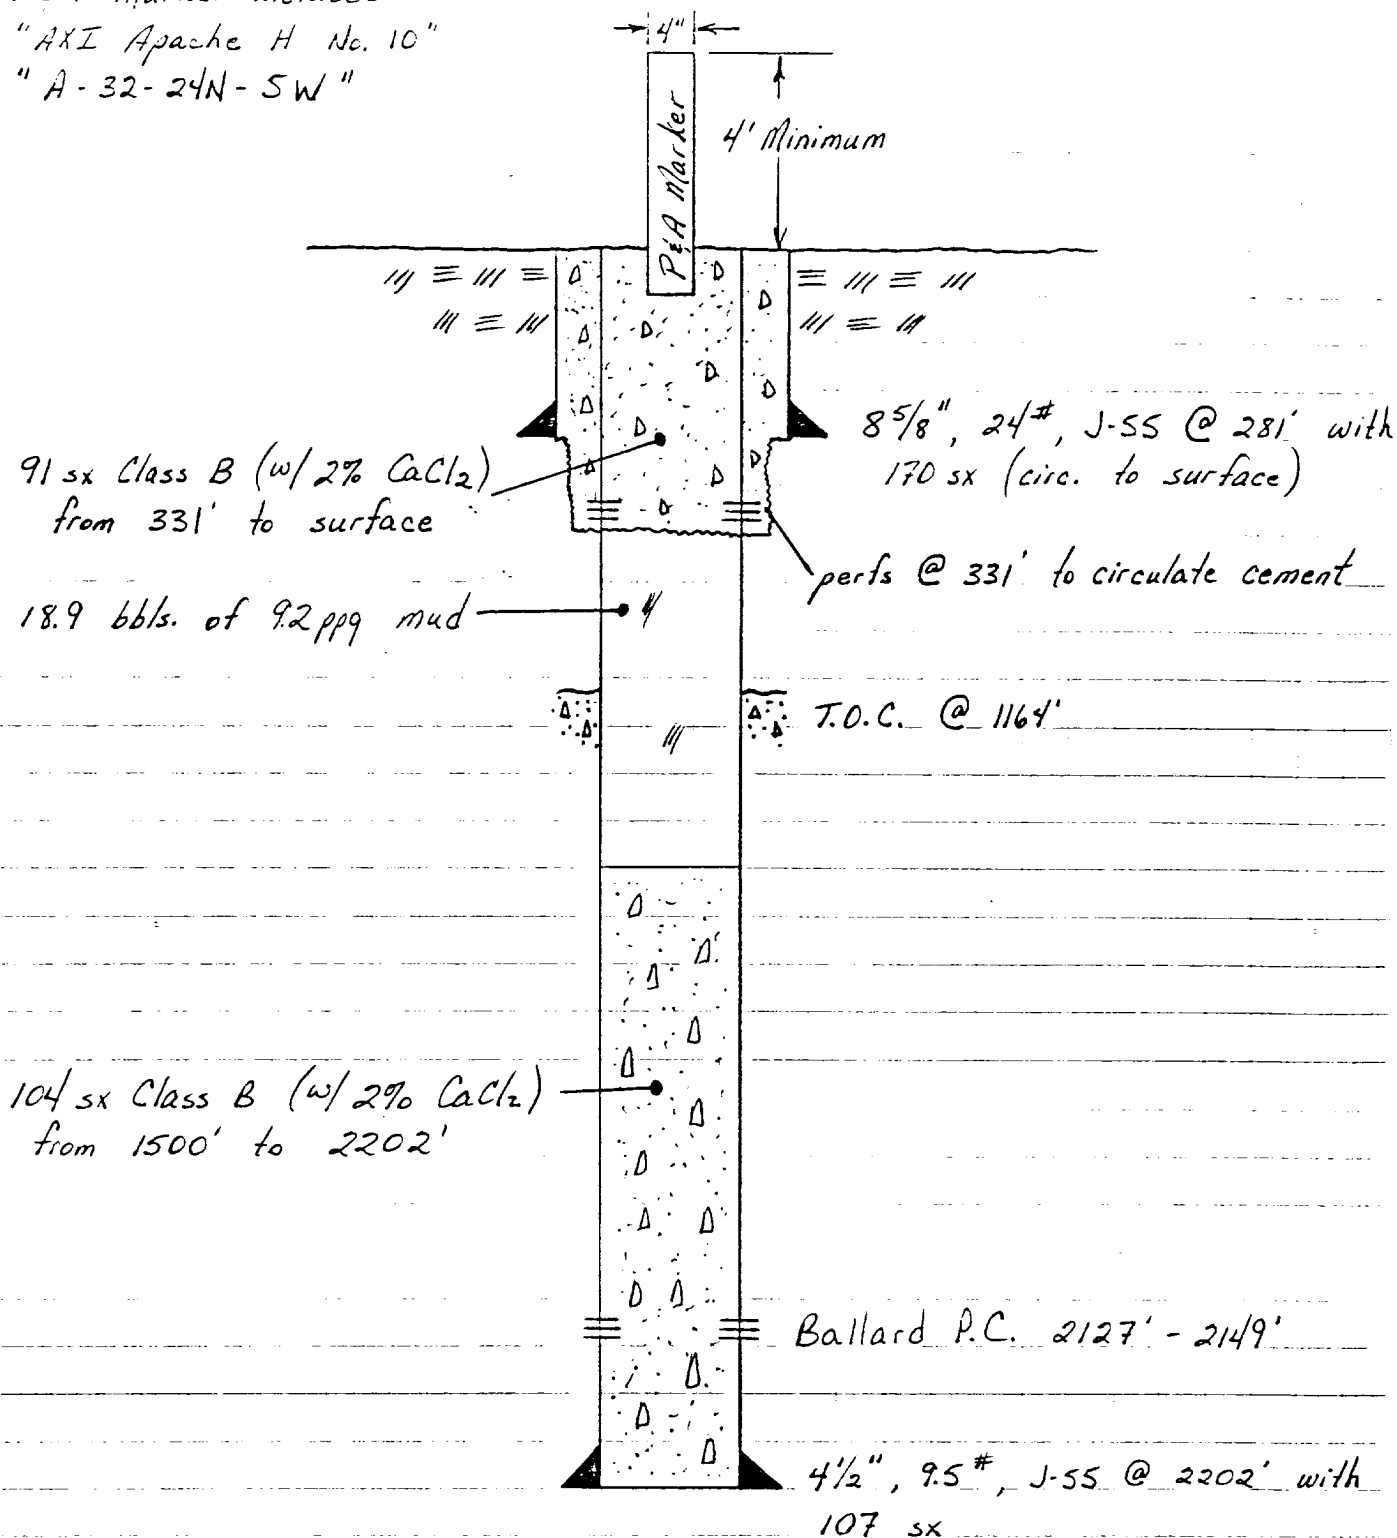

Made By Greg Ashdown

Checked By

Date 7/23/86

Page 1 of 1

Conoco Inc.

Calculation Sheet

Job No.

Title Proposed PeA Sketch

AXI Apache H #10

Field

Ballard

State

New Mexico