

Form 9-331
(May 1973)UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE
(Order instructions on reverse side)Form approved
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND AREA NO.

NM-03595

6. IF INDIAN, ALLOTTEE OR TRIBAL NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

BCO, Inc.

3. ADDRESS OF OPERATOR

135 Grant Ave. Santa Fe, New Mexico 87501

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

1850 FSL and 790 FEL Sec 18 T24N R7W NMPM

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

14. PERMIT NO.

15. ELEVATIONS (Show whether DP, RT, CR, etc.)

GR 7171

7. UNIT AGREEMENT NAME

Escrito Gallup

8. FARM OR LEASE NAME

Escrito Gallup Unit

9. WELL NO.

9 (Formerly Eliz 5)

10. FIELD AND FORM. OF WILDCAT

Escrito Gallup

11. SEC., T., R., M. OR BLK. AND SURVEY OR AREA

18-24N-7W NMPM

12. COUNTY OR PARISH 13. STATE

Rio Arriba

N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT

☒
☐
☐
☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and pertinent to this work.)

7-14-82 Set BP at 5589'. Advised Lisa with Minerals Management we intend to cement on 7-15-82 at 8:00 AM. Determined holes at 4118' - 4196' and 2297' - 2313'.

7-15-82 Set cement retainer at 3996'. Mixed 125 sacks Class H, 2% CaCl yield 1.06. Set packer at 1690'. Final squeeze pressure 2000#'s. Mixed 325 sacks Class H, 2% CaCl yield 1.06. Final squeeze pressure 1000#'s.

8-24-82 Tagged cement.

8-25-82


to

8-31-82 Drilled cement. Tested. Circulated to BP. Removed RBP.

9-9-82

to

9-15-82 Swabbed well and placed back in production.

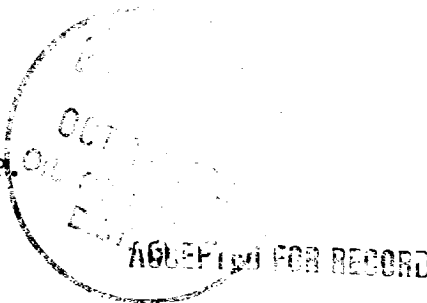

OCT 10 1982

FARMINGTON N.M.

BY

18. I hereby certify that the foregoing is true and correct

SIGNED

Lida L. Classen

TITLE

Office Manager

DATE

10/11/82

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

NMOCC