

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)


1. oil ☐ well gas ☐ well other ☒ P&A
2. NAME OF OPERATOR  
Mesa Petroleum Co.
3. ADDRESS OF OPERATOR  
1660 Lincoln St. #2800, Denver CO 80264
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 1980' FNL, 1980' FWL  
AT TOP PROD. INTERVAL:  
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

5. LEASE  
NM 23233
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME  
South Blanco Federal 22
9. WELL NO.  
1
10. FIELD OR WILDCAT NAME  
Lybrook Gallup Extension
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Sec. 22-T24N-R8W
12. COUNTY OR PARISH  
San Juan
13. STATE  
New Mexico
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

- TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐

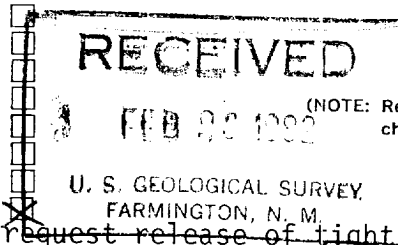

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

(other) Notice of Intent to P&A, request release of tight hole status

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Subject well was drilled to TD of 5732' using a 7-7/8" bit on 2/17/82. Logged well and determined well to be non-productive. Received permission from Minerals Management Services in Farmington NM to plug well. Plugged well as follows: 5436-5336' - 30 sack plug, 4386-4286' - 30 sack plug, 2046-1946' - 30 sack plug, 1400-1300' - 30 sack plug, 300-200' - 30 sack plug. Remaining open hole was filled with heavy mud laden fluid. Set dry hole marker and cemented it with 10 sack plug. Request release of Tight Hole status given to well.

APPROVED  
AS AMENDED  
DEC 13 1984

Subsurface Safety Valve: Manu. and Type

OIL CON. DIV.  
DIST. 3

DEC 11 1984  
Set @ *[Signature]*  
M. MILLENBACH  
AREA MANAGER

18. I hereby certify that the foregoing is true and correct

SIGNED *Randy Nordman* TITLE Reg. Coordinator DATE 2/19/82

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

Approved as to plugging of the well bore.  
Liability under bond is retained until  
surface restoration is completed.

See Instructions on Reverse Side

NMOCC

ACCEPTED FOR RECORD  
DEC 11 1984  
FARMINGTON RESOURCE AREA