

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER	5. LEASE DESIGNATION AND SERIAL NO. <i>Contract #99</i>
2. NAME OF OPERATOR <i>Mobil Oil Corporation</i>	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR <i>Box 633, Midland, Texas 79701</i>	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface	8. FARM OR LEASE NAME <i>Llano "D"</i>
9. WELL NO. <i>3</i>	10. FIELD AND POOL, OR WILDCAT <i>Blanco Mesa Verde</i>
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA <i>Sec. 13, T-26-N, R-3-W</i>	12. COUNTY OR PARISH <i>Blanco Picture Creek</i>
13. STATE <i>New Mexico</i>	
14. PERMIT NO. <i>UNIT A, 990' FNL + 990' FEL of Sec. 13, T-26-N, R-3-W</i>	15. ELEVATIONS (Show whether DF, RT, GR, etc.) <i>7298 ft</i>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other)

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☒

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other)

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

To Plug & Abandon as Per attached Procedures



U. S. GEOLOGICAL SURVEY
SANGRE DE CRISTO, COLO.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

DATE

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: Sicorilla "D" Well No. 3
Field: Blanco Mesa Verde & Gavilan Pictore Cliffs
County: Rio Arriba State: New Mexico

RECOMMENDED PROCEDURE:


1. Pull short string (PC tbg.) and check long string (MV tbg) in Model D.
2. If long string is free and can pump — spot 100 sx cement to clear tubing and then pull out of Model D packer. (If long string is not free — pull tubing to rerun or consider cut off and spotting plug above packer).
3. Circulate hole to mud laden fluid.
4. Spot 30 sx plug (100') across top of Pictore Cliffs perms, plug top at 3720'.
5. Spot 30 sx plug (100') across est. top of Ojo Alamo at 3400'. 13350'-3450.
6. Check 7 5/8" casing for Free point, cut and pull.
7. Spot 50 sx plug (100') across 7 5/8" stub (50 sx plug 50' below, and 50 sx plug across 10 3/4" casing shoe and surface sands).
8. Spot 10 sx plug at surface.
9. Erect monument and clear location.

Verbally reviewed w/ JCC & USGS

JCG/10-26-71

WBS

17A
 Jicarilla D #3
 Unit A, Sec 13, T26N, R3W
 Rio Arriba County
 New Mexico

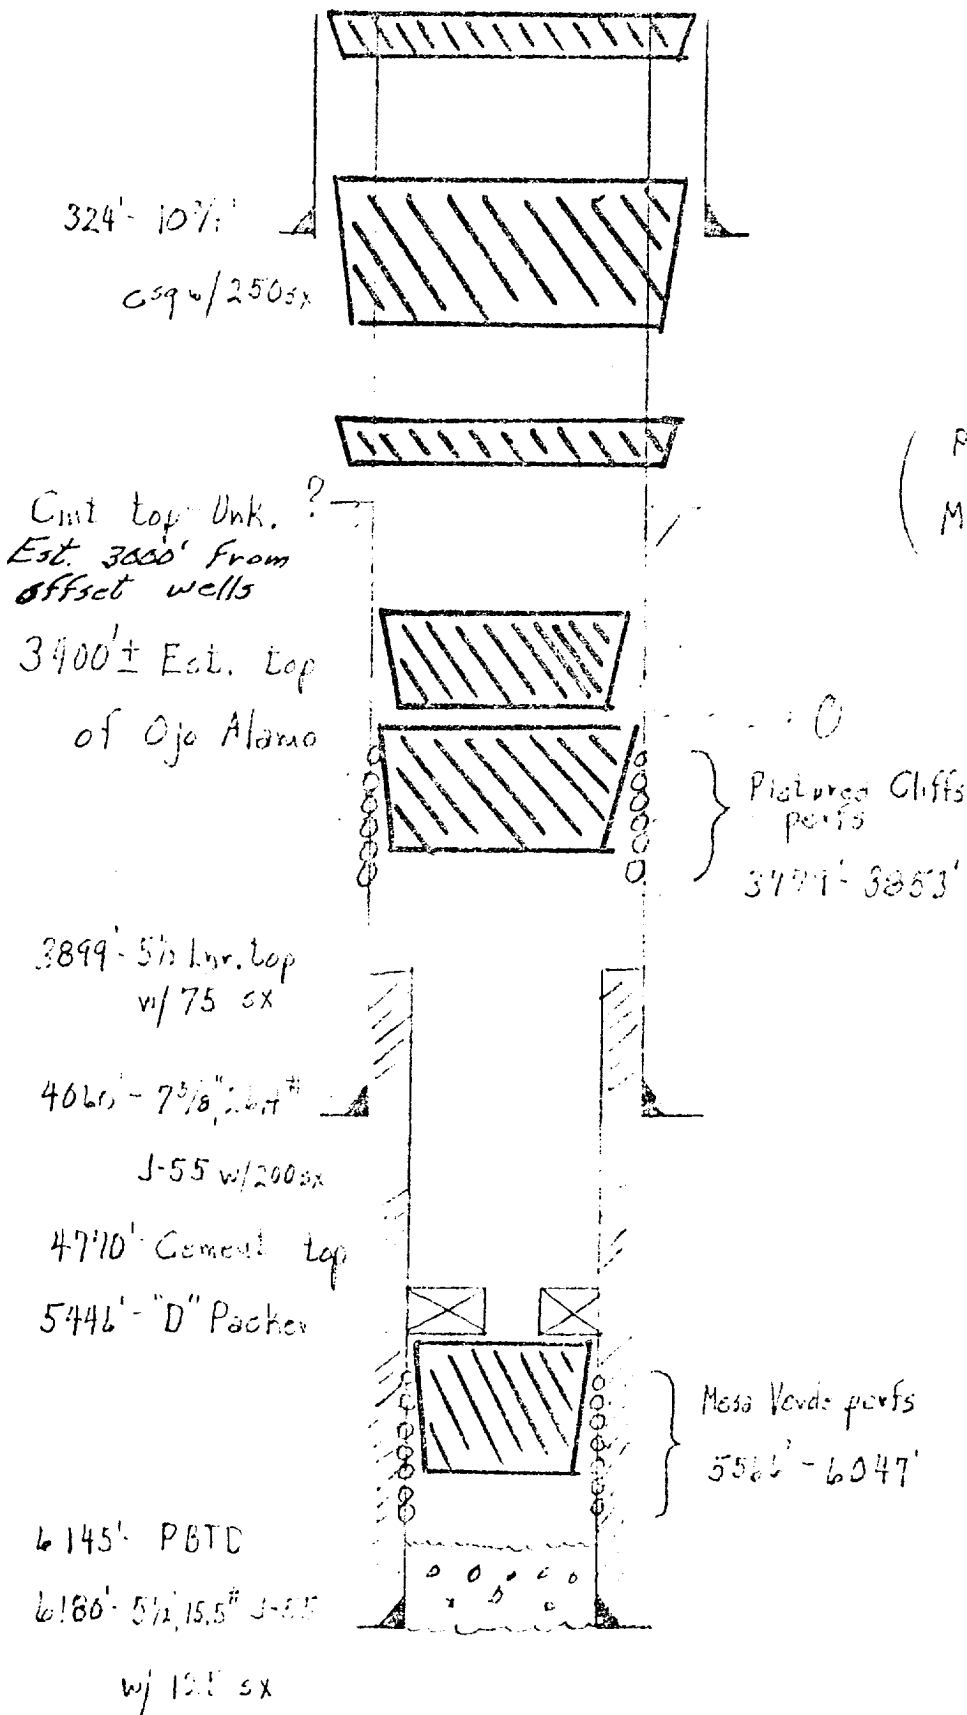

(PC - 2' tbq @ 3774'
 MY - 2' tbq @ 5456 w/ 4 q. valves

Cement plugs .
 1. Mesa Verde
 2. Pisadero Cliff
 3. Ojo Alamo top
 4. Surface sands
 below 10 3/4" and
 7 5/8" stub
 5. Surface

JGG/10-18-71