

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☒ OTHER		6. LEASE DESIGNATION AND SERIAL NO. Jicarilla Cont. 109
2. NAME OF OPERATOR Tenneco Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P. O. Box 1714, Durango, Colorado 81301		Jicarilla Dulce, New Mex.
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1850 FNL, 1150 FEL Unit A		7. UNIT AGREEMENT NAME
14. PERMIT NO.		8. FARM OR LEASE NAME Jicarilla "B"
15. ELEVATIONS (Show whether DF, RT, OR, etc.) 6610 Gr.		9. WELL NO. 7
		10. FIELD AND POOL, OR WILDCAT Dual Basin Dakota & Tapacito Gal
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 16, T-26-N, R-5-W
		12. COUNTY OR PARISH Rio Arriba
		13. STATE New Mexico

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDISE
REPAIR WELL
(Other)

☐
☐
☐
☐
☐

PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS

☐
☐
☐
☐
☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)

☐
☐
☐
☐


REPAIRING WELL
ALTERING CASING
ABANDONMENT*

☐
☐
☐
☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

67
4/29/66. RU. CO to 7633 PBD. Perf 6880 and 6830 w/2 holes. Set cmt retainer at 6871. Treated perfs w/250 gals 15% acid. Circ thru retainer w/100 sx cmt. Perf 6858, 6859, 6860, 12 holes, treat w/750 gals acid. Frac w/30,000 gals oil, 15,000# sd and 3,000# beads. 40 BPM @ 2500#. Swbd. Drld cmt retainer and CO to TD. Set pkr at 7290. Dakota string - 228 jts 2-1/16" tbg, Gallup string 211 jts 2-1/16" tbg hung at 6843. Rel rig 5/4. WO Test.

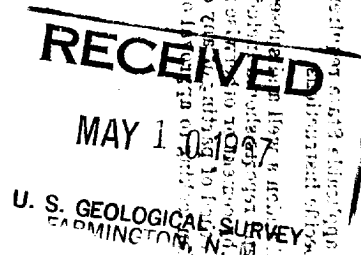

18. I hereby certify that the foregoing is true and correct

SIGNED

G. A. Ford

TITLE

Senior Production Clerk

DATE

May 8, 1967.

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

6 USGS
1 Cont.
1 Atlantic
1 File

TITLE

DATE

*See Instructions on Reverse Side