

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS


(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
well well
2. NAME OF OPERATOR
Tenneco Oil Company
3. ADDRESS OF OPERATOR
P. O. Box 3249, Englewood, Colorado 80155
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1650' FSL, 1650' FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) Repair tubing leak

SUBSEQUENT REPORT OF:

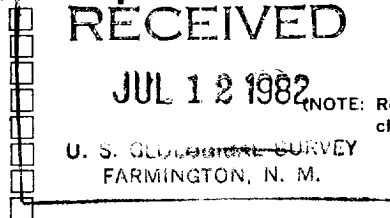

5. LEASE
Contract #109
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
Jicarilla Dulce, NM
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Jicarilla B
9. WELL NO.
6
10. FIELD OR WILDCAT NAME
Basin Dakota
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 22, T26N, R5W
12. COUNTY OR PARISH
Rio Arriba Co., New Mexico
13. STATE
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)
6594' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*
7-2-82: RIH w/ tbg, 3-1/16" collar overshot. Pulled 35 pts. POOH w/tbg. & overshot. Had 8" of tbg. RIH w/tbg. & overshot w/2-3/8" body grapple. Caught fish. Pulled, has 14 jts.
7-3-82: RIH w/tbg & overshot w/2-3/8" body grapple. Milled 3". SD on fish. Pulled 65,000#. Worked the tbg several times. Would not come loose. Called wireline truck. RIH w/back off tool. Could not get down. RIH w/jet cutter. Got down 120', cut tbg, POOH w/fish.
7-5-82: RIH w/2-3/8" overshot. Dressed fish w/guide mill. Set down on top of the fish. Pulled 38,000#. RIH w/wire line & jet cutter. Could not get the jet cutter down past the tool over 5'. Have a severe kink. POOH w/wire line. RIH w/short tool. Cut down length of tube from 46" to 27". Still could not get in hole. POOH w/wireline. Pulled 42,000# - grapple came loose. POOH w/overshot & tbg. Put on new grapple. Rerigged head, RIH w/tbg. & overshot and caught fish. Pulled 68,000#.
Subsurface Safety Valve: Mand. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Denise Wilson TITLE Production Analyst DATE July 8, 1982

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL IF ANY:

TITLE _____ DATE _____

ACCEPTED FOR RECORD

JUL 15 1982



*See Instructions on Reverse Side

MOCC

FARMINGTON DISTRICT
BY [Signature]